

# Expansion of Hong Kong International Airport into a Three-Runway System

Construction Phase Monthly EM&A Report No.44 (For August 2019)

September 2019

Airport Authority Hong Kong

3/F International Trade Tower 348 Kwun Tong Road Kwun Tong Kowloon Hong Kong

T +852 2828 5757 F +852 2827 1823 mottmac.hk

# **Expansion of Hong Kong International Airport into a Three-Runway System**

Construction Phase Monthly EM&A Report No.44 (For August 2019)

September 2019

# This Monthly EM&A Report No. 44 has been reviewed and certified by the Environmental Team Leader (ETL) in accordance with

Condition 3.5 of Environmental Permit No. EP-489/2014.

Certified by:

Terence Kong

Environmental Team Leader (ETL) Mott MacDonald Hong Kong Limited

Date 13 September 2019



AECOM

8/F, Grand Central Plaza, Tower 2, +852 2317 7609 fax 138 Shatin Rural Committee Road, Shatin, Hong Kong 香港新界沙田鄉事會路 138 號新城

市中央廣場第2座8樓 www.aecom.com

+852 3922 9000 tel

Our Ref : 60440482/C/JCHL190913

#### By Email

Airport Authority Hong Kong HKIA Tower, 1 Sky Plaza Road Hong Kong International Airport Lantau, Hong Kong

Attn: Mr. Lawrence Tsui, Principal Manager

13 September 2019

Dear Sir,

Contract No. 3102 **3RS Independent Environmental Checker Consultancy Services** 

#### Submission of Monthly EM&A Report No. 44 (August 2019)

Reference is made to the Environmental Team's submission of the Monthly EM&A Report No. 44 under Condition 3.5 of the Environmental Permit No. EP-489/2014 certified by the ET Leader on 13 September 2019.

We write to verify the captioned submission in accordance with the requirement stipulated in Condition 3.5 of EP-489/2014.

Should you have any query, please feel free to contact the undersigned at 3922 9376.

Yours faithfully, AECOM Asia Co. Ltd.

Jackel Law

Independent Environmental Checker

## **Contents**

Abbr	evia	ations	1
Exec	utiv	ve Summary	3
1	Intro	oduction	7
	1.1	Background	7
	1.2	Scope of this Report	7
	1.3	Project Organisation	7
	1.4	Summary of Construction Works	10
	1.5	Summary of EM&A Programme Requirements	10
2	Air	Quality Monitoring	13
2	2.1	Action and Limit Levels	13
:	2.2	Monitoring Equipment	13
	2.3	Monitoring Methodology	13
		2.3.1 Measuring Procedure	13
		2.3.2 Maintenance and Calibration	14
:	2.4	Summary of Monitoring Results	14
:	2.5	Conclusion	14
3	Noi	se Monitoring	15
;	3.1	Action and Limit Levels	15
;	3.2	Monitoring Equipment	15
;	3.3	Monitoring Methodology	16
		3.3.1 Monitoring Procedure	16
		3.3.2 Maintenance and Calibration	16
;	3.4	Summary of Monitoring Results	16
;	3.5	Conclusion	17
4	Wa	ter Quality Monitoring	18
	4.1	Action and Limit Levels	19
	4.2	Monitoring Equipment	21
	4.3	Monitoring Methodology	21
		4.3.1 Measuring Procedure	21
		4.3.2 Maintenance and Calibration	21
		4.3.3 Laboratory Measurement / Analysis	22
	4.4	Summary of Monitoring Results	22
	4.5	Conclusion	25

5	wa	ste Management	26
	5.1	Action and Limit Levels	26
	5.2	Waste Management Status	26
6	Chi	nese White Dolphin Monitoring	27
	6.1	Action and Limit Levels	27
	6.2	CWD Monitoring Transects and Stations	27
		6.2.1 Small Vessel Line-transect Survey	27
		6.2.2 Land-based Theodolite Tracking Survey	29
	6.3	CWD Monitoring Methodology	29
		6.3.1 Small Vessel Line-transect Survey	29
		6.3.2 Photo Identification	30
	0.4	6.3.3 Land-based Theodolite Tracking Survey	30
	6.4	Monitoring Results and Observations	31
		<ul><li>6.4.1 Small Vessel Line-transect Survey</li><li>6.4.2 Photo Identification</li></ul>	31 34
		6.4.3 Land-based Theodolite Tracking Survey	34
	6.5	Progress Update on Passive Acoustic Monitoring	35
	6.6	Site Audit for CWD-related Mitigation Measures	36
	6.7	Timing of Reporting CWD Monitoring Results	36
	6.8	Summary of CWD Monitoring	36
7	Εn	vironmental Site Inspection and Audit	37
	7.1	Environmental Site Inspection	37
	7.2	Audit of SkyPier High Speed Ferries	38
	7.3	Audit of Construction and Associated Vessels	39
	7.4	Implementation of Dolphin Exclusion Zone	39
	7.5	Status of Submissions under Environmental Permits	40
	7.6	Compliance with Other Statutory Environmental Requirements	40
	7.7	Analysis and Interpretation of Complaints, Notification of Summons and	4.0
		Status of Prosecutions	40
		<ul><li>7.7.1 Complaints</li><li>7.7.2 Notifications of Summons or Status of Prosecution</li></ul>	40 40
		7.7.3 Cumulative Statistics	41
8	Fut	ure Key Issues and Other EIA & EM&A Issues	42
	8.1	Construction Programme for the Coming Reporting Period	42
	8.2	Key Environmental Issues for the Coming Reporting Period	43
	8.3	Monitoring Schedule for the Coming Reporting Period	44
	8.4	Review of the Key Assumptions Adopted in the EIA Report	44
9	Cor	nclusion and Recommendation	45

### Tables

T. I. A. C. A. A. A. A. A. C. A. C.	_
Table 1.1: Contact Information of Key Personnel	8
Table 1.2: Summary of status for all environmental aspects under the Updated EM&A	
Manual Table 2.4. Leasting of Impact Air Quality Manitoring Stations	10
Table 2.1: Locations of Impact Air Quality Monitoring Stations	13
Table 2.2: Action and Limit Levels of Air Quality Monitoring	13
Table 2.3: Air Quality Monitoring Equipment	13
Table 2.4: Summary of Air Quality Monitoring Results	14
Table 3.1: Locations of Impact Noise Monitoring Stations	15
Table 3.2: Action and Limit Levels for Noise Monitoring	15
Table 3.3: Noise Monitoring Equipment	16
Table 3.4: Summary of Construction Noise Monitoring Results	17
Table 4.1: Monitoring Locations and Parameters of Impact Water Quality Monitoring	18
Table 4.2: Action and Limit Levels for General Water Quality Monitoring and Regular	
DCM Monitoring	20
Table 4.3: The Control and Impact Stations during Flood Tide and Ebb Tide for Gener	
Water Quality Monitoring and Regular DCM Monitoring	20
Table 4.4: Water Quality Monitoring Equipment	21
Table 4.5: Other Monitoring Equipment	21
Table 4.6: Laboratory Measurement/ Analysis of SS and Heavy Metals	22
Table 4.7: Summary of SS Compliance Status (Mid-Ebb Tide)	23
Table 4.8: Summary of Findings from Investigation of SS Monitoring Results	23
Table 4.9: Summary of Nickel Compliance Status (Mid-Flood Tide)	24
Table 4.10: Summary of Findings from Investigation of Nickel Monitoring Results	24
Table 5.1: Action and Limit Levels for Construction Waste	26
Table 5.2: Construction Waste Statistics	26
Table 6.1: Derived Values of Action and Limit Levels for Chinese White Dolphin	
Monitoring	27
Table 6.2: Coordinates of Transect Lines in NEL, NWL, AW, WL and SWL Survey Are	eas
	28
Table 6.3: Land-based Theodolite Survey Station Details	29
Table 6.4: Comparison of CWD Encounter Rates of the Whole Survey Area with Actio	n
Levels	33
Table 6.5: Summary of Photo Identification	34
Table 6.6: Summary of Survey Effort and CWD Group of Land-based Theodolite	
Tracking	34
Table 7.1: Summary of Key Audit Findings against the SkyPier Plan	39
Table 7.2: Status of Submissions under Environmental Permit	40

## Figures

Figure 1.1	Locations of Key Construction Activities
Figure 1.2	Latest Layout of the Enhanced Silt Curtain
Figure 2.1	Locations of Air and Noise Monitoring Stations and Chek Lap Kok Wind Station
Figure 4.1a	Water Quality Monitoring Stations
Figure 4.1b	Updated Water Quality Monitoring Stations (Since 8 August 2019)
Figure 6.1	Vessel based Dolphin Monitoring Transects in Construction, Post- construction and Operation Phases
Figure 6.2	Land based Dolphin Monitoring in Baseline and Construction Phases
Figure 6.3	Sightings Distribution of Chinese White Dolphins
Figure 6.4	Plots of First Sightings of All CWD Groups obtained from Land-based Stations
Figure 6.5	Location for Autonomous Passive Acoustic Monitoring
Figure 7.1	Duration of the SkyPier HSFs travelled through the SCZ for August 2019

## **Appendices**

Appendix A	Environmental Mitigation Implementation Schedule (EMIS) for Construction Phase
Appendix B	Monitoring Schedule
Appendix C	Monitoring Results
Appendix D	Calibration Certificates
Appendix E	Status of Environmental Permits and Licences
Appendix F	Cumulative Statistics on Exceedances, Environmental Complaints, Notification of Summons and Status of Prosecutions
Appendix G	Data of SkyPier HSF Movements to/from Zhuhai and Macau (between 1 and 31 August 2019)

## **Abbreviations**

3RS	Three-Runway System		
AAHK	Airport Authority Hong Kong		
AECOM	AECOM Asia Company Limited		
AFCD	Agriculture, Fisheries and Conservation Department		
AIS	Automatic Information System		
ANI	Encounter Rate of Number of Dolphins		
APM	Automated People Mover		
AW	Airport West		
BHS	Baggage Handling System		
C&D	Construction and Demolition		
CAP	Contamination Assessment Plan		
CAR	Contamination Assessment Report		
CNP	Construction Noise Permit		
CWD	Chinese White Dolphin		
DCM	Deep Cement Mixing		
DEZ	Dolphin Exclusion Zone		
DO	Dissolved Oxygen		
EAR	Ecological Acoustic Recorder		
EIA	Environmental Impact Assessment		
EM&A	Environmental Monitoring & Audit		
EP	Environmental Permit		
EPD	Environmental Protection Department		
ET	Environmental Team		
FCZ	Fish Culture Zone		
HDD	Horizontal Directional Drilling		
HKBCF	Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities		
HKIA	Hong Kong International Airport		
HOKLAS			
HSF	Hong Kong Laboratory Accreditation Scheme		
HVS	High Speed Ferry High Volume Sampler		
IEC LKC	Independent Environmental Checker		
	Lung Kwu Chau		
MMHK	Mott MacDonald Hong Kong Limited		
MMWP	Marine Mammal Watching Plan		
MSS	Marine Surveillance System		
MTRMP-CAV	Marine Travel Routes and Management Plan for Construction and Associated Vessel		
NEL	Northeast Lantau		
NWL	Northwest Lantau		
PAM	Passive Acoustic Monitoring		
PVD	Prefabricated Vertical Drain		
SC	Sha Chau		

SCLKCMP	Sha Chau and Lung Kwu Chau Marine Park
SS	Suspended Solids
SSSI	Site of Special Scientific Interest
STG	Encounter Rate of Number of Dolphin Sightings
SWL	Southwest Lantau
T2	Terminal 2
The Project	The Expansion of Hong Kong International Airport into a
	Three-Runway System
The SkyPier Plan	Marine Travel Routes and Management Plan for High Speed
	Ferries of SkyPier
The Manual	The Updated EM&A Manual
TSP	Total Suspended Particulates
WL	West Lantau
WMP	Waste Management Plan

## **Executive Summary**

The "Expansion of Hong Kong International Airport into a Three-Runway System" (the Project) serves to meet the future air traffic demands at Hong Kong International Airport (HKIA). On 7 November 2014, the Environmental Impact Assessment (EIA) Report (Register No.: AEIAR-185/2014) for the Project was approved and an Environmental Permit (EP) (Permit No.: EP-489/2014) was issued for the construction and operation of the Project.

Airport Authority Hong Kong (AAHK) commissioned Mott MacDonald Hong Kong Limited (MMHK) to undertake the role of Environmental Team (ET) for carrying out the Environmental Monitoring & Audit (EM&A) works during the construction phase of the Project in accordance with the Updated EM&A Manual (the Manual).

This is the 44<sup>th</sup> Construction Phase Monthly EM&A Report for the Project which summarizes the monitoring results and audit findings of the EM&A programme during the reporting period from 1 to 31 August 2019.

#### **Key Activities in the Reporting Period**

The key activities of the Project carried out in the reporting period included reclamation works and land-side works. Reclamation works included deep cement mixing (DCM) works, marine filling, and seawall construction. Land-side works involved mainly airfield works, foundation and substructure work for Terminal 2 expansion, modification and tunnel work for Automated People Mover (APM) and Baggage Handling System (BHS), and preparation work for utilities, with activities include site establishment, site office construction, road and drainage works, cable ducting, demolition, piling, and excavation works.

#### **EM&A Activities Conducted in the Reporting Period**


The monthly EM&A programme was undertaken in accordance with the Manual of the Project. Summary of the monitoring activities during this reporting period is presented as below:

Monitoring Activities	Number of Sessions
1-hour Total Suspended Particulates (TSP) air quality monitoring	36
Noise monitoring	20
Water quality monitoring	13
Vessel line-transect surveys for Chinese White Dolphin (CWD) monitoring	2
Land-based theodolite tracking survey effort for CWD monitoring	3

Environmental auditing works, including weekly site inspections of construction works conducted by the ET and bi-weekly site inspections conducted by the Independent Environmental Checker (IEC), audit of SkyPier High Speed Ferries (HSF), audit of construction and associated vessels, and audit of implementation of Marine Mammal Watching Plan (MMWP) and Dolphin Exclusion Zone (DEZ) Plan, were conducted in the reporting period. Based on information including ET's observations, records of Marine Surveillance System (MSS), and contractors' site records, it is noted that environmental pollution control and mitigation measures were properly implemented and construction activities of the Project in the reporting period did not introduce adverse impacts to the sensitive receivers.

#### **Snapshots of EM&A Activities in the Reporting Period**



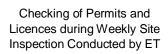



Chemical Spill Drill Conducted by Contractor



Dump Truck with Mechanical Truck Cover Adopted by Contractor for Delivering Dusty Waste Material

#### **Results of Impact Monitoring**

The monitoring works for construction dust, construction noise, water quality, construction waste, landscape & visual, and CWD were conducted during the reporting period in accordance with the Manual.

Monitoring results of construction dust, construction noise, construction waste, and CWD did not trigger the corresponding Action and Limit Levels in the reporting period.

The water quality monitoring results for dissolved oxygen (DO), turbidity, total alkalinity, and chromium obtained during the reporting period were within the corresponding Action and Limit Levels stipulated in the EM&A programme. Relevant investigation and follow-up actions will be conducted according to the EM&A programme if the corresponding Action and Limit Levels are triggered. For suspended solids (SS) and nickel, some testing results triggered the relevant Action or Limit Levels, and the corresponding investigations were conducted accordingly. The investigation findings concluded that the cases were not related to the Project. To conclude, the construction activities in the reporting period did not introduce adverse impact to all water quality sensitive receivers.

#### **Summary of Upcoming Key Issues**

#### **Advanced Works:**

#### Contract P560 (R) Aviation Fuel Pipeline Diversion Works

Stockpiling of compressed materials

#### **DCM Works:**

#### Contract 3205 DCM works

DCM works

#### **Reclamation Works:**

#### **Contract 3206 Main Reclamation Works**

- Land base ground improvement works;
- Seawall construction; and
- Marine filling.

#### **Airfield Works:**

#### **Contract 3301 North Runway Crossover Taxiway**

- Cable ducting works;
- Subgrade compaction and paving works;
- Drainage construction works;
- Operation of aggregate mixing facility; and
- Precast of duct bank and fabrication of steel works.

#### **Contract 3302 Eastern Vehicular Tunnel Advance Works**

- Site survey and cable laying;
- Pavement removal works;
- · Backfilling and reinstatement works; and
- Site establishment.

#### **Contract 3303 Third Runway and Associated Works**

- Plant and equipment mobilization; and
- Site establishment.

#### **Third Runway Concourse and Integrated Airport Centres Works:**

#### **Contract 3402 New Integrated Airport Centres Enabling Works**

- Superstructure works;
- Lateral supports and excavation works;
- Drawpit and duct laying works;
- · Manhole and pipe construction works; and
- Site establishment.

#### **Terminal 2 Expansion Works:**

#### Contract 3501 Antenna Farm and Sewage Pumping Station

- Drainage works;
- Boring works; and
- Pipe installation.

#### Contract 3502 Terminal 2 Automated People Mover (APM) Depot Modification Works

- Site clearance; and
- Fitting out works.

#### **Contract 3503 Terminal 2 Foundation and Substructure Works**

- Site establishment;
- Utilities, drainage, and road work; and
- Piling and structure works.

#### **Automated People Mover (APM) Works:**

#### **Contract 3602 Existing APM System Modification Works**

- Site establishment; and
- Modification works at APM depot.

#### **<u>Airport Support Infrastructure & Logistic Works:</u>**

#### Contract 3801 APM and BHS Tunnels on Existing Airport Island

- Site establishment;
- Cofferdam installation for box culvert;
- Rising main installation;
- Drilling and grouting works;
- Piling and foundation works
- Demolition works; and
- Site clearance.

#### **Summary Table**

The following table summarizes the key findings of the EM&A programme during the reporting period:

	Yes	No	Details	Analysis / Recommendation / Remedial Actions
Breach of Limit Level^		√	No breach of Limit Level was recorded.	Nil
Breach of Action Level^		√	No breach of Action Level was recorded.	Nil
Complaint Received		√	No construction activities-related complaint was received	Nil
Notification of any summons and status of prosecutions		$\sqrt{}$	No notification of summons or prosecution was received.	Nil
Change that affect the EM&A	<b>V</b>		Starting from 8 Aug 2019, one of the water quality sensitive receiver stations was relocated.	Nil

Note:

<sup>^</sup> Only triggering of Action or Limit Level found related to Project works is counted as Breach of Action or Limit Level.

### 1 Introduction

#### 1.1 Background

On 7 November 2014, the Environmental Impact Assessment (EIA) Report (Register No.: AEIAR-185/2014) for the "Expansion of Hong Kong International Airport into a Three-Runway System" (the Project) was approved and an Environmental Permit (EP) (Permit No.: EP-489/2014) was issued for the construction and operation of the Project.

Airport Authority Hong Kong (AAHK) commissioned Mott MacDonald Hong Kong Limited (MMHK) to undertake the role of Environmental Team (ET) for carrying out the Environmental Monitoring & Audit (EM&A) works during the construction phase of the Project in accordance with the Updated EM&A Manual (the Manual) submitted under EP Condition 3.1<sup>1</sup>. AECOM Asia Company Limited (AECOM) was employed by AAHK as the Independent Environmental Checker (IEC) for the Project.

The Project covers the expansion of the existing airport into a three-runway system (3RS) with key project components comprising land formation of about 650 ha and all associated facilities and infrastructure including taxiways, aprons, aircraft stands, a passenger concourse, an expanded Terminal 2, all related airside and landside works and associated ancillary and supporting facilities. The submarine aviation fuel pipelines and submarine power cables also require diversion as part of the works.

Construction of the Project is to proceed in the general order of diversion of the submarine aviation fuel pipelines, diversion of the submarine power cables, land formation, and construction of infrastructure, followed by construction of superstructures.

The updated overall phasing programme of all construction works was presented in Appendix A of the Construction Phase Monthly EM&A Report No. 7 and the contract information was presented in Appendix A of the Construction Phase Monthly EM&A Report No. 42.

#### 1.2 Scope of this Report

This is the 44<sup>th</sup> Construction Phase Monthly EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 1 to 31 August 2019.

#### 1.3 Project Organisation

The Project's organization structure presented in Appendix B of the Construction Phase Monthly EM&A Report No.1 remained unchanged during the reporting period. Contact details of the key personnel are presented in **Table 1.1**.

<sup>&</sup>lt;sup>1</sup> The Manual is available on the Project's dedicated website (accessible at: http://env.threerunwaysystem.com/en/index.html).

**Table 1.1: Contact Information of Key Personnel** 

Party	Position	Name	Telephone
Project Manager's Representative (Airport Authority Hong Kong)	Principal Manager, Environment	Lawrence Tsui	2183 2734
Environmental Team (ET) (Mott MacDonald Hong Kong Limited)	Environmental Team Leader	Terence Kong	2828 5919
	Deputy Environmental Team Leader	Heidi Yu	2828 5704
	Deputy Environmental Team Leader	Daniel Sum	2585 8495
Independent Environmental Checker (IEC) (AECOM Asia Company Limited)	Independent Environmental Checker	Jackel Law	3922 9376
	Deputy Independent Environmental Checker	Roy Man	3922 9141
Advanced Wests			
Advanced Works: Party	Position	Name	Telephone
Contract P560(R) Aviation	Project Manager	Wei Shih	2117 0566
Fuel Pipeline Diversion Works (Langfang Huayuan Mechanical and Electrical Engineering Co., Ltd.)	FTOJECT Manager	Wei Stilli	2117 0300
	Environmental Officer	Lyn Liu	5172 6543
Deep Cement Mixing (D	CM) Works:		
Party	Position	Name	Telephone
Contract 3201 DCM (Package 1) (Penta-Ocean-China State- Dong-Ah Joint Venture)	Project Director	Tsugunari Suzuki	9178 9689
	Environmental Officer	Hiu Yeung Tang	6329 3513
Contract 3205 DCM (Package 5)	Deputy Project Director	Min Park	9683 0765
(Bachy Soletanche - Sambo Joint Venture)	Environmental Officer	William Chan	5408 3045
Reclamation Works:			
Party	Position	Name	Telephone
Contract 3206 Main Reclamation Works (ZHEC-CCCC-CDC Joint Venture)	Project Manager	Kim Chuan Lim	3763 1509
	Environmental Officer	Kwai Fung Wong	3763 1452
		<u> </u>	

#### Airfield Works:

Party	Position	Name	Telephone
Contract 3301 North Runway Crossover Taxiway (FJT-CHEC-ZHEC Joint Venture)	Deputy Project Director	Kin Hang Chung	9800 0048
	Environmental Officer	Nelson Tam	9721 3942
Contract 3302 Eastern Vehicular Tunnel Advance Works (China Road and Bridge Corporation)	Project Manager	Wan Cheung Lee	6100 6075
	Environmental Officer	Wilmer Ng	3919 9421
Contract 3303 Third Runway and Associated Works (SAPR Joint Venture)	Project Manager	Steven Meredith	6109 1813
	Environmental Officer	Pan Fong	9436 9435
Third Runway Concours	se and Integrated Airpo	rt Centres Works:	
Party	Position	Name	Telephone
Contract 3402 New Integrated Airport Centres Enabling Works (Wing Hing Construction Co., Ltd.)	Contract Manager	Michael Kan	9206 0550
00., Ltd.)			

### Terminal 2 (T2) Expansion Works:

Party	Position	Name	Telephone	
Contract 3501 Antenna Farm and Sewage Pumping Station (Build King Construction Ltd.)	Project Manager	Vincent Kwan	9833 1313	
	Environmental Officer	Edward Tam	9287 8270	
Contract 3502 Terminal 2 APM Depot Modification Works (Build King Construction Ltd.)	Project Manager	David Ng	9010 7871	
	Environmental Officer	Chun Pong Chan	9187 7118	
Contract 3503 Terminal 2 Foundation and Substructure Works (Leighton – Chun Wo Joint Venture)	Project Manager	Eric Wu	3973 1718	
	Environmental Officer	Stephen Tsang	5508 6361	

#### **Automated People Mover (APM) Works:**

Party	Position	Name	Telephone
Contract 3602 Existing APM System Modification Works (Niigata Transys Co., Ltd.)	Project Manager	Kunihiro Tatecho	9755 0351
	Environmental Officer	Arthur Wong	9170 3394

#### Baggage Handling System (BHS) Works:

Party	Position	Name	Telephone
Contract 3603 3RS Baggage Handling System (VISH Consortium)	Project Manager	Andy Ng	9102 2739
	Environmental Officer	Eric Ha	9215 3432

#### **Airport Support Infrastructure and Logistic Works:**

Party	Position	Name	Telephone
Contract 3801 APM and BHS Tunnels on Existing Airport Island (China State Construction Engineering (Hong Kong) Ltd.)	Project Manager	Tony Wong	9642 8672
	Environmental Officer	Fredrick Wong	9842 2703

#### 1.4 Summary of Construction Works

The key activities of the Project carried out in the reporting period included reclamation works and land-side works. Reclamation works included deep cement mixing (DCM) works, marine filling, and seawall construction. Land-side works involved mainly airfield works, foundation and substructure work for Terminal 2 expansion, modification and tunnel work for Automated People Mover (APM) and Baggage Handling System (BHS) systems, and preparation work for utilities, with activities include site establishment, site office construction, road and drainage works, cable ducting, demolition of existing facilities, piling, and excavation works.

The locations of key construction activities are presented in **Figure 1.1**. **Figure 1.2** presents the latest layout of enhanced silt curtain deployed and a section of enhanced silt curtain phased out in this reporting period. In accordance with the Silt Curtain Deployment Plan, when a certain section of seawalls were partially completed with rock core to high tide mark and filter layer on the inner side, and an overlapping length of at least 150m for seawall and enhanced silt curtain was maintained, the enhanced silt curtain would be phased out.

#### 1.5 Summary of EM&A Programme Requirements

The status for all environmental aspects are presented in **Table 1.2**. The EM&A requirements remained unchanged during the reporting period and details can be referred to Table 1.2 of the Construction Phase Monthly EM&A Report No. 1.

Table 1.2: Summary of status for all environmental aspects under the Updated EM&A Manual

Parameters	Status
Air Quality	
Baseline Monitoring	The baseline air quality monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4.
Impact Monitoring	On-going
Noise	

Parameters	Status
Baseline Monitoring	The baseline noise monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4.
Impact Monitoring	On-going On-going
Water Quality	
General Baseline Water Quality Monitoring for reclamation, water jetting and field joint works	The baseline water quality monitoring result has been reported in Baseline Water Quality Monitoring Report and submitted to EPD under EP Condition 3.4.
General Impact Water Quality Monitoring for reclamation, water jetting and field joint works	On-going
Initial Intensive Deep Cement Mixing (DCM) Water Quality Monitoring	The Initial Intensive DCM Monitoring Report was submitted and approved by EPD in accordance with the Detailed Plan on DCM.
Regular DCM Water Quality Monitoring	On-going Control of the control of t
Waste Management	
Waste Monitoring	On-going
Land Contamination	
Supplementary Contamination Assessment Plan (CAP)	The Supplementary CAP was submitted to EPD pursuant to EP Condition 2.20.
Contamination Assessment Report (CAR) for Golf Course	The CAR for Golf Course was submitted to EPD.
Terrestrial Ecology	
Pre-construction Egretry Survey Plan	The Egretry Survey Plan was submitted and approved by EPD under EP Condition 2.14.
Ecological Monitoring	The terrestrial ecological monitoring at Sheung Sha Chau was completed in January 2019.
Marine Ecology	
Pre-Construction Phase Coral Dive Survey	The Coral Translocation Plan was submitted and approved by EPD under EP Condition 2.12.
Coral Translocation	The coral translocation was completed.
Post-Translocation Coral Monitoring	The post-translocation monitoring programme according to the Coral Translocation Plan was completed in April 2018.
Chinese White Dolphins (CWD)	
Vessel Survey, Land-based Theodolite Tracking and Passive Acoustic Monitoring (PAM)	
Baseline Monitoring	Baseline CWD results were reported in the CWD Baseline Monitoring Report and submitted to EPD in accordance with EP Condition 3.4.
Impact Monitoring	On-going
Landscape & Visual	
Landscape & Visual Plan	The Landscape & Visual Plan was submitted to EPD under EP Condition 2.18
Baseline Monitoring	The baseline landscape & visual monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4.
Impact Monitoring	On-going On-going
Environmental Auditing	
Regular site inspection	On-going On-going
Marine Mammal Watching Plan (MMWP) implementation measures	On-going
Dolphin Exclusion Zone (DEZ) Plan implementation measures	On-going
SkyPier High Speed Ferries (HSF) implementation measures	On-going
Construction and Associated Vessels	On-going On-going

Parameters	Status
Complaint Hotline and Email channel	On-going
Environmental Log Book	On-going

Taking into account the construction works in this reporting period, impact monitoring of air quality, noise, water quality, waste management, landscape & visual, and CWD were carried out in the reporting period.

The EM&A programme also involved weekly site inspections and related auditing conducted by the ET for checking the implementation of the required environmental mitigation measures recommended in the approved EIA Report. To promote the environmental awareness and enhance the environmental performance of the contractors, environmental trainings and regular environmental management meetings were conducted during the reporting period, which are summarized as below:

- Two skipper training sessions provided by ET: 8 and 28 August 2019
- One dolphin observer training session provided by ET: 28 August 2019
- Nine environmental management meetings for EM&A review with works contracts: 1, 20, 21, 22, 27, 29, and 30 August 2019

The EM&A programme has been following the recommendations presented in the approved EIA Report and the Manual. A summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix A**.

## 2 Air Quality Monitoring

Air quality monitoring of 1-hour Total Suspended Particulates (TSP) was conducted three times every six days at two representative monitoring stations in the vicinity of air sensitive receivers in Tung Chung and villages in North Lantau in accordance with the Manual. **Table 2.1** describes the details of the monitoring stations. **Figure 2.1** shows the locations of the monitoring stations.

**Table 2.1: Locations of Impact Air Quality Monitoring Stations** 

Monitoring Station	Location
AR1A	Man Tung Road Park
AR2	Village House at Tin Sum

#### 2.1 Action and Limit Levels

In accordance with the Manual, baseline air quality monitoring of 1-hour TSP levels at the two air quality monitoring stations were established as presented in the Baseline Monitoring Report. The Action and Limit Levels of the air quality monitoring stipulated in the EM&A programme for triggering the relevant investigation and follow-up procedures under the programme are provided in **Table 2.2**.

Table 2.2: Action and Limit Levels of Air Quality Monitoring

Monitoring Station	Action Level (μg/m³)	Limit Level (μg/m³)
AR1A	306	500
AR2	298	

#### 2.2 Monitoring Equipment

Portable direct reading dust meter was used to carry out the air quality monitoring. Details of equipment used in the reporting period are given in **Table 2.3**.

**Table 2.3: Air Quality Monitoring Equipment** 

Equipment	Brand and Model	Last Calibration Date	Calibration Certificate Provided in
Portable direct reading dust meter (Laser dust monitor)	SIBATA LD-3B-1 (Serial No. 597337)	2 Oct 2018	Monthly EM&A Report No. 35, Appendix D
	SIBATA LD-3B-2 (Serial No. 296098)	16 Oct 2018	

#### 2.3 Monitoring Methodology

#### 2.3.1 Measuring Procedure

The measurement procedures involved in the impact air quality monitoring can be summarised as follows:

a. The portable direct reading dust meter was mounted on a tripod at a height of 1.2 m above the ground.

- b. Prior to the measurement, the equipment was set up for 1 minute span check and 6 second background check.
- c. The one hour dust measurement was started. Site conditions and dust sources at the nearby area were recorded on a record sheet.
- d. When the measurement completed, the "Count" reading per hour was recorded for result calculation.

#### 2.3.2 Maintenance and Calibration

The portable direct reading dust meter is calibrated every year against high volume sampler (HVS) to check the validity and accuracy of the results measured by direct reading method. The calibration record of the HVS provided in Appendix D of the Construction Phase Monthly EM&A Report No. 35, and the calibration certificates of portable direct reading dust meters listed in **Table 2.3** are still valid.

#### 2.4 Summary of Monitoring Results

The air quality monitoring schedule involved in the reporting period is provided in **Appendix B**. The air quality monitoring session on 31 July 2019 was rescheduled to 2 August 2019 due to Strong Wind Signal No. 3 in force.

The air quality monitoring results in the reporting period are summarized in **Table 2.4**. Detailed impact monitoring results are presented in **Appendix C**.

**Table 2.4: Summary of Air Quality Monitoring Results** 

Monitoring Station	1-hr TSP Concentration Range (μg/m³)	Action Level (μg/m³)	Limit Level (μg/m³)
AR1A	16 – 99	306	500
AR2	15 – 91	298	

The monitoring results were within the corresponding Action and Limit Levels at all monitoring stations in the reporting period.

General meteorological conditions throughout the impact monitoring period were recorded. Wind data including wind speed and wind direction for each monitoring day were collected from the Chek Lap Kok Wind Station.

#### 2.5 Conclusion

No dust emission source from Project activities was observed during impact air quality monitoring. No major sources of dust was observed at the monitoring stations during the monitoring sessions. It is considered that the monitoring work in the reporting period is effective and there was no adverse impact attributable to the Project activities.

## 3 Noise Monitoring

Noise monitoring in the form of 30-minute measurements of  $L_{eq}$ ,  $L_{10}$ , and  $L_{90}$  levels was conducted once per week between 0700 and 1900 on normal weekdays at four representative monitoring stations in the vicinity of noise sensitive receivers in Tung Chung and villages in North Lantau in accordance with the Manual. **Table 3.1** describes the details of the monitoring stations. **Figure 2.1** shows the locations of the monitoring stations.

**Table 3.1: Locations of Impact Noise Monitoring Stations** 

<b>Monitoring Station</b>	Location	Type of measurement
NM1A	Man Tung Road Park	Free field
NM2 <sup>(1)</sup>	Tung Chung West Development	To be determined
NM3A <sup>(2)</sup>	Site Office	Facade
NM4	Ching Chung Hau Po Woon Primary School	Free field
NM5	Village House in Tin Sum	Free field
NM6	House No. 1, Sha Lo Wan	Free field

Note:

- (1) As described in Section 4.3.3 of the Manual, noise monitoring at NM2 will only commence after occupation of the future Tung Chung West Development.
- (2) According to Section 4.3.3 of the Manual, the noise monitoring at NM3A was temporarily suspended starting from 1 Sep 2018 and would be resumed with the completion of the Tung Chung East Development.

#### 3.1 Action and Limit Levels

In accordance with the Manual, baseline noise levels at the noise monitoring stations were established as presented in the Baseline Monitoring Report. The Action and Limit Levels of the noise monitoring stipulated in the EM&A programme for triggering the relevant investigation and follow-up procedures under the programme are provided in **Table 3.2**.

Table 3.2: Action and Limit Levels for Noise Monitoring

Monitoring Stations	Time Period	Action Level	Limit Level, L <sub>eq(30mins)</sub> dB(A)
NM1A, NM2, NM3A, NM4, NM5 and NM6	0700-1900 hours on normal weekdays	When one documented complaint is received from any one of the sensitive receivers	75 dB(A) <sup>(1)</sup>

Note:

(1) Reduced to 70dB(A) for school and 65dB(A) during school examination periods for NM4.

#### 3.2 Monitoring Equipment

Noise monitoring was performed using sound level meter at each designated monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was used to check the sound level meters by a known sound pressure level for field measurement. Details of equipment used in the reporting period are given in **Table 3.3**.

**Table 3.3: Noise Monitoring Equipment** 

Equipment	Brand and Model	Last Calibration Date	Calibration Certificate Provided in
Integrated Sound Level Meter	Rion NL-52 (Serial No. 01287679)	6 Feb 2019	Monthly EM&A Report No. 39, Appendix D
	NTi XL2 (Serial No. A2A-14829-E0)	14 July 2019	Monthly EM&A Report No. 43, Appendix D
Acoustic Calibrator	Casella CEL-120/1 (Serial No. 2383737)	17 Oct 2018	Monthly EM&A Report No. 35, Appendix D
	Castle GA607 (Serial No. 040162)	14 July 2019	Monthly EM&A Report No. 43, Appendix D

#### 3.3 Monitoring Methodology

#### 3.3.1 Monitoring Procedure

The monitoring procedures involved in the noise monitoring can be summarised as follows:

- a. The sound level meter was set on a tripod at least a height of 1.2 m above the ground for free-field measurements at monitoring stations NM1A, NM4, NM5 and NM6. A correction of +3 dB(A) was applied to the free field measurements.
- b. Façade measurements were made at the monitoring station NM3A.
- c. Parameters such as frequency weighting, time weighting and measurement time were set.
- d. Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- e. During the monitoring period, L<sub>eq</sub>, L<sub>10</sub> and L<sub>90</sub> were recorded. In addition, site conditions and noise sources were recorded on a record sheet.
- f. Noise measurement results were corrected with reference to the baseline monitoring levels.
- g. Observations were recorded when high intrusive noise (e.g. dog barking, helicopter noise) was observed during the monitoring.

#### 3.3.2 Maintenance and Calibration

The maintenance and calibration procedures are summarised below:

- a. The microphone head of the sound level meter was cleaned with soft cloth at regular intervals.
- b. The meter and calibrator were sent to the supplier or laboratory accredited under Hong Kong Laboratory Accreditation Scheme (HOKLAS) to check and calibrate at yearly intervals.

Calibration certificates of the sound level meters and acoustic calibrators used in the noise monitoring listed in **Table 3.3** are still valid.

#### 3.4 Summary of Monitoring Results

The noise monitoring schedule involved in the reporting period is provided in **Appendix B**.

The noise monitoring results in the reporting period are summarized in **Table 3.4**. Detailed impact monitoring results are presented in **Appendix C**.

**Table 3.4: Summary of Construction Noise Monitoring Results** 

<b>Monitoring Station</b>	Noise Level Range, dB(A)	Limit Level, dB(A)	
	Leq (30 mins)	Leq (30 mins)	
NM1A <sup>(1)</sup>	67 – 72	75	
NM4 <sup>(1)</sup>	59 – 65	70 <sup>(2)</sup>	
NM5 <sup>(1)</sup>	55 – 64	75	
NM6 <sup>(1)</sup>	66 – 68	75	

#### Notes:

- (1) +3 dB(A) Façade correction included;
- (2) Reduced to 65 dB(A) during school examination periods at NM4. No school examination took place during this reporting period.

No complaints were received from any sensitive receiver that triggered the Action Level. All monitoring results were also within the corresponding Limit Levels at all monitoring stations in the reporting period.

#### 3.5 Conclusion

As the construction activities were far away from the monitoring stations, major sources of noise dominating the monitoring stations observed during the construction noise impact monitoring were traffic noise near NM1A and aircraft noise near NM6 during this reporting period. It is considered that the monitoring work during the reporting period was effective and there was no adverse impact attributable to the Project activities.

## 4 Water Quality Monitoring

Water quality monitoring of DO, pH, temperature, salinity, turbidity, suspended solids (SS), total alkalinity, chromium, and nickel was conducted three days per week, at mid-ebb and mid-flood tides, at a total of 23 water quality monitoring stations, comprising 12 impact (IM) stations, 8 sensitive receiver (SR) stations and 3 control (C) stations in the vicinity of water quality sensitive receivers around the airport island in accordance with the Manual. The purpose of water quality monitoring at the IM stations is to promptly capture any potential water quality impact from the Project before it could become apparent at sensitive receivers (represented by the SR stations). **Table 4.1** describes the details of the monitoring stations. **Figure 4.1a** shows the locations of the monitoring stations. The monitoring location of SR6 has been shifted to SR6A starting from 8 August 2019 as the access to SR6 was obstructed by construction activities and temporary structures for Tung Chung New Town Extension. The updated monitoring locations are presented in **Figure 4.1b**.

Table 4.1: Monitoring Locations and Parameters of Impact Water Quality Monitoring

Monitoring Station	Description		Coordinates	Parameters		
		Easting	Northing			
C1	Control Station	804247	815620	General Parameters		
C2	Control Station	806945	825682	DO, pH, Temperature,		
C3 <sup>(3)</sup>	Control Station	817803	822109	Salinity, Turbidity, SS		
IM1	Impact Station	807132	817949	DCM Parameters		
IM2	Impact Station	806166	818163	Total Alkalinity, Heavy		
IM3	Impact Station	805594	818784	Metals <sup>(2)</sup>		
IM4	Impact Station	804607	819725			
IM5	Impact Station	804867	820735			
IM6	Impact Station	805828	821060			
IM7	Impact Station	806835	821349			
IM8	Impact Station	808140	821830			
IM9	Impact Station	808811	822094			
IM10	Impact Station	809794	822385			
IM11	Impact Station	811460	822057			
IM12	Impact Station	812046	821459			
SR1A <sup>(1)</sup>	Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) Seawater Intake for cooling	812660	819977	General Parameters DO, pH, Temperature, Salinity, Turbidity, SS		
SR2 <sup>(3)</sup>	Planned marine park / hard corals at The Brothers / Tai Mo To	814166	821463	General Parameters DO, pH, Temperature, Salinity, Turbidity, SS  DCM Parameters		
SR3	Sha Chau and Lung Kurr	907571	922447	Total Alkalinity, Heavy Metals <sup>(2)(4)</sup>		
<u></u>	Sha Chau and Lung Kwu Chau Marine Park / fishing	807571	822147	General Parameters		

Monitoring Station	Description		Coordinates	Parameters
	and spawning grounds in North Lantau			DO, pH, Temperature, Salinity, Turbidity, SS
SR4A	Sha Lo Wan	807810	817189	
SR5A	San Tau Beach SSSI	810696	816593	
SR6 <sup>(5)</sup>	Tai Ho Bay, Near Tai Ho	814663	817899	
SR6A <sup>(5)</sup>	Stream SSSI	814739	817963	
SR7	Ma Wan Fish Culture Zone (FCZ)	823742	823636	
SR8 <sup>(6)</sup>	Seawater Intake for cooling at Hong Kong International Airport (East)	811623	820390	

#### Notes:

- (1) With the operation of HKBCF, water quality monitoring at SR1A station was commenced on 25 October 2018. To better reflect the water quality in the immediate vicinity of the intake, the monitoring location of SR1A has been shifted closer to the intake starting from 5 January 2019.
- (2) Details of selection criteria for the two heavy metals for regular DCM monitoring refer to the Detailed Plan on Deep Cement Mixing available on the dedicated 3RS website (http://env.threerunwaysystem.com/en/ep-submissions.html). DCM specific water quality monitoring parameters (total alkalinity and heavy metals) were only conducted at C1 to C3, SR2, and IM1 to IM12.
- (3) According to the Baseline Water Quality Monitoring Report, C3 station is not adequately representative as a control station of impact/ SR stations during the flood tide. The control reference has been changed from C3 to SR2 from 1 September 2016 onwards.
- (4) Total alkalinity and heavy metals results are collected at SR2 as a control station for regular DCM monitoring.
- (5) As the access to SR6 was obstructed by the construction activities and temporary structures for Tung Chung New Town Extension, the monitoring location has been relocated to SR6A starting from 8 August 2019.
- (6) The monitoring location for SR8 is subject to further changes due to silt curtain arrangements and the progressive relocation of this seawater intake.

#### 4.1 Action and Limit Levels

In accordance with the Manual, baseline water quality levels at the abovementioned representative water quality monitoring stations were established as presented in the Baseline Water Quality Monitoring Report. The Action and Limit Levels of general water quality monitoring and regular DCM monitoring stipulated in the EM&A programme for triggering the relevant investigation and follow-up procedures under the programme are provided in **Table 4.2**. The control and impact stations during ebb tide and flood tide for general water quality monitoring and regular DCM monitoring are presented in **Table 4.3**.

Table 4.2: Action and Limit Levels for General Water Quality Monitoring and Regular DCM Monitoring

Parameter	'S	Action Level (A	L)	Limit Level (	LL)		
	Limit Levels for genera SR1A & SR8)	l water quality moi	nitoring and regular	DCM monitorin	g		
General Water Quality Monitoring	DO in mg/L (Surface, Middle & Bottom)	Surface and Middle 4.5 mg/L		Surface and Middle 4.1 mg/L 5 mg/L for Fish Culture Zone (SR7) only			
		Bottom 3.4 mg/L		Bottom 2.7 mg/L			
	Suspended Solids (SS) in mg/L	23	or 120% of upstream control	37	or 130% of upstream control		
	Turbidity in NTU	22.6	station at the same tide of the	36.1	station at the		
	Total Alkalinity in ppm			99	same day,		
Regular DCM Monitoring	Representative Heavy Metals for regular DCM monitoring (Chromium) in µg/L	0.2	whichever is higher	0.2	whichever is higher		
	Representative Heavy Metals for regular DCM monitoring (Nickel) in µg/L	3.2		3.6			
Action and	Limit Levels SR1A						
SS (mg/l)		33		42			
Action and	Limit Levels SR8						
SS (mg/l)		52		60			

#### Notes:

- (1) For DO measurement, non-compliance occurs when monitoring result is lower than the limits.
- (2) For parameters other than DO, non-compliance of water quality results when monitoring results is higher than
- (3) Depth-averaged results are used unless specified otherwise.
- (4) Details of selection criteria for the two heavy metals for regular DCM monitoring refer to the Detailed Plan on Deep Cement Mixing available on the dedicated 3RS website (<a href="http://env.threerunwaysystem.com/en/ep-submissions.html">http://env.threerunwaysystem.com/en/ep-submissions.html</a>)
- (5) The Action and Limit Levels for the two representative heavy metals chosen will be the same as that for the intensive DCM monitoring.

Table 4.3: The Control and Impact Stations during Flood Tide and Ebb Tide for General Water Quality Monitoring and Regular DCM Monitoring

<b>Control Station</b>	Impact Stations
Flood Tide	
C1	IM1, IM2, IM3, IM4, IM5, IM6, IM7, IM8, SR3
SR2 <sup>(1)</sup>	IM7, IM8, IM9, IM10, IM11, IM12, SR1A, SR3, SR4A, SR5A, SR6, SR6A, SR8
Ebb Tide	
C1	SR4A, SR5A, SR6, SR6A
C2	IM1, IM2, IM3, IM4, IM5, IM6, IM7, IM8, IM9, IM10, IM11, IM12, SR1A, SR2, SR3, SR7, SR8

#### Note:

(1) As per findings of Baseline Water Quality Monitoring Report, the control reference has been changed from C3 to SR2 from 1 Sep 2016 onwards.

#### 4.2 Monitoring Equipment

**Table 4.4** summarises the equipment used in the reporting period for monitoring of specific water quality parameters under the water quality monitoring programme.

**Table 4.4: Water Quality Monitoring Equipment** 

Equipment	Brand and Model	Last Calibration Date	Calibration Certificate Provided in
Multifunctional Meter (measurement of DO, pH,	YSI ProDSS (Serial No. 17E100747)	25 Jun 2019	Monthly EM&A Report No. 42,
	YSI ProDSS (Serial No. 15M100005)	25 Jun 2019	Appendix E
temperature, salinity and turbidity)	YSI 6920V2 (Serial No. 0001C6A7)	24 Jul 2019	Monthly EM&A Report No. 43,
tarbianty)	YSI 6920V2 (Serial No. 00019CB2)	24 Jul 2019	Appendix D
	YSI 6920V2 (Serial No. 17H105557)	2 Aug 2019	Appendix D
	YSI 6920V2 (Serial No. 18A104824)	2 Aug 2019	_
Digital Titrator	Titrette Digital Burette 50ml Class A	19 Jun 2019	Appendix D
(measurement of total alkalinity)	(Serial No. 10N65665)		

Other equipment used as part of the impact water quality monitoring programme are listed in **Table 4.5**.

**Table 4.5: Other Monitoring Equipment** 

Equipment	Brand and Model
Water Sampler	Van Dorn Water Sampler
Positioning Device (measurement of GPS)	Garmin eTrex Vista HCx
Current Meter (measurement of current speed and direction, and water depth)	Sontek HydroSurveyor

#### 4.3 Monitoring Methodology

#### 4.3.1 Measuring Procedure

Water quality monitoring samples were taken at three depths (at 1m below surface, at mid-depth, and at 1m above bottom) for locations with water depth >6m. For locations with water depth between 3m and 6m, water samples were taken at two depths (surface and bottom). For locations with water depth <3m, only the mid-depth was taken. Duplicate water samples were taken and analysed.

The water samples for all monitoring parameters were collected, stored, preserved and analysed according to the Standard Methods, APHA 22<sup>nd</sup> ed. and/or other methods as agreed by the EPD. In-situ measurements at monitoring locations including temperature, pH, DO, turbidity, salinity, alkalinity and water depth were collected by equipment listed in **Table 4.4** and **Table 4.5**. Water samples for heavy metals and SS analysis were stored in high density polythene bottles with no preservative added, packed in ice (cooled to 4 °C without being frozen), delivered to the laboratory within 24 hours of collection.

#### 4.3.2 Maintenance and Calibration

#### Calibration of In-situ Instruments

All in-situ monitoring instrument were checked, calibrated and certified by a laboratory accredited under HOKLAS before use. Responses of sensors and electrodes were checked with certified standard solutions before each use.

Wet bulb calibration for a DO meter was carried out before commencement of monitoring and after completion of all measurements each day. Calibration was not conducted at each monitoring location as daily calibration is adequate for the type of DO meter employed. A zero check in distilled water was performed with the turbidity probe at least once per monitoring day. The probe was then calibrated with a solution of known NTU. In addition, the turbidity probe was calibrated at least twice per month to establish the relationship between turbidity readings (in NTU) and levels of SS (in mg/L). Accuracy check of the digital titrator was performed at least once per monitoring day.

Calibration certificates of the monitoring equipment used in the reporting period listed in **Table 4.4** are still valid.

#### 4.3.3 Laboratory Measurement / Analysis

Analysis of SS and heavy metals have been carried out by a HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (Reg. No. HOKLAS 066). Sufficient water samples were collected at all the monitoring stations for carrying out the laboratory SS and heavy metals determination. The SS and heavy metals determination works were started within 24 hours after collection of the water samples. The analysis of SS and heavy metals have followed the standard methods summarised in **Table 4.6**. The QA/QC procedures for laboratory measurement/ analysis of SS and heavy metals were presented in Appendix F of the Construction Phase Monthly EM&A Report No.8.

Table 4.6: Laboratory Measurement/ Analysis of SS and Heavy Metals

Parameters	Instrumentation	<b>Analytical Method</b>	Reporting Limit
SS	Analytical Balance	APHA 2540D	2 mg/L
Heavy Metals			
Chromium (Cr)	ICP-MS	USEPA 6020A	0.2 μg/L
Nickel (Ni)	ICP-MS	USEPA 6020A	0.2 μg/L

#### 4.4 Summary of Monitoring Results

The water quality monitoring schedule for the reporting period is updated and provided in **Appendix B**.

The water quality monitoring results for DO, turbidity, total alkalinity and chromium obtained during the reporting period were within their corresponding Action and Limit Level. The detailed monitoring results are presented in **Appendix C**.

For SS and nickel, some of the testing results triggered the corresponding Action or Limit Levels, and investigations were conducted accordingly.

**Table 4.7** present the summary of the SS compliance status at IM and SR stations during midebb tide for the reporting period.

Table 4.7: Summary of SS Compliance Status (Mid-Ebb Tide)

	IM1	IM2	IM3	IM4	IM5	IM6	IM7	IM8	IM9	IM10	IM11	IM12	SR1A	SR2	SR3	SR4A	SR5A	SR6/ SR6A*	SR7	SR8
03/08/2019																				
06/08/2019																				
08/08/2019																				
10/08/2019																				
13/08/2019																				
15/08/2019																				
17/08/2019																				
20/08/2019																				
22/08/2019																				
24/08/2019																				
27/08/2019																				
29/08/2019																				
31/08/2019			D															D		
No. of result triggereing Action or Limit Level	0	0	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	1	0	(

Note\*: SR6 has been relocated to SR6A starting from 8 August 2019.

Legend:

D

The monitoring results were within the corresponding Action and Limit Levels

Monitoring result triggered the Action Level at monitoring station located downstream of the Project based on dominant tidal flow

Upstream station with respect to the Project during the respective tide based on dominant tidal flow

Monitoring results triggered the corresponding Action Levels on 31 August 2019. Details of the Project's marine construction activities and site observations on the concerned monitoring day were collected. The findings are summarized in **Table 4.8**.

Table 4.8: Summary of Findings from Investigation of SS Monitoring Results

Date	Marine construction works nearby	Approximate distance from marine construction works	Status of water quality measures (if applicable)	Construction vessels in the vicinity	Turbidity / Silt plume observed near the monitoring station	Action or Limit Level triggered due to Project
31/08/2019	Marine filling and DCM works	Around 1 km	Localised and enhanced silt curtain deployed	No	No	No

The investigation confirmed that marine filling and DCM works were operating normally on 31 August 2019 with localised and enhanced silt curtains deployed. The localised and enhanced silt curtains were maintained properly and checked by ET regularly. Contractor had followed up and carried out silt curtain maintenance when defects were identified by ET or Contractor.

During ebb tide, SR6A was located downstream of impact stations including IM11 and IM12 which were closer to the Project area, but the SS concentrations at these stations were well below the corresponding Action and Limit Levels. This suggest the existence of non-Project related sources that may affect SS concentration in that area. Other than IM3, the SS concentration at all other impact monitoring stations were within their corresponding Action and Limit Levels. The cases at IM3 and SR6A therefore appeared to be isolated cases with no observable temporal and spatial trend to indicate any effect due to Project activities. With no observable silt plume during marine

works and mitigation measures implemented properly, cases at both stations were considered not due to Project.

**Table 4.9** presents the summary of the nickel compliance status at IM stations during mid-flood tide for the reporting period.

Table 4.9: Summary of Nickel Compliance Status (Mid-Flood Tide)

1 abio 110. Ca		<b>,</b>		<del></del>				1			,	
	IM1	IM2	IM3	IM4	IM5	IM6	IM7	IM8	IM9	IM10	IM11	IM12
03/08/2019												
06/08/2019												
08/08/2019												
10/08/2019					D	D	D					
13/08/2019												
15/08/2019												
17/08/2019												
20/08/2019												
22/08/2019												
24/08/2019												
27/08/2019												
29/08/2019												
31/08/2019												
No. of result triggereing Action or Limit Level	1	0	0	0	1	1	1	0	0	0	0	0

Note: Detailed results are presented in <b>Appendix C</b> .				
Legend:				
	The monitoring results were within the corresponding Action and Limit Levels			
	Monitoring result triggered the Limit Level at monitoring station located upstream of the Project based on dominant tidal flow			
D	Monitoring result triggered the Limit Level at monitoring station located downstream of the Project based on dominant tidal flow			
	Upstream station with respect to the Project during the respective tide based on dominant tidal flow			

Nickel monitoring results triggered the corresponding Limit Levels on 10 August 2019. One of the cases occurred at monitoring station upstream of the Project during respective tide and would unlikely be affected by the Project. Investigation was therefore focused on cases that occurred at monitoring station located downstream of the Project. Details of the Project's marine construction activities and site observations on the concerned monitoring day were collected. The findings are summarized in **Table 4.10**.

Table 4.10: Summary of Findings from Investigation of Nickel Monitoring Results

Date	Marine construction works nearby		Status of water quality measures (if applicable)	Construction vessels in the vicinity		Action or Limit Level triggered due to Project
10/08/2019	Marine filling	Around 0.5 km	Localised and enhanced silt curtain deployed	No	No	No

The investigation confirmed that DCM works and marine filling were operating normally with localised and enhanced silt curtain deployed. The localised and enhanced silt curtains were maintained properly and checked by ET regularly.

Nickel is a representative heavy metal that indicates the potential for release of contaminants from contaminated mud pits due to the disturbance of marine sediment within it by DCM activities. Elevated nickel concentration due to these activities should be associated with similar elevated SS levels. The SS results at IM5, IM6 and IM7 were within the Action and Limit Levels and they were located more than 2km away from the closest active DCM barge. These indicate that active DCM works had limited influence on water quality when monitoring were conducted at these monitoring stations. Considering that no silt plume was observed at the monitoring stations and mitigation measures were implemented properly, the cases recorded at these impact stations were considered not caused by the Project.

#### 4.5 Conclusion

During the reporting period, it is noted that the vast majority of monitoring results were within their corresponding Action and Limit Levels, while only a minor number of results triggered the corresponding Action or Limit Levels, and investigations were conducted accordingly.

Based on the investigation findings, all results that triggered the corresponding Action or Limit Levels were not due to the Project. Therefore, the Project did not cause adverse impact at the water quality sensitive receivers. All required actions under the Event and Action Plan were followed. These cases appeared to be due to natural fluctuation or other sources not related to the Project.

Nevertheless, as part of the EM&A programme, the construction methods and mitigation measures for water quality will continue to be monitored and opportunities for further enhancement will continue to be explored and implemented where possible, to strive for better protection of water quality and the marine environment.

In the meantime, the contractors were reminded to implement and maintain all mitigation measures during weekly site inspection and regular environmental management meetings. These include maintaining mitigation measures properly for reclamation works including DCM works, marine filling, and seawall construction as recommended in the Manual.

## 5 Waste Management

In accordance with the Manual, the waste generated from construction activities was audited once per week to determine if wastes are being managed in accordance with the Waste Management Plan (WMP) prepared for the Project, contract-specific WMP, and any statutory and contractual requirements. All aspects of waste management including waste generation, storage, transportation and disposal were assessed during the audits.

#### 5.1 Action and Limit Levels

The Action and Limit Levels of the construction waste are provided in **Table 5.1**.

Table 5.1: Action and Limit Levels for Construction Waste

Monitoring Stations	Action Level	Limit Level
Construction Area	When one valid documented complaint is received	Non-compliance of the WMP, contract-specific WMPs, any statutory and contractual
		requirements

#### 5.2 Waste Management Status

Weekly monitoring on all works contracts were carried out by the ET to check and monitor the implementation of proper waste management practices during the construction phase.

Recommendations made included provision and maintenance of proper chemical waste storage area, as well as handling, segregation, and regular disposal of general refuse. The contractors had taken actions to implement the recommended measures.

Based on updated information provided by contractors, construction waste generated in the reporting period is summarized in **Table 5.2**.

There were no complaints, non-compliance of the WMP, contract-specific WMPs, statutory and contractual requirements that triggered Action and Limit Levels in the reporting period.

**Table 5.2: Construction Waste Statistics** 

			C&D Material Transferred	Material Waste	Chemical Waste (L)	General Refuse (tonne)	
	for Reuse or Recycle (m³)	the Project (m³)	other Projects (m³)	to Public Fill (m³)	(19)	(-/	(1)
July 2019 <sup>(2)(3)</sup>	*4,821	*4,568	665	4,627	200	9,040	399
August 2019 <sup>(3)</sup>	5,579	4,071	0	3,447	200	7,200	827

#### Notes:

- (1) C&D refers to Construction and Demolition.
- (2) Updated figures in the past month are reported and marked with an asterisk (\*). Updated figures for earlier months will be reported in the forthcoming Annual EM&A Report.
- (3) Metals, paper and/or plastics were recycled in the reporting period.

## 6 Chinese White Dolphin Monitoring

In accordance with the Manual, CWD monitoring by small vessel line-transect survey supplemented by land-based theodolite tracking survey and passive acoustic monitoring should be conducted during construction phase.

The small vessel line-transect survey should be conducted at a frequency of two full surveys per month, while land-based theodolite tracking survey should be conducted at a frequency of one day per month per station at Sha Chau (SC) and Lung Kwu Chau (LKC) during the construction phase as stipulated in the Manual. Supplemental theodolite tracking survey of one additional day has also been conducted at LKC, i.e. in total twice per month at the LKC station.

#### 6.1 Action and Limit Levels

The Action and Limit Levels for CWD monitoring were formulated by the action response approach using the running quarterly dolphin encounter rates STG and ANI derived from the baseline monitoring data, as presented in the CWD Baseline Monitoring Report. The derived values of Action and Limit Levels for CWD monitoring were summarized in **Table 6.1**.

Table 6.1: Derived Values of Action and Limit Levels for Chinese White Dolphin Monitoring

	NEL, NWL, AW, WL and SWL as a Whole
Action Level <sup>(3)</sup>	Running quarterly <sup>(1)</sup> STG < 1.86 & ANI < 9.35
Limit Level <sup>(3)</sup>	Two consecutive running quarterly <sup>(2)</sup> (3-month) STG < 1.86 & ANI < 9.35

Notes: (referring to the baseline monitoring report)

- (1) Action Level running quarterly STG & ANI will be calculated from the three preceding survey months.
- (2) Limit Level two consecutive running quarters mean both the running quarterly encounter rates of the preceding month and the running quarterly encounter rates of this month.
- (3) Action Level and/or Limit Level will be triggered if both STG and ANI fall below the criteria.

#### 6.2 CWD Monitoring Transects and Stations

#### 6.2.1 Small Vessel Line-transect Survey

Small vessel line-transect surveys were conducted along the transects covering Northeast Lantau (NEL), Northwest Lantau (NWL), Airport West (AW), West Lantau (WL) and Southwest Lantau (SWL) areas as proposed in the Manual, which are consistent with the Agriculture, Fisheries and Conservation Department (AFCD) long-term monitoring programme (except the addition of AW). The AW transect has not been previously surveyed in the AFCD programme due to the restrictions of HKIA Approach Area, nevertheless, this transect was established during the EIA of the 3RS Project and refined in the Manual with the aim to collect project specific baseline information within the HKIA Approach Area to fill the data gap that was not covered by the AFCD programme. This also provided a larger sample size for estimating the density, abundance and patterns of movements in the broader study area of the project.

The planned vessel survey transect lines follow the waypoints set for construction phase monitoring as proposed in the Manual and depicted in **Figure 6.1** with the waypoint coordinates of all transect lines given in **Table 6.2**, which are subject to on-site refinement based on the actual survey conditions and constraints.

Table 6.2: Coordinates of Transect Lines in NEL, NWL, AW, WL and SWL Survey Areas

Waypoint	Easting	Northing	Waypoint	Easting	Northing
		NE			
1S	813525	820900	6N	818568	824433
1N	813525	824657	7S	819532	821420
2\$	814556	818449	7N	819532	824209
2N	814559	824768	8S	820451	822125
3S	815542	818807	8N	820451	823671
3N	815542	824882	9S	821504	822371
48	816506	819480	9N	821504	823761
4N	816506	824859	10S	822513	823268
5S	817537	820220	10N	822513	824321
5N	817537	824613	11S	823477	823402
6S	818568	820735	11N	823477	824613
		NV	VL		
1S	804671	814577	5S	808504	821735
1N	804671	831404	5N	808504	828602
2Sb	805475	815457	6S	809490	822075
2Nb	805476	818571	6N	809490	825352
2Sa	805476	820770	7S	810499	822323
2Na	805476	830562	7N	810499	824613
3S	806464	821033	8S	811508	821839
3N	806464	829598	8N	811508	824254
4S	807518	821395	9S	812516	821356
4N	807518	829230	9N	812516	824254
		Al	N		
1W	804733	818205	2W	805045	816912
1E	806708	818017	2E	805960	816633
		W	L		
1W	800600	805450	7W	800400	811450
1E	801760	805450	7E	802400	811450
2W	800300	806450	8W	800800	812450
2E	801750	806450	8E	802900	812450
3W	799600	807450	9W	801500	813550
3E	801500	807450	9E	803120	813550
4W	799400	808450	10W	801880	814500
4E	801430	808450	10E	803700	814500
5W	799500	809450	11W	802860	815500
5E	801300	809450	12S/11E	803750	815500
6W	799800	810450	12N	803750	818500
6E	801400	810450			
		SV			
1S	802494	803961	6S	807467	801137
1N	802494	806174	6N	807467	808458
2S	803489	803280	7S	808553	800329
2N	803489	806720	7N	808553	807377
3S	804484	802509	8S	809547	800338
3N	804484	807048	8N	809547	807396
4S	805478	802105	9S	810542	800423
4N	805478	807556	9N	810542	807462

Waypoint	Easting	Northing	Waypoint	Easting	Northing
5S	806473	801250	10S	811446	801335
5N	806473	808458	10N	811446	809436

#### 6.2.2 Land-based Theodolite Tracking Survey

Land-based theodolite tracking survey stations were set up at two locations, one facing east/south/west on the southern slopes of Sha Chau (SC), and the other facing north/northeast/northwest at Lung Kwu Chau (LKC). The stations (D and E) are depicted in **Figure 6.2** and shown in **Table 6.3** with position coordinates, height of station and approximate distance of consistent theodolite tracking capabilities for CWD.

Table 6.3: Land-based Theodolite Survey Station Details

Stations	Location	Geographical Coordinates	Station Height (m)	Approximate Tracking Distance (km)
D	Sha Chau (SC)	22° 20′ 43.5″ N 113° 53′ 24.66″ E	45.66	2
E	Lung Kwu Chau (LKC)	22° 22' 44.83" N 113° 53' 0.2" E	70.40	3

#### 6.3 CWD Monitoring Methodology

#### 6.3.1 Small Vessel Line-transect Survey

Small vessel line-transect surveys provided data for density and abundance estimation and other assessments using distance-sampling methodologies, specifically, line-transect methods.

The surveys involved small vessel line-transect data collection and have been designed to be similar to, and consistent with, previous surveys for the AFCD for their long-term monitoring of small cetaceans in Hong Kong. The survey was designed to provide systematic, quantitative measurements of density, abundance and habitat use.

As mentioned in **Section 6.2.1**, the transects covered NEL, NWL covering the AW, WL and SWL areas as proposed in the Manual and are consistent with the AFCD long-term monitoring programme (except AW). There are two types of transect lines:

- Primary transect lines: the parallel and zigzag transect lines as shown in Figure 6.1; and
- Secondary transect lines: transect lines connecting between the primary transect lines and going around islands.

All data collected on both primary and secondary transect lines were used for analysis of sighting distribution, group size, activities including association with fishing boat, and mother-calf pairs. Only on-effort data collected under conditions of Beaufort 0-3 and visibility of approximately 1200 m or beyond were used for analysis of the CWD encounter rates.

A 15-20 m vessel with a flying bridge observation platform about 4 to 5 m above water level and unobstructed forward view, and a team of three to four observers were deployed to undertake the surveys. Two observers were on search effort at all times when following the transect lines with a constant speed of 7 to 8 knots (i.e. 13 to 15 km per hour), one using 7X handheld binoculars and the other using unaided eyes and recording data.

During on-effort survey periods, the survey team recorded effort data including time, position (waypoints), weather conditions (Beaufort sea state and visibility) and distance travelled in each

series with assistance of a handheld GPS device. The GPS device also continuously and automatically logged data including time, position (latitude and longitude) and vessel speed throughout the entire survey.

When CWDs were seen, the survey team was taken off-effort, the dolphins were approached and photographed for photo-ID information (using a Canon 7D [or similar] camera and long 300 mm+ telephoto lens), then followed until they were lost from view. At that point, the boat returned (off effort) to the survey line at the closest point after obtaining photo records of the dolphin group and began to survey on effort again.

Focal follows of dolphins would be used for providing supplementary information only where practicable (i.e. when individual dolphins or small stable groups of dolphins with at least one member that could be readily identifiable with unaided eyes during observations and weather conditions are favourable). These would involve the boat following (at an appropriate distance to minimize disturbance) an identifiable individual dolphin for an extended period of time, and collecting detailed data on its location, behaviour, response to vessels, and associates.

#### 6.3.2 Photo Identification

CWDs can be identified by their unique features like presence of scratches, nick marks, cuts, wounds, deformities of their dorsal fin and distinguished colouration and spotting patterns.

When CWDs were observed, the survey team was taken off-effort, the dolphins were approached and photographed for photo-ID information (using a Canon 7D [or similar] camera and long 300 mm+ telephoto lens). The survey team attempted to photo both sides of every single dolphin in the group as the colouration and spotting pattern on both sides may not be identical. The photos were taken at the highest available resolution and stored on Compact Flash memory cards for transferring into a computer.

All photos taken were initially examined to sort out those containing potentially identifiable individuals. These sorted-out images would then be examined in detail and compared to the CWD photo-identification catalogue established for 3RS during the baseline monitoring stage.

#### 6.3.3 Land-based Theodolite Tracking Survey

Land-based theodolite tracking survey obtains fine-scale information on the time of day and movement patterns of the CWDs. A digital theodolite (Sokkia/Sokkisha Model DT5 or similar equipment) with 30-power magnification and 5-s precision was used to obtain the vertical and horizontal angle of each dolphin and vessel position. Angles were converted to geographic coordinates (latitude and longitude) and data were recorded using *Pythagoras* software, Version 1.2. This method delivers precise positions of multiple spatially distant targets in a short period of time. The technique is fully non-invasive, and allows for time and cost-effective descriptions of dolphin habitat use patterns at all times of daylight.

Three surveyors (one theodolite operator, one computer operator, and one observer) were involved in each survey. Observers searched for dolphins using unaided eyes and handheld binoculars (7X50). Theodolite tracking sessions were initiated whenever an individual CWD or group of CWDs was located. Where possible, a distinguishable individual was selected, based on colouration, within the group. The focal individual was then continuously tracked via the theodolite, with a position recorded each time the dolphin surfaced. In case an individual could not be positively distinguished from other members, the group was tracked by recording positions based on a central point within the group whenever the CWD surfaced. Tracking continued until animals were lost from view; moved beyond the range of reliable visibility (>1-3 km, depending on station height); or environmental conditions obstructed visibility (e.g., intense haze, Beaufort sea state >4, or sunset), at which time the research effort was terminated. In addition to the

tracking of CWD, all vessels that moved within 2-3 km of the station were tracked, with effort made to obtain at least two positions for each vessel.

Theodolite tracking included focal follows of CWD groups and vessels. Priority was given to tracking individual or groups of CWD. The survey team also attempted to track all vessels moving within 1 km of the focal CWD.

#### 6.4 Monitoring Results and Observations

#### 6.4.1 Small Vessel Line-transect Survey

#### **Survey Effort**

Within this reporting period, two complete sets of small vessel line-transect surveys were conducted on the 7, 8, 12, 13, 16, 21, 22 and 26 August 2019, covering all transects in NEL, NWL, AW, WL and SWL survey areas for twice.

A total of around 451.68 km of survey effort was collected from these surveys, with around 95.3% of the total survey effort being conducted under favourable weather condition (i.e. Beaufort Sea State 3 or below with favourable visibility). Details of the survey effort are given in **Appendix D**.

#### **Sighting Distribution**

In August 2019, 17 sightings with 71 dolphins were sighted. Details of cetacean sightings are presented in **Appendix C**.

Distribution of all CWD sightings recorded in August 2019 is illustrated in **Figure 6.3**. In NWL, there was only one CWD sighting recorded at the southwestern corner of the survey area. In WL, CWD sightings were recorded from Tai O to Fan Lau, with sightings largely recorded at the coastal waters between Tai O and Peaked Hill. In SWL, there were two CWD sightings located near Fan Lau. No sightings of CWD were recorded in NEL or in close vicinity to 3RS Works Area.

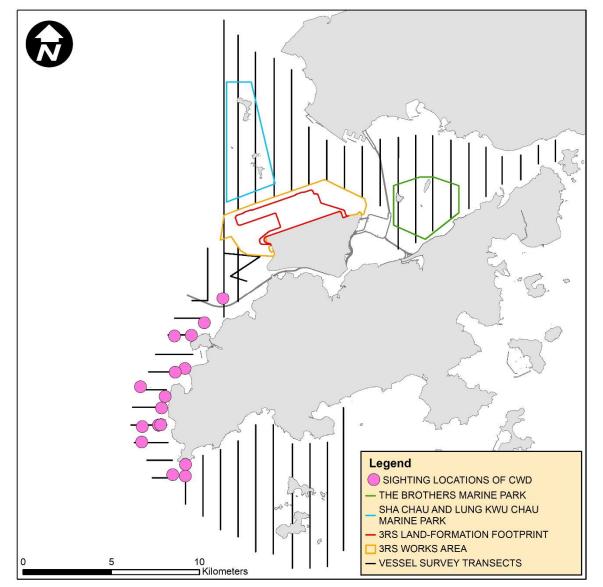


Figure 6.3: Sightings Distribution of Chinese White Dolphins

Remarks: Please note that there are 17 pink circles on the map indicating the sighting locations of CWDs. Some of them were very close to each other and therefore may appear overlapped on this distribution map.

#### **Encounter Rate**

Two types of dolphin encounter rates were calculated based on the data from August 2019. They included the number of dolphin sightings per 100 km survey effort (STG) and total number of dolphins per 100 km survey effort (ANI) in the whole survey area (i.e. NEL, NWL, AW, WL and SWL). In the calculation of dolphin encounter rates, only survey data collected under favourable weather condition (i.e. Beaufort Sea State 3 or below with favourable visibility) were used. The formulae used for calculation of the encounter rates are shown below:

Encounter Rate by Number of Dolphin Sightings (STG)

$$STG = \frac{Total\ No.\ of\ On-effort\ Sightings}{Total\ Amount\ of\ Survey\ Effort\ (km)}\ x\ 100$$

#### Encounter Rate by Number of Dolphins (ANI)

$$ANI = \frac{Total\ No.\ of\ Dolphins\ from\ On-effort\ Sightings}{Total\ Amount\ of\ Survey\ Effort\ (km)}\ x\ 100$$

(Notes: Only data collected under Beaufort 3 or below condition were used)

In August 2019, a total of around 430.24 km of survey effort were conducted under Beaufort Sea State 3 or below with favourable visibility, whilst a total number of 17 on-effort sightings with 71 dolphins were sighted under such condition. Calculation of the encounter rates in August 2019 are shown in **Appendix C**.

For the running quarter of the reporting period (i.e., from June 2019 to August 2019), a total of around 1259.56 km of survey effort were conducted under Beaufort Sea State 3 or below with favourable visibility, whilst a total number of 62 on-effort sightings and a total number of 248 dolphins from on-effort sightings were obtained under such condition. Calculation of the running quarterly encounter rates are shown in **Appendix C**.

The STG and ANI of CWD in the whole survey area (i.e. NEL, NWL, AW, WL and SWL) during the month of August 2019 and during the running quarter are presented in **Table 6.4** below and compared with the Action Level. The running quarterly encounter rates STG and ANI did not trigger Action Level.

Table 6.4: Comparison of CWD Encounter Rates of the Whole Survey Area with Action Levels

	Encounter Rate (STG)	Encounter Rate (ANI)
August 2019	3.95	16.50
Running Quarter from June 2019 to August 2019 <sup>(1)</sup>	4.92	19.69
Action Level	Running quarterly <sup>(1)</sup> ST	FG < 1.86 & ANI < 9.35

Note: (1) Running quarterly encounter rates STG & ANI were calculated from data collected in the reporting period and the two preceding survey months, i.e. the data from June 2019 to August 2019, containing six sets of transect surveys for all monitoring areas. Action Level will be triggered if both STG and ANI fall below the criteria.

#### **Group Size**

In August 2019, 17 groups with 71 dolphins were sighted, and the average group size of CWDs was 4.2 dolphins per group. The numbers of sightings with small group size (i.e. 1-2 dolphins) and medium group size (i.e. 3-9 dolphins) are similar. There were two CWD sightings with large group size (i.e. 10 or more dolphins) recorded in WL.

#### **Activities and Association with Fishing Boats**

Three sightings of CWDs were recorded engaging in feeding activities in August 2019 in NWL and WL survey areas. No CWD sightings were observed in association with operating fishing boat in the reporting month.

#### **Mother-calf Pair**

In August 2019, there were two sightings of CWD with the presence of mother-and-unspotted juvenile pair.

#### 6.4.2 Photo Identification

In August 2019, a total number of 32 different CWD individuals were identified for totally 33 times. A summary of photo identification works is presented in **Table 6.5**. Representative photos of these individuals are given in **Appendix C**.

Table 6.5: Summary of Photo Identification

Individual ID	Date of Sighting (dd-mmm-yy)	Sighting Group No.	Area	Individual ID	Date of Sighting (dd-mmm-yy)	Sighting Group No.	Area
NLMM012	21-Aug-19	1	WL	WLMM039	8-Aug-19	7	WL
NLMM021	21-Aug-19	2	WL		21-Aug-19	3	WL
NLMM027	21-Aug-19	2	WL	WLMM051	8-Aug-19	1	WL
NLMM033	8-Aug-19	1	WL	WLMM056	21-Aug-19	5	WL
NLMM040	8-Aug-19	2	WL	WLMM079	21-Aug-19	5	WL
NLMM041	8-Aug-19	2	WL	WLMM081	8-Aug-19	4	WL
NLMM046	8-Aug-19	2	WL	WLMM082	8-Aug-19	4	WL
NLMM056	8-Aug-19	1	WL	WLMM090	8-Aug-19	7	WL
NLMM063	21-Aug-19	5	WL	WLMM094	8-Aug-19	7	WL
NLMM067	8-Aug-19	1	WL	WLMM100	8-Aug-19	1	WL
SLMM003	21-Aug-19	5	WL	WLMM104	8-Aug-19	7	WL
SLMM010	21-Aug-19	5	WL	WLMM121	8-Aug-19	4	WL
SLMM025	21-Aug-19	2	WL	WLMM122	8-Aug-19	1	WL
SLMM053	21-Aug-19	2	WL	WLMM143	8-Aug-19	4	WL
SLMM064	8-Aug-19	1	WL	WLMM144	8-Aug-19	7	WL
SLMM072	22-Aug-19	2	SWL	WLMM145	21-Aug-19	2	WL
WLMM030	8-Aug-19	4	WL				

#### 6.4.3 Land-based Theodolite Tracking Survey

#### **Survey Effort**

Land-based theodolite tracking surveys were conducted at LKC on 15 and 22 August 2019 and at SC on 27 August 2019, with a total of three days of land-based theodolite tracking survey effort accomplished in this reporting period. Five CWD groups were tracked at LKC station during the surveys. Information of survey effort and CWD groups sighted during these land-based theodolite tracking surveys are presented in **Table 6.6**. Details of the survey effort and CWD groups tracked are presented in **Appendix C**. The first sighting locations of CWD groups tracked at LKC station during land-based theodolite tracking surveys in August 2019 were depicted in **Figure 6.4**. No CWD group was sighted from SC station in this reporting month.

Table 6.6: Summary of Survey Effort and CWD Group of Land-based Theodolite Tracking

Land-based Station	No. of Survey Sessions	Survey Effort (hh:mm)	No. of CWD Groups Sighted	CWD Group Sighting per Survey Hour
Lung Kwu Chau	2	12:00	5	0.42
Sha Chau	1	6:00	0	0
TOTAL	3	18:00	5	0.28

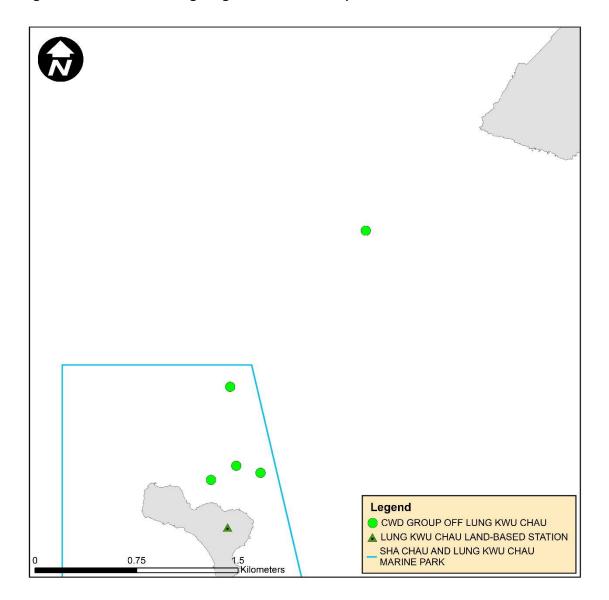


Figure 6.4: Plots of First Sightings of All CWD Groups obtained from Land-based Stations

#### 6.5 Progress Update on Passive Acoustic Monitoring

Underwater acoustic monitoring using Passive Acoustic Monitoring (PAM) should be undertaken during land formation related construction works. In this reporting period, the Ecological Acoustic Recorder (EAR) was remained underwater and positioned at south of Sha Chau Island inside the SCLKCMP with 20% duty cycle (**Figure 6.5**). The EAR deployment is generally for 6 weeks prior to data retrieval for analysis. Acoustic data is reviewed to give an indication of CWDs occurrence patterns and to obtain anthropogenic noise information simultaneously. Analysis (by a specialized team of acousticians) involved manually browsing through every acoustic recording and logging the occurrence of dolphin signals. All data will be re-played by computer as well as listened to by human ears for accurate assessment of dolphin group presence. As the period of data collection and analysis takes more than four months, PAM results could not be reported in monthly intervals but report for supplementing the annual CWD monitoring analysis.

#### 6.6 Site Audit for CWD-related Mitigation Measures

During the reporting period, silt curtains were in place by the contractor for marine filling, in which dolphin observers were deployed by contractor in accordance with the MMWP. Overall, 5 to 7 dolphin observation stations and teams of at least two dolphin observers were deployed by the contractors for continuous monitoring of the DEZ for DCM works and seawall construction in accordance with the DEZ Plan. Trainings for the proposed dolphin observers on the implementation of MMWP and DEZ monitoring were provided by the ET prior to the aforementioned works, with a cumulative total of 679 individuals being trained and the training records kept by the ET. From the contractors' MMWP observation records, no dolphin or other marine mammals were observed within or around the silt curtains. As for DEZ monitoring records, no dolphin or other marine mammals were observed within or around the DEZs in this reporting month. These contractors' records were also audited by the ET during site inspection.

Audits of acoustic decoupling measures for construction vessels were carried out during weekly site inspection and the observations are summarised in **Section 7.1**. Audits of SkyPier high speed ferries route diversion and speed control and construction vessel management are presented in **Section 7.2** and **Section 7.3** respectively.

#### 6.7 Timing of Reporting CWD Monitoring Results

Detailed analysis of CWD monitoring results collected by small vessel line-transect survey will be provided in future quarterly reports. Detailed analysis of CWD monitoring results collected by land-based theodolite tracking survey and PAM will be provided in future annual reports after a larger sample size of data has been collected.

#### 6.8 Summary of CWD Monitoring

Monitoring of CWD was conducted with two complete sets of small vessel line-transect surveys and three days of land-based theodolite tracking survey effort as scheduled. The running quarterly encounter rates STG and ANI in the reporting period did not trigger the Action Level for CWD monitoring.

## 7 Environmental Site Inspection and Audit

#### 7.1 Environmental Site Inspection

Site inspections of the construction works were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. The weekly site inspection schedule of the construction works is provided in **Appendix B**. Biweekly site inspections were also conducted by the IEC. Besides, *ad-hoc* site inspections were conducted by ET and IEC if environmental problems were identified, or subsequent to receipt of an environmental complaint, or as part of the investigation work. These site inspections provided a direct means to reinforce the specified environmental protection requirements and pollution control measures in construction sites.

During site inspections, environmental situation, status of implementation of pollution control and mitigation measures were observed. Environmental documents and site records, including waste disposal record, maintenance record of environmental equipment, and relevant environmental permit and licences, were also checked on site. Observations were recorded in the site inspection checklist and passed to the contractor together with the appropriate recommended mitigation measures where necessary in order to advise contractors on environmental improvement, awareness and on-site enhancement measures. The observations were made with reference to the following information during the site inspections:

- The EIA and EM&A requirements;
- Relevant environmental protection laws, guidelines, and practice notes;
- The EP conditions and other submissions under the EP;
- Monitoring results of EM&A programme;
- Works progress and programme;
- Proposal of individual works;
- Contract specifications on environmental protection; and
- Previous site inspection results.

Good site practices were observed in site inspections during the reporting period. Advice were given when necessary to ensure the construction workforce were familiar with relevant procedures, and to maintain good environmental performance on site. Regular toolbox talks on environmental issues were organized for the construction workforce by the contractors to ensure understanding and proper implementation of environmental protection and pollution control mitigation measures.

During the reporting period, implementation of recommended landscape and visual mitigation measures (CM1 – CM10) where applicable was monitored weekly in accordance with the Manual and no non-conformity was recorded. In case of non-conformity, specific recommendations will be made, and actions will be proposed according to the Event and Action Plan. The monitoring status is summarized in **Appendix A**.

A summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix A**.

#### 7.2 Audit of SkyPier High Speed Ferries

The Marine Travel Routes and Management Plan for High Speed Ferries of SkyPier (the SkyPier Plan) was submitted to the Advisory Council on the Environment for comment and subsequently submitted to and approved by EPD in November 2015 under EP Condition 2.10. The approved SkyPier Plan is available on the dedicated website of the Project. In the SkyPier Plan, AAHK has committed to implement the mitigation measure of requiring HSFs of SkyPier travelling between HKIA and Zhuhai / Macau to start diverting the route with associated speed control across the area, i.e. Speed Control Zone (SCZ), with high CWD abundance. The route diversion and speed restriction at the SCZ have been implemented since 28 December 2015.

Key audit findings for the SkyPier HSFs travelling to/from Zhuhai and Macau against the requirements of the SkyPier Plan during the reporting period are summarized in **Table 7.1**. The daily movements of all SkyPier HSFs in this reporting period (i.e., 63 to 82 daily movements were within the maximum daily cap of 125 daily movements. Status of compliance with the annual daily average of 99 movements will be further reviewed in the annual EM&A Report.

In total, 612 ferry movements between HKIA SkyPier and Zhuhai / Macau were recorded in August 2019 and the data are presented in **Appendix G**. The time spent by the SkyPier HSFs travelling through the SCZ in August 2019 were presented in **Figure 7.1**. It will take 9.6 minutes to travel through the SCZ when the SkyPier HSFs adopt the maximum allowable speed of 15 knots within the SCZ. **Figure 7.1** shows that all of the SkyPier HSFs spent more than 9.6 minutes to travel through the SCZ.

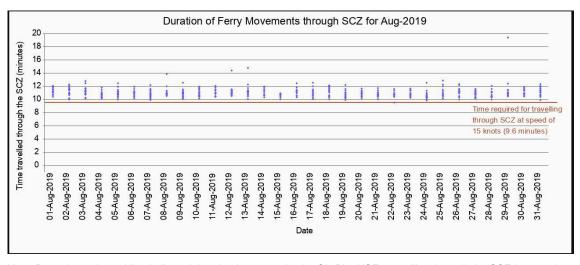


Figure 7.1: Duration of the SkyPier HSFs travelling through the SCZ for August 2019

Note: Data above the red line indicated that the time spent by the SkyPier HSFs travelling through the SCZ is more than 9.6 minutes, which is in compliance with the SkyPier Plan.

A total of two ferries were recorded with route deviation on 15 and 29 August 2019. Notices were sent to the ferry operator and the cases are under investigation by ET.

As reported in the Construction Phase Monthly EM&A Report No. 43, one ferry was recorded with minor route deviation on 26 July 2019. ET's investigation found that the deviation was due to giving way to vessels in order to avoid collision.

Table 7.1: Summary of Key Audit Findings against the SkyPier Plan

Requirements in the SkyPier Plan	1 to 31 August 2019
Total number of ferry movements recorded and audited	612
Use diverted route and enter / leave SCZ through Gate Access Points	2 deviations
Speed control in speed control zone	The average speeds of all HSFs travelling through the SCZ ranged from 9.8 to 14.4 knots. All HSFs had travelled through the SCZ with average speeds under 15 knots in compliance with the SkyPier Plan. The time used by HSFs to travel through SCZ is presented in <b>Figure 7.1</b> .
Daily Cap (including all SkyPier HSFs)	63-82 daily movements (within the maximum daily cap - 125 daily movements).

#### 7.3 Audit of Construction and Associated Vessels

The updated Marine Travel Routes and Management Plan for Construction and Associated Vessel (MTRMP-CAV) was submitted and approved in November 2016 by EPD under EP Condition 2.9. The approved Plan is available on the dedicated website of the Project.

ET carried out the following actions during the reporting period:

- Skipper training sessions were held for contractors' concerned skippers of relevant
  construction vessels to familiarize them with the predefined routes; general education on
  local cetaceans; guidelines for avoiding adverse water quality impact; the required
  environmental practices / measures while operating construction and associated vessels
  under the Project; and guidelines for operating vessels safely in the presence of CWDs.
  The list of all trained skippers was properly recorded and maintained by ET.
- Three skipper training sessions were held by contractors' Environmental Officers.
   Competency tests were subsequently conducted with the trained skippers by ET. The list of all trained skippers was properly recorded and maintained by ET.
- In this reporting period, 4 skippers were trained by ET and 4 skippers were trained by contractors' Environmental Officers. In total, 1171 skippers were trained from August 2016 to August 2019.
- The Marine Surveillance System (MSS) automatically recorded deviation cases such as speeding, entering no entry zone and not travelling through the designated gate. ET conducted checking to ensure the MSS records deviation cases accurately.
- Deviations such as speeding in the works area, entered no entry zone, and entering from non-designated gates were identified. All the concerned contractors were reminded to comply with the requirements of the MTRMP-CAV during the bi-weekly MTCC audit.
- Three-month rolling programmes (one month record and three months forecast) for construction vessel activities were received from the contractors in order to help maintain the number of construction and associated vessels on site to a practicable minimal level.

#### 7.4 Implementation of Dolphin Exclusion Zone

The DEZ Plan was submitted in accordance with EP Condition 3.1 (v) requirement and Section 10.3 of the Manual, and approved in April 2016 by EPD. The 24-hour DEZs with a 250m radius for marine works were established and implemented by the contractors for DCM works and

seawall construction according to their Method Statement for DEZ Monitoring that followed the specifications and requirements of the DEZ Plan.

During the reporting period, ET was notified that no dolphin sightings were recorded within the DEZ by the contractors. The ET checked the relevant records by the contractors and conducted competence checking to audit the implementation of DEZ.

#### 7.5 Status of Submissions under Environmental Permits

The current status of submissions under the EP up to the reporting period is presented in **Table 7.2**.

Table 7.2: Status of Submissions under Environmental Permit

EP Condition	Submission	Status
2.1	Complaint Management Plan	
2.4	Management Organizations	
2.5	Construction Works Schedule and Location Plans	
2.7	Marine Park Proposal	
2.8	Marine Ecology Conservation Plan	
2.9	Marine Travel Routes and Management Plan for Construction and Associated Vessels	
2.10	Marine Travel Routes and Management Plan for High Speed Ferries of SkyPier	Accepted / approved
2.11	Marine Mammal Watching Plan	─by EPD
2.12	Coral Translocation Plan	
2.13	Fisheries Management Plan	
2.14	Egretry Survey Plan	_
2.15	Silt Curtain Deployment Plan	
2.16	Spill Response Plan	
2.17	Detailed Plan on Deep Cement Mixing	
2.18	Landscape & Visual Plan	Submitted to EPD
2.19	Waste Management Plan	
2.20	Supplementary Contamination Assessment Plan	Accepted / approved
3.1	Updated EM&A Manual	by EPD
3.4	Baseline Monitoring Reports	

#### 7.6 Compliance with Other Statutory Environmental Requirements

During the reporting period, environmental related licenses and permits required for the construction activities were checked. No non-compliance with environmental statutory requirements was recorded. The environmental licenses and permits which are valid in the reporting period are presented in **Appendix E**.

## 7.7 Analysis and Interpretation of Complaints, Notification of Summons and Status of Prosecutions

#### 7.7.1 Complaints

No construction activities-related complaint was received during the reporting period.

#### 7.7.2 Notifications of Summons or Status of Prosecution

Neither notification of summons nor prosecution was received during the reporting period.

#### 7.7.3 Cumulative Statistics

Cumulative statistics on complaints, notifications of summons and status of prosecutions are summarized in  ${\bf Appendix}\;{\bf F}.$ 

## 8 Future Key Issues and Other EIA & EM&A Issues

#### 8.1 Construction Programme for the Coming Reporting Period

Key activities anticipated in the next reporting period for the Project will include the following:

#### **Advanced Works:**

#### Contract P560 (R) Aviation Fuel Pipeline Diversion Works

Stockpiling of compressed materials

#### **DCM Works:**

#### Contract 3205 DCM works

DCM works

#### **Reclamation Works:**

#### **Contract 3206 Main Reclamation Works**

- Land base ground improvement works;
- Seawall construction; and
- Marine filling.

#### **Airfield Works:**

#### **Contract 3301 North Runway Crossover Taxiway**

- Cable ducting works;
- Subgrade compaction and paving works;
- Drainage construction works;
- Operation of aggregate mixing facility; and
- Precast of duct bank and fabrication of steel works.

#### Contract 3302 Eastern Vehicular Tunnel Advance Works

- Site survey and cable laying;
- Pavement removal works;
- Backfilling and reinstatement works; and
- Site establishment.

#### Contract 3303 Third Runway and Associated Works

- Plant and equipment mobilization; and
- Site establishment.

#### **Third Runway Concourse and Integrated Airport Centres Works:**

#### **Contract 3402 New Integrated Airport Centres Enabling Works**

- Superstructure works;
- Lateral supports and excavation works;

- Drawpit and duct laying works;
- Manhole and pipe construction works; and
- Site establishment.

#### **Terminal 2 Expansion Works:**

#### **Contract 3501 Antenna Farm and Sewage Pumping Station**

- Drainage works;
- Boring works; and
- Pipe installation.

#### Contract 3502 Terminal 2 Automated People Mover (APM) Depot Modification Works

- Site clearance; and
- Fitting out works.

#### Contract 3503 Terminal 2 Foundation and Substructure Works

- Site establishment;
- Utilities, drainage, and road work; and
- Piling and structure works.

#### **Automated People Mover (APM) Works:**

#### **Contract 3602 Existing APM System Modification Works**

- Site establishment; and
- Modification works at APM depot.

#### <u>Airport Support Infrastructure & Logistic Works:</u>

#### Contract 3801 APM and BHS Tunnels on Existing Airport Island

- Site establishment;
- Cofferdam installation for box culvert;
- Rising main installation;
- Drilling and grouting works;
- Piling and foundation works
- Demolition works; and
- Site clearance.

#### 8.2 Key Environmental Issues for the Coming Reporting Period

The key environmental issues for the Project in the coming reporting period expected to be associated with the construction activities include:

- Generation of dust from construction works and stockpiles;
- Noise from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Water quality from DCM works and marine filling;
- DEZ monitoring for ground improvement works (DCM works) and seawall construction;
- Implementation of MMWP for silt curtain deployment;
- Sorting, recycling, storage and disposal of general refuse and construction waste;
- Management of chemicals and avoidance of oil spillage on-site; and
- Acoustic decoupling measures for equipment on marine vessels.

The implementation of required mitigation measures by the contractors will be monitored by the ET.

#### 8.3 Monitoring Schedule for the Coming Reporting Period

A tentative schedule of the planned environmental monitoring work in the next reporting period is provided in **Appendix B**.

#### 8.4 Review of the Key Assumptions Adopted in the EIA Report

With reference to Appendix E of the Manual, it is noted that the key assumptions adopted in approved EIA report for the construction phase are still valid and no major changes are involved. The environmental mitigation measures recommended in the approved EIA Report remain applicable and shall be implemented in undertaking construction works for the Project.

### 9 Conclusion and Recommendation

The key activities of the Project carried out in the reporting period included reclamation works and land-side works. Reclamation works included DCM works, marine filling and seawall construction. Land-side works involved mainly airfield works, foundation and substructure work for Terminal 2 expansion, modification and tunnel work for APM and BHS systems, and preparation work for utilities, with activities include site establishment, site office construction, road and drainage works, cable ducting, demolition of existing facilities, piling, and excavation works.

All the monitoring works for construction dust, construction noise, water quality, construction waste, landscape & visual, and CWD were conducted during the reporting period in accordance with the Manual.

Monitoring results of construction dust, construction noise, construction waste, and CWD did not trigger the corresponding Action and Limit Levels during the reporting period.

The water quality monitoring results for DO, turbidity, total alkalinity, and chromium obtained during the reporting period were within the corresponding Action and Limit Levels stipulated in the EM&A programme. Relevant investigation and follow-up actions will be conducted according to the EM&A programme if the corresponding Action and Limit Levels are triggered. For SS and nickel, some testing results triggered the relevant Action or Limit Levels, and the corresponding investigations were conducted accordingly. The investigation findings concluded that the case was not related to the Project. To conclude, the construction activities in the reporting period did not introduce adverse impact to all water quality sensitive receivers.

Weekly site inspections of the construction works were carried out by the ET to audit the implementation of proper environmental pollution control and mitigation measures for the Project. Bi-weekly site inspections were also conducted by the IEC. Site inspection findings were recorded in the site inspection checklists and provided to the contractors to follow up.

On the implementation of the SkyPier Plan, the daily movements of all SkyPier HSFs in August 2019 were in the range of 63 to 82 daily movements, which are within the maximum daily cap of 125 daily movements. A total of 612 HSF movements under the SkyPier Plan were recorded in the reporting period. The average speeds of all HSFs travelling through the SCZ ranged from 9.8 to 14.4 knots. All HSFs had travelled through the SCZ with average speeds under 15 knots in compliance with the SkyPier Plan. Two deviations from the diverted route in August 2019 were recorded in the HSF monitoring and is under investigation by the ET. In summary, the ET and IEC have audited the HSF movements against the SkyPier Plan and conducted follow up investigations or actions accordingly.

On the implementation of MTRMP-CAV, the MSS automatically recorded the deviation case such as speeding, entering no entry zone and not travelling through the designated gates. ET conducted checking to ensure the MSS records all deviation cases accurately. Training has been provided for the concerned skippers to facilitate them in familiarising with the requirements of the MTRMP-CAV. Deviations including speeding in the works area, entered no entry zone, and entry from non-designated gates were reviewed by ET. All the concerned captains were reminded by the contractor's MTCC representative to comply with the requirements of the MTRMP-CAV. The ET reminded contractors that all vessels shall avoid entering the no-entry zone, in particular the Brothers Marine Park and the Sha Chau & Lung Kwu Chau Marine Park. Three-month rolling

programmes for construction vessel activities, which ensures the proposed vessels are necessary and minimal through good planning, were also received from contractors.

## **Figures**




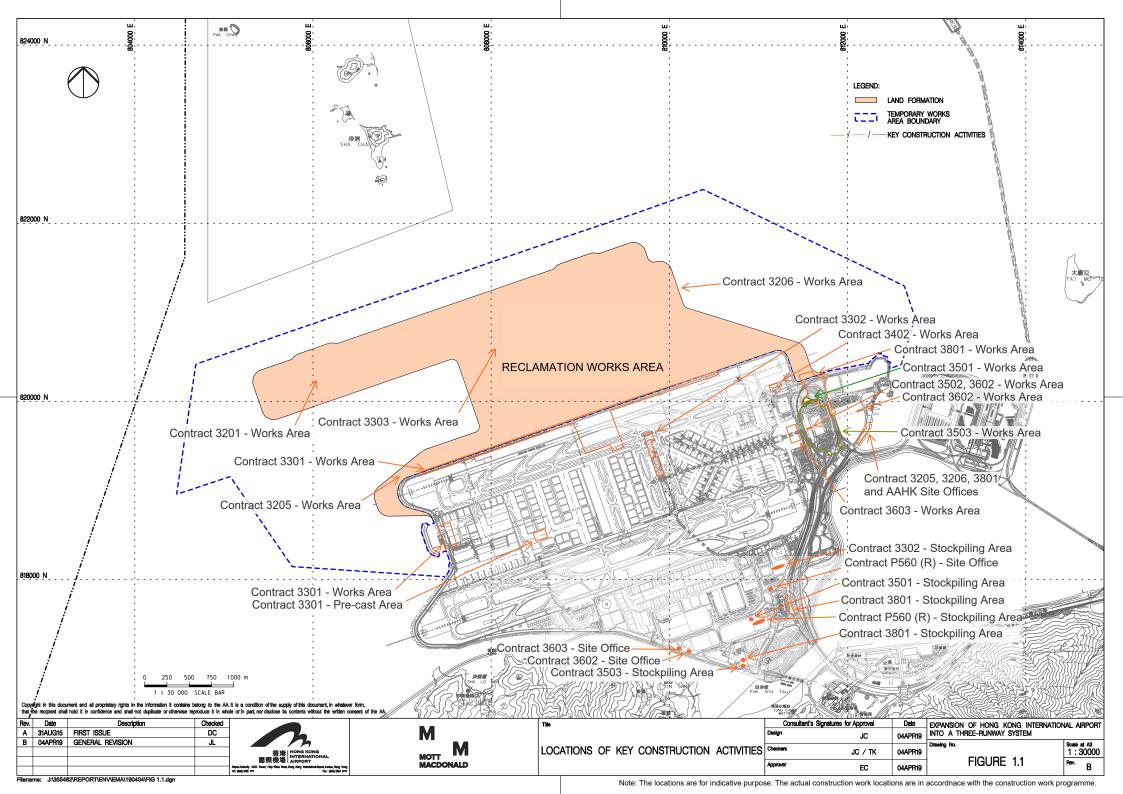



Figure 1.2


<u>Latest Layout of the Enhanced Silt Curtain</u>

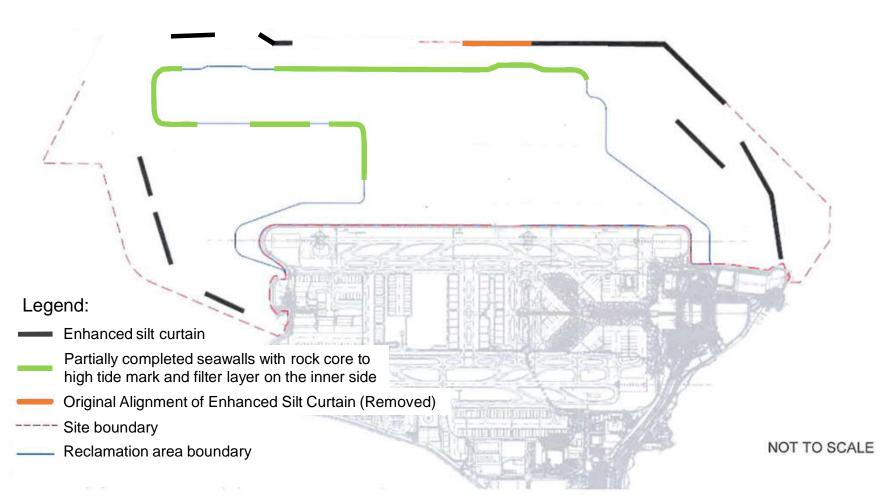


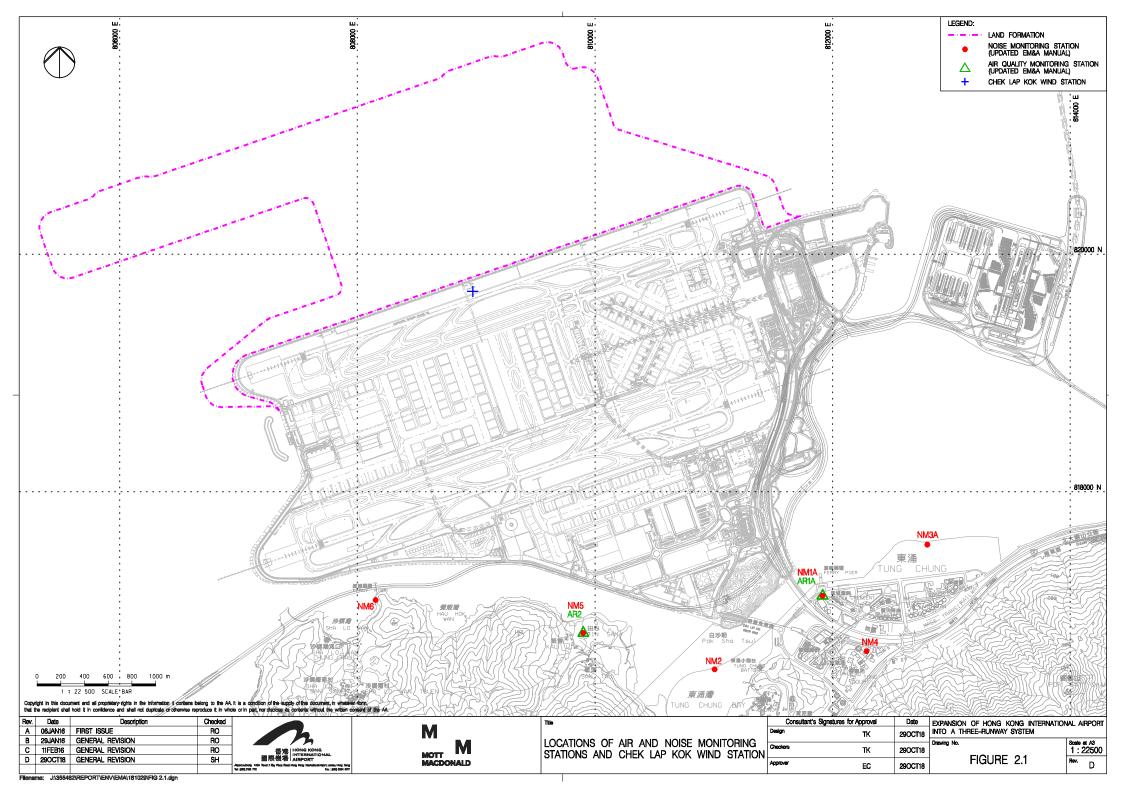


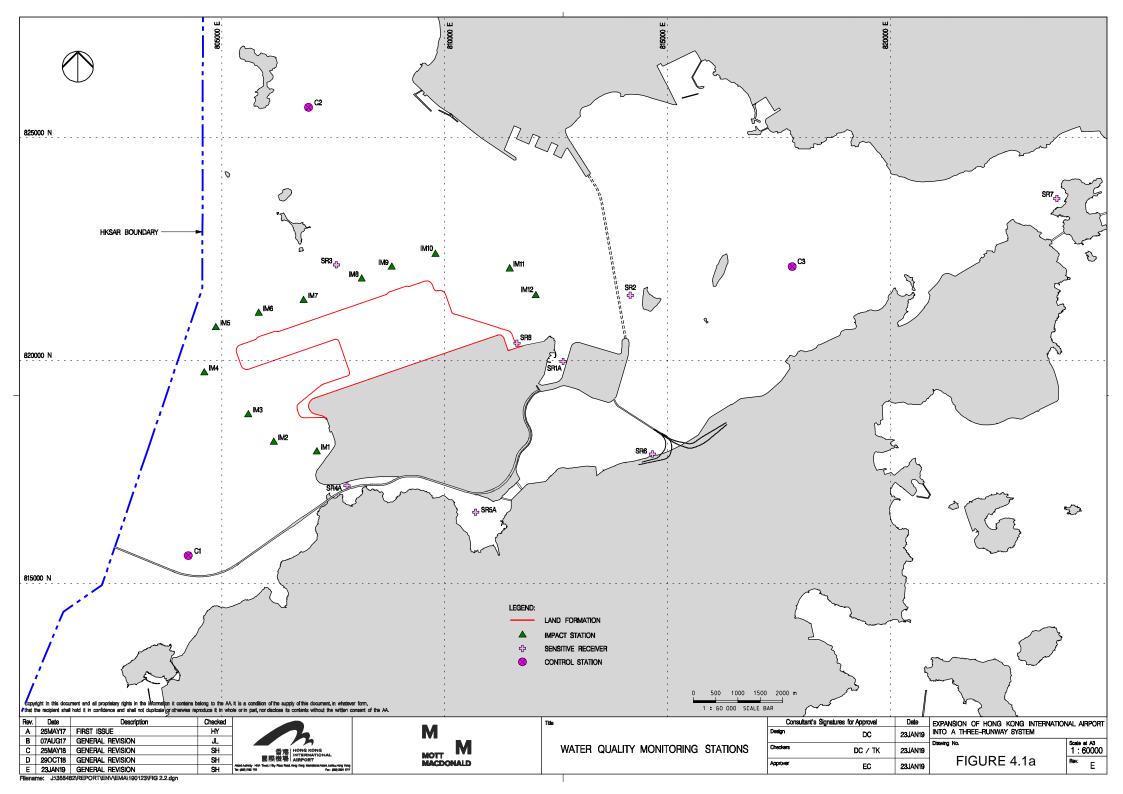

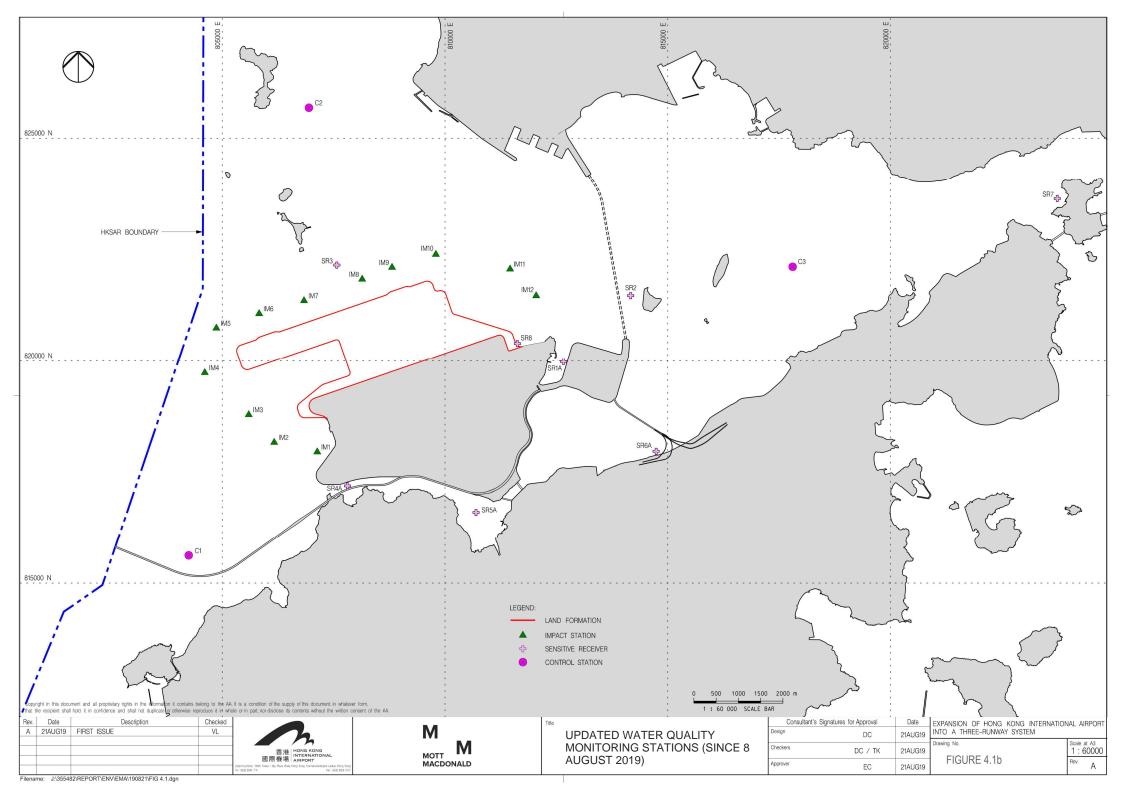

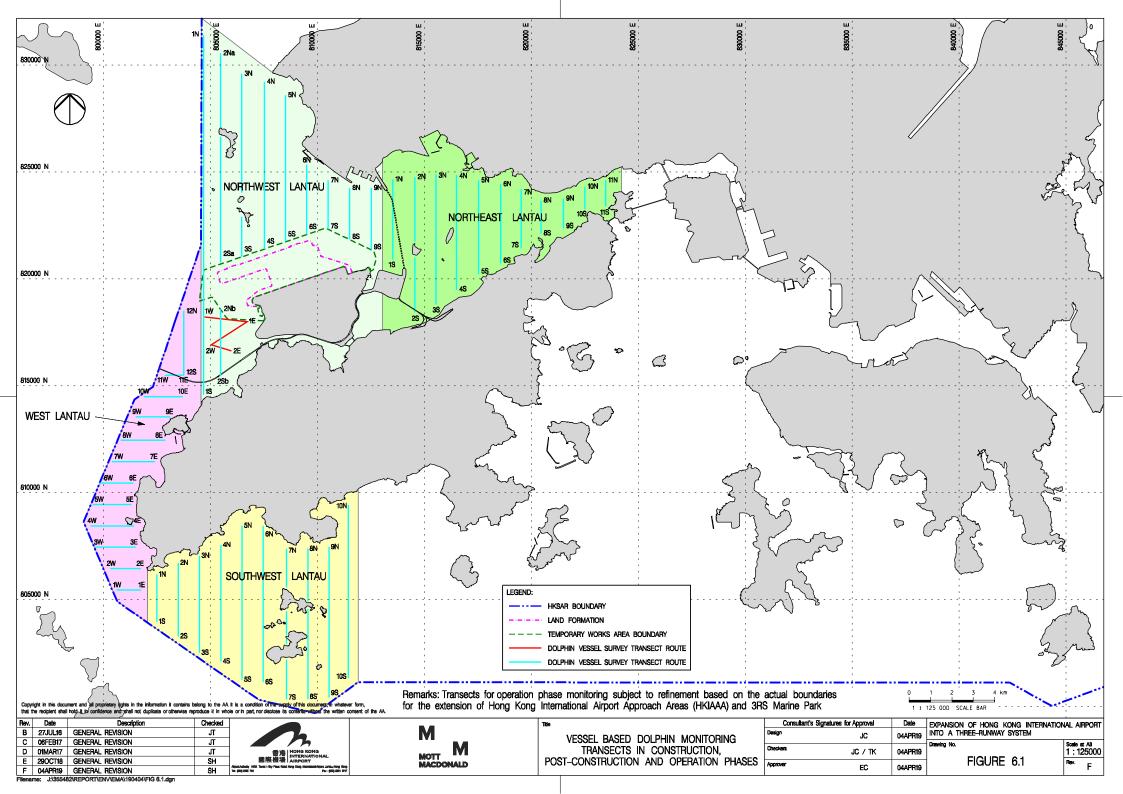

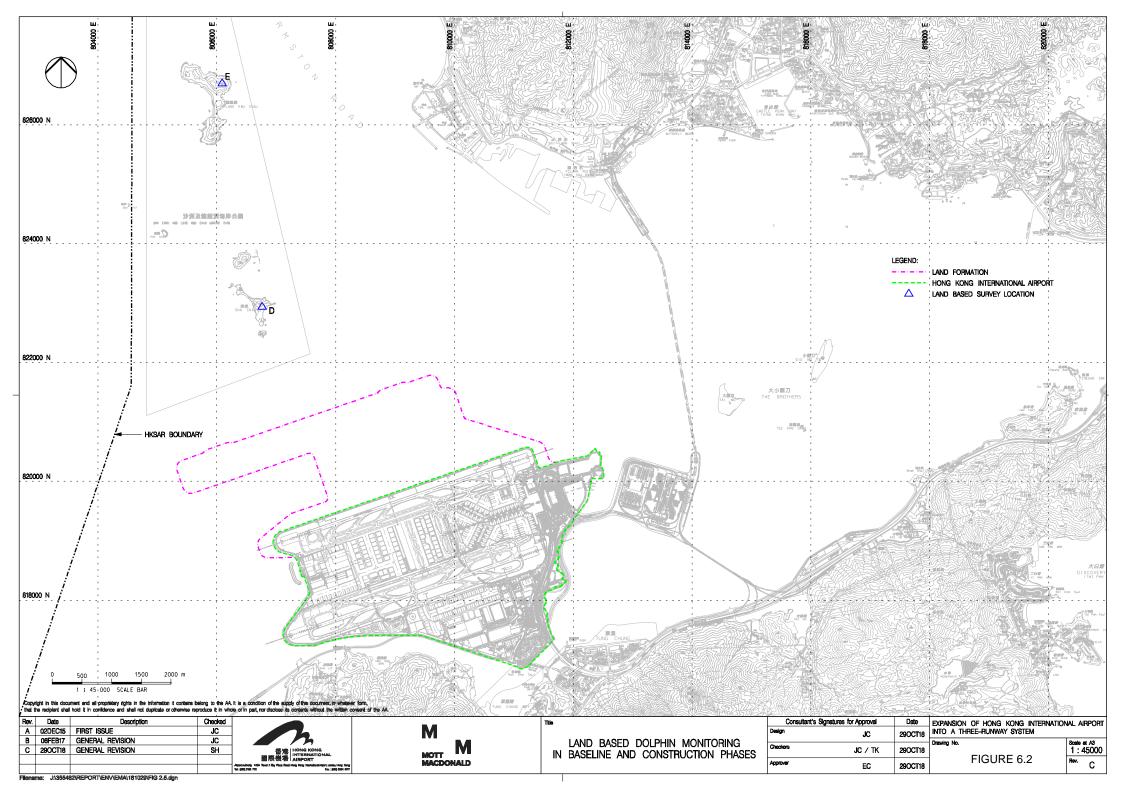

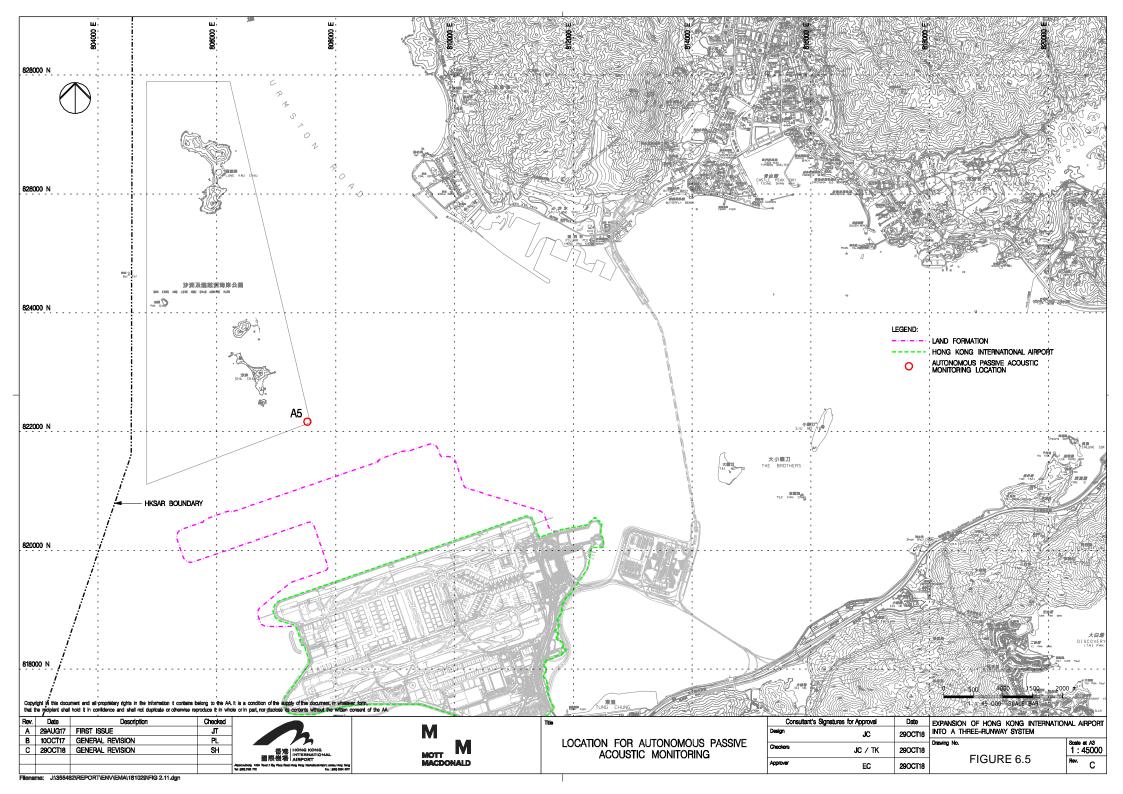

# Appendix A. Environmental Mitigation Implementation Schedule (EMIS) for Construction Phase



# Environmental Mitigation Implementation Schedule (EMIS) for Construction Phase

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Air Quality Impact – Construction Phase		
5.2.6.2	2.1	-	Dust Control Measures ■ Water spraying for 12 times a day or once every two hours for 24-hour working at all active works area.	Within construction site / Duration of the construction phase	I
5.2.6.3	2.1	-	<ul> <li>Covering of at least 80% of the stockpiling area by impervious sheets. Water spraying of all dusty materials immediately prior to any loading transfer operation so as to keep the dusty material wet during material handling.</li> </ul>	Within construction site / Duration of the construction phase	I
5.2.6.4	2.1	-	Dust control practices as stipulated in the Air Pollution Control (Construction Dust) Regulation should be adopted. These practices include:  Good Site Management  Good site management is important to help reducing potential air quality impact down to an acceptable level. As a general guide, the Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust. Loading, unloading, handling and storage of raw materials, wastes or byproducts should be carried out in a manner so as to minimise the release of visible dust emission. Any piles of materials accumulated on or around the work areas should be cleaned up regularly. Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimising generation of fugitive dust emissions. The material should be handled properly to prevent fugitive dust emission before cleaning.	Within construction site / Duration of the construction phase	I
			Disturbed Parts of the Roads  Each and every main temporary access should be paved with concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or  Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.	Within construction site / Duration of the construction phase	I
			<ul> <li>Exposed Earth</li> <li>Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.</li> </ul>	Within construction site / Duration of the construction phase	I



EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures	Mitigation Measures Implemented?
			Timing of completion of measures	implemented:
		Loading, Unloading or Transfer of Dusty Materials  • All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.	Within construction site / Duration of the construction phase	I
		Debris Handling  • Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides; and	Within construction site / Duration of the construction phase	1
		<ul> <li>Transport of Dusty Materials</li> <li>Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.</li> </ul>	Within construction site / Duration of the construction phase	1
		Wheel washing  Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.	Within construction site / Duration of the construction phase	1
		Use of vehicles  The speed of the trucks within the site should be controlled to about 10km/hour in order to reduce adverse dust impacts and secure the safe movement around the site;	Within construction site / Duration of the construction phase	I
		<ul> <li>Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels; and</li> </ul>		
		• Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle.		
		Site hoarding  Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit.	Within construction site / Duration of the construction phase	I
2.1	-	Best Practices for Concrete Batching Plant  The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Cement Works (Concrete Batching Plant) BPM 3/2 as well as in the future Specified Process licence should be adopted. The best practices are recommended to be applied to both the land based and floating concrete batching plants. Best practices include:	Within Concrete Batching Plant / Duration of the construction phase	N/A
			Loading, Unloading or Transfer of Dusty Materials  • All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.  Debris Handling  • Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides; and  • Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.  Transport of Dusty Materials  • Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.  Wheel washing  • Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.  Use of vehicles  • The speed of the trucks within the site should be controlled to about 10km/hour in order to reduce adverse dust impacts and secure the safe movement around the site;  • Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels; and  • Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle.  Site hoarding  • Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit.   Pest Practices for Concrete Batching Plant  The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Cement Works (Concrete Batching Plant) BPM 3/2 as well as in the future Specified Process licence should be adopted. The best practices a	Loading, Unloading or Transfer of Dusty Materials  * All dusty materials should be sprayed with water immediately prior to any loading or transfer operation site / Duration of the construction phase  Debris Handling  * Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides; and  * Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.  Transport of Dusty Materials  * Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.  Wheel washing  * Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.  Use of vehicles  * The speed of the trucks within the site should be controlled to about 10km/hour in order to reduce adverse dust impacts and secure the safe movement around the site;  * Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels; and  * Where a vehicle leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels; and  * Where a vehicle leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels; and  * Where a vehicle leaving the construction site, every vehicle should be washed to remove any dusty materials from the construction phase  **Site Nouration of the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle.  Site hoarding  **Where a vehicle leaving the construction site is carrying a load of dusty materials do not leak from the vehicle.  **Where a vehicle leaving the co



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented? <sup>4</sup>
			■ The loading, unloading, handling, transfer or storage of cement, pulverised fuel ash (PFA) and/or other equally dusty materials shall be carried in a totally enclosed system acceptable to EPD. All dust-laden air or waste gas generated by the process operations shall be properly extracted and vented to fabric filtering system to meet the required emission limit;		
			• Cement, PFA and/or other equally dusty materials shall be stored in storage silo fitted with audible high level alarms to warn of over-filling. The high-level alarm indicators shall be interlocked with the material filling line such that in the event of the silo approaching an overfilling condition, an audible alarm will operate, and after 1 minute or less the material filling line will be closed;		
			<ul> <li>Vents of all silos shall be fitted with fabric filtering system to meet the required emission limit;</li> </ul>		
			<ul> <li>Vents of cement/PFA weighing scale shall be fitted with fabric filtering system to meet the required emission limit; and</li> </ul>		
			<ul> <li>Seating of pressure relief valves of all silos shall be checked, and the valves re-seated if necessary, before each delivery.</li> </ul>		
			Other raw materials	Within Concrete	N/A
			<ul> <li>The loading, unloading, handling, transfer or storage of other raw materials which may generate airborne dust emissions such as crushed rock, sand, stone aggregate, shall be carried out in such a manner to prevent or minimize dust emissions;</li> </ul>	Batching Plant / Duration of the construction phase	
			The materials shall be adequately wetted prior to and during the loading, unloading and handling operations. Manual or automatic water spraying system shall be provided at all unloading areas, stock piles and material discharge points;		
			<ul> <li>All receiving hoppers for unloading relevant materials shall be enclosed on three sides up to 3 m above the unloading point. In no case shall these hoppers be used as the material storage devices;</li> </ul>		
			• The belt conveyor for handling materials shall be enclosed on top and two sides with a metal board at the bottom to eliminate any dust emission due to wind-whipping effect. Other type of enclosure will also be accepted by EPD if it can be demonstrated that the proposed enclosure can achieve same performance;		
			<ul> <li>All conveyor transfer points shall be totally enclosed. Openings for the passage of conveyors shall be fitted with adequate flexible seals;</li> </ul>		
			<ul> <li>Scrapers shall be provided at the turning points of all conveyors to remove dust adhered to the belt surface;</li> </ul>		
			<ul> <li>Conveyors discharged to stockpiles of relevant materials shall be arranged to minimize free fall as far as practicable. All free falling transfer points from conveyors to stockpiles shall be enclosed with chute(s) and water sprayed;</li> </ul>		
			<ul> <li>Aggregates with a nominal size less than or equal to 5 mm should be stored in totally enclosed structure such as storage bin and should not be handled in open area. Where there is sufficient buffer area surrounding the concrete batching plant, ground stockpiling may be used;</li> </ul>		



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion	Mitigation Measures Implemented?
				of measures	
			<ul> <li>The stockpile shall be enclosed at least on top and three sides and with flexible curtain to cover the entrance side;</li> </ul>		
			<ul> <li>Aggregates with a nominal size greater than 5 mm should preferably be stored in a totally enclosed structure. If open stockpiling is used, the stockpile shall be enclosed on three sides with the enclosure wall sufficiently higher than the top of the stockpile to prevent wind whipping; and</li> </ul>		
			■ The opening between the storage bin and weighing scale of the materials shall be fully enclosed.		
			Loading of materials for batching	Within Concrete	N/A
			Concrete truck shall be loaded in such a way as to minimise airborne dust emissions. The following control measures shall be implemented:	Batching Plant / Duration of the	
			(a) Pre-mixing the materials in a totally enclosed concrete mixer before loading the materials into the concrete truck is recommended. All dust-laden air generated by the pre-mixing process as well as the loading process shall be totally vented to fabric filtering system to meet the required emission limit; and	construction phase	
			(b) If truck mixing batching or other types of batching method is used, effective dust control measures acceptable to EPD shall be adopted. The dust control measures must have been demonstrated to EPD that they are capable to collect and vent all dust-laden air generated by the material loading/mixing to dust arrestment plant to meet the required emission limit.		
			The loading bay shall be totally enclosed during the loading process.		
			Vehicles	Within Concrete	N/A
			<ul> <li>All practicable measures shall be taken to prevent or minimize the dust emission caused by vehicle movement; and</li> </ul>	Batching Plant / Duration of the	
			<ul> <li>All access and route roads within the premises shall be paved and adequately wetted.</li> </ul>	construction phase	
			Housekeeping	Within Concrete	N/A
			<ul> <li>A high standard of housekeeping shall be maintained. All spillages or deposits of materials on ground, support structures or roofs shall be cleaned up promptly by a cleaning method acceptable to EPD. Any dumping of materials at open area shall be prohibited.</li> </ul>	Batching Plant / Duration of the construction phase	
.2.6.6	2.1	-	Best Practices for Asphaltic Concrete Plant	Within Concrete	N/A
			The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Tar and Bitumen Works (Asphaltic Concrete Plant) BPM 15 (94) as well as in the future Specified Process licence should be adopted. These include:	Batching Plant / Duration of the construction phase	
			Design of Chimney		
			• The chimney shall not be less than 3 metres plus the building height or 8 metres above ground level, whichever is the greater;		
			■ The efflux velocity of gases from the main chimney shall not be less than 12 m/s at full load condition;		



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			■ The flue gas exit temperature shall not be less than the acid dew point; and	or measures	
			Release of the chimney shall be directed vertically upwards and not be restricted or deflected.		
			Cold feed side	Within Concrete	N/A
			<ul> <li>The aggregates with a nominal size less than or equal to 5 mm shall be stored in totally enclosed structure such as storage bin and shall not be handled in open area;</li> </ul>	Batching Plant / Duration of the construction phase	
			• Where there is sufficient buffer area surrounding the plant, ground stockpiling may be used. The stockpile shall be enclosed at least on top and three sides and with flexible curtain to cover the entrance side. If these aggregates are stored above the feeding hopper, they shall be enclosed at least on top and three sides and be wetted on the surface to prevent wind-whipping;		
			• The aggregates with a nominal size greater than 5 mm should preferably be stored in totally enclosed structure. Aggregates stockpile that is above the feeding hopper shall be enclosed at least on top and three sides. If open stockpiling is used, the stockpiles shall be enclosed on three sides with the enclosure wall sufficiently higher than the top of the stockpile to prevent wind whipping;		
			<ul> <li>Belt conveyors shall be enclosed on top and two sides and provided with a metal board at the bottom to eliminate any dust emission due to the wind-whipping effect. Other type of enclosure will also be accepted by EPD if it can be demonstrated that the proposed enclosure can be achieve the same performance;</li> </ul>		
			<ul> <li>Scrapers shall be provided at the turning points of all belt conveyors inside the chute of the transfer points to remove dust adhered to the belt surface;</li> </ul>		
			<ul> <li>All conveyor transfer points shall be totally enclosed. Openings for the passages of conveyors shall be fitted with adequate flexible seals; and</li> </ul>		
			<ul> <li>All materials returned from dust collection system shall be transferred in enclosed system and shall be stored inside bins or enclosures.</li> </ul>		
			Hot feed side	Within Concrete Batching Plant / Duration of the construction phase	N/A
			• The inlet and outlet of the rotary dryer shall be enclosed and ducted to a dust extraction and collection system such as a fabric filter. The particulate and gaseous concentration at the exhaust outlet of the dust collector shall not exceed the required limiting values;		
			<ul> <li>The bucket elevator shall be totally enclosed and the air be extracted and ducted to a dust collection system to meet the required particulates limiting value;</li> </ul>		
			<ul> <li>All vibratory screens shall be totally enclosed and dust tight with close-fitted access inspection opening.</li> <li>Gaskets shall be installed to seal off any cracks and edges of any inspection openings;</li> </ul>		
			<ul> <li>Chutes for carrying hot material shall be rigid and preferably fitted with abrasion resistant plate inside.</li> <li>They shall be inspected daily for leakages;</li> </ul>		



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures  Within Concrete Batching Plant / Duration of the construction phase  Within Concrete Batching Plant / Duration of the construction phase  Within Concrete Batching Plant / Duration of the construction phase  Within Concrete Batching Plant / Duration of the construction phase  Within Concrete Batching Plant / Duration of the construction phase	Mitigation Measures Implemented?^
			<ul> <li>Appropriate control measures shall be adopted in order to meet the required bitumen emission limit as well as the ambient odour level (2 odour units).</li> </ul>		
			Material transportation		
			• The loading, unloading, handling, transfer or storage of other raw materials which may generate airborne dust emissions such as crushed rocks, sands, stone aggregates, reject fines, shall be carried out in such a manner as to minimize dust emissions;		
			<ul> <li>Roadways from the entrance of the plant to the product loading points and/or any other working areas where there are regular movements of vehicles shall be paved or hard surfaced; and</li> </ul>		
			<ul> <li>Haul roads inside the Works shall be adequately wetted with water and/or chemical suppressants by water trucks or water sprayers.</li> </ul>		
			Control of emissions from bitumen decanting		N/A
			<ul> <li>The heating temperature of the particular bitumen type and grade shall not exceed the corresponding temperature limit of the same type listed in Appendix 1 of the Guidance Note;</li> </ul>		
			<ul> <li>Tamper-free high temperature cut-off device shall be provided to shut off the fuel supply or electricity in case the upper limit for bitumen temperature is reached;</li> </ul>		
			<ul> <li>Proper chimney for the discharge of bitumen fumes shall be provided at high level;</li> </ul>		
			<ul> <li>The emission of bitumen fumes shall not exceed the required emission limit; and</li> </ul>		
			The air-to-fuel ratio shall be properly controlled to allow complete combustion of the fuel. The fuel burners, if any, shall be maintained properly and free from carbon deposits in the burner nozzles.		
			Liquid fuel		N/A
			<ul> <li>The receipt, handling and storage of liquid fuel shall be carried out so as to prevent the release of emissions of organic vapours and/or other noxious and offensive emissions to the air.</li> </ul>		
			Housekeeping		N/A
			A high standard of housekeeping shall be maintained. Waste material, spillage and scattered piles gathered beneath belt conveyors, inside and around enclosures shall be cleared frequently. The minimum clearing frequency is on a weekly basis.		
5.2.6.7	2.1	-	Best Practices for Rock Crushing Plants		Within Concrete
			The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Mineral Works (Stone Crushing Plant) BPM 11/1 (95) as well as in the future Specified Process licence should be adopted. These include:	Batching Plant / Duration of the construction phase	



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?
			Crushers		
			• The outlet of all primary crushers, and both inlet and outlet of all secondary and tertiary crushers, if not installed inside a reasonably dust tight housing, shall be enclosed and ducted to a dust extraction and collection system such as a fabric filter;		
			<ul> <li>The inlet hopper of the primary crushers shall be enclosed on top and 3 sides to contain the emissions during dumping of rocks from trucks. The rock while still on the trucks shall be wetted before dumping;</li> </ul>		
			<ul> <li>Water sprayers shall be installed and operated in strategic locations at the feeding inlet of crushers; and</li> </ul>		
			<ul> <li>Crusher enclosures shall be rigid and be fitted with self-closing doors and close-fitting entrances and exits. Where conveyors pass through the crusher enclosures, flexible covers shall be installed at entries and exits of the conveyors to the enclosure.</li> </ul>		
			Vibratory screens and grizzlies	Within Concrete	N/A
			• All vibratory screens shall be totally enclosed in a housing. Screenhouses shall be rigid and reasonably dust tight with self-closing doors or close-fitted entrances and exits for access. Where conveyors pass through the screenhouse, flexible covers shall be installed at entries and exits of the conveyors to the housing. Where containment of dust within the screenhouse structure is not successful then a dust extraction and collection system shall be provided; and	Batching Plant / Duration of the construction phase	
			<ul> <li>All grizzlies shall be enclosed on top and 3 sides and sufficient water sprayers shall be installed at their feeding and outlet areas.</li> </ul>		
			Belt conveyors	Within Concrete	N/A
			<ul> <li>Except for those conveyors which are placed within a totally enclosed structure such as a screenhouse or those erected at the ground level, all conveyors shall be totally enclosed with windshield on top and 2 sides;</li> </ul>	Batching Plant / Duration of the construction phase	
			• Effective belt scraper such as the pre-cleaner blades made by hard wearing materials and provided with pneumatic tensioner, or equivalent device, shall be installed at the head pulley of designated conveyor as required to dislodge fine dust particles that may adhere to the belt surface and to reduce carry-back of fine materials on the return belt. Bottom plates shall also be provided for the conveyor unless it has been demonstrated that the corresponding belt scraper is effective and well maintained to prevent falling material from the return belt; and		
			Except for those transfer points which are placed within a totally enclosed structure such as a screenhouse, all transfer points to and from conveyors shall be enclosed. Where containment of dust within the enclosure is not successful, then water sprayers shall be provided. Openings for any enclosed structure for the passage of conveyors shall be fitted with flexible seals.		



EIA Ref.	EM&A EP Ref. Condition		Environmental Protection Measures	Location / Duration of measures	Mitigation Measures Implemented?^
			Timing of completion of measures	implemented?^	
			Storage piles and bins	Within Concrete	N/A
			<ul> <li>Where practicable, free falling transfer points from conveyors to stockpiles shall be fitted with flexible curtains or be enclosed with chutes designed to minimize the drop height. Water sprays shall also be used where required.</li> </ul>	Batching Plant / Duration of the construction phase	
			<ul> <li>The surface of all surge piles and stockpiles of blasted rocks or aggregates shall be kept sufficiently wet by water spraying wherever practicable;</li> </ul>		
			<ul> <li>All open stockpiles for aggregates of size in excess of 5 mm shall be kept sufficiently wet by water spraying where practicable; or</li> </ul>		
			• The stockpiles of aggregates 5 mm in size or less shall be enclosed on 3 sides or suitably located to minimize wind-whipping. Save for fluctuations in stock or production, the average stockpile shall stay within the enclosure walls and in no case the height of the stockpile shall exceed twice the height of the enclosure walls.		
			<ul> <li>Scattered piles gathered beneath belt conveyors, inside and around enclosures shall be cleared regularly.</li> </ul>		
			Rock drilling equipment	Within Concrete	N/A
			<ul> <li>Appropriate dust control equipment such as a dust extraction and collection system shall be used during rock drilling activities.</li> </ul>	Batching Plant / Duration of the construction phase	
			Hazard to Human Life - Construction Phase		
Table 6.40	3.2	-	■ Precautionary measures should be established to request barges to move away during typhoons.	Construction Site / Construction Period	I
Table 6.40	3.2	-	<ul> <li>An appropriate marine traffic management system should be established to minimize risk of ship collision.</li> </ul>	Construction Site / Construction Period	I
Table 6.40	3.2	-	<ul> <li>Location of all existing hydrant networks should be clearly identified prior to any construction works.</li> </ul>	Construction Site / Construction Period	I
			Noise Impact – Construction Phase		
7.5.6	4.3	-	Good Site Practice Good site practice and noise management can significantly reduce the impact of construction site activities on nearby NSRs. The following package of measures should be followed during each phase of construction:	Within the Project site / During construction phase / Prior to	I
			<ul> <li>only well-maintained plant to be operated on-site and plant should be serviced regularly during the construction works;</li> </ul>	commencement of operation	
			<ul> <li>machines and plant that may be in intermittent use to be shut down between work periods or should be throttled down to a minimum;</li> </ul>		



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion	Mitigation Measures Implemented?^
				of measures	
			<ul> <li>plant known to emit noise strongly in one direction, should, where possible, be orientated to direct noise away from the NSRs;</li> </ul>		
			<ul> <li>mobile plant should be sited as far away from NSRs as possible; and</li> </ul>		
			<ul> <li>material stockpiles and other structures to be effectively utilised, where practicable, to screen noise from on-site construction activities.</li> </ul>		
7.5.6	4.3	-	Adoption of QPME	Within the Project site /	1
		<ul> <li>QPME should be adopted as far as a</li> </ul>	<ul> <li>QPME should be adopted as far as applicable.</li> </ul>	During construction	
				phase / Prior to commencement of operation	
7.5.6	4.3	- Use of Movable Noise Barriers	Within the Project site /	1	
	0		<ul> <li>Movable noise barriers should be placed along the active works area and mobile plants to block the direct line of sight between PME and the NSRs.</li> </ul>	During construction phase / Prior to commencement of operation	
7.5.6	4.3	-	Use of Noise Enclosure/ Acoustic Shed	Within the Project site /	I
			<ul> <li>Noise enclosure or acoustic shed should be used to cover stationary PME such as air compressor and generator.</li> </ul>	During construction phase / Prior to commencement of operation	
•	•		Water Quality Impact – Construction Phase	_	•



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
3.8.1.2 and	5.1	2.26	Marine Construction Activities	Within construction	1
3.8.1.3			General Measures to be Applied to All Works Areas	site / Duration of the	
			<ul> <li>Barges or hoppers shall not be filled to a level which will cause overflow of materials or pollution of water during loading or transportation;</li> </ul>	construction phase	
			<ul><li>Use of Lean Material Overboard (LMOB) systems shall be prohibited;</li></ul>		
			<ul> <li>Excess materials shall be cleaned from the decks and exposed fittings of barges and hopper dredgers before the vessels are moved;</li> </ul>		
			<ul> <li>Plants should not be operated with leaking pipes and any pipe leakages shall be repaired quickly;</li> </ul>		
			<ul> <li>Adequate freeboard shall be maintained on barges to reduce the likelihood of decks being washed by wave action;</li> </ul>		
			<ul> <li>All vessels shall be sized such that adequate clearance is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash;</li> </ul>		
			<ul> <li>The works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site; and</li> </ul>		
			• For ground improvement activities including DCM, the wash water from cleaning of the drilling shaft should be appropriately treated before discharge. The Contractor should ensure the waste water meets the WPCO/TM requirements before discharge. No direct discharge of contaminated water is permitted.		
			Specific Measures to be Applied to All Works Areas	Within construction	
			<ul> <li>The daily maximum production rates shall not exceed those assumed in the water quality assessment in the EIA report;</li> </ul>	site / Duration of the construction phase	1
			<ul> <li>A maximum of 10 % fines content to be adopted for sand blanket and 20 % fines content for marine filling below +2.5 mPD prior to substantial completion of seawall (until end of Year 2017) shall be specified in the works contract document;</li> </ul>		
		• An advance seawall of at least 200m to be constructed (comprising either rows of contiguous permanent steel cells completed above high tide mark or partially completed seawalls with rock core to high tide mark and filter layer on the inner side) prior to commencement of marine filling activities;		I	
			<ul> <li>Closed grab dredger shall be used to excavate marine sediment;</li> </ul>		N/A
			<ul> <li>Silt curtains surrounding the closed grab dredger shall be deployed in accordance with the Silt Curtain Deployment Plan; and</li> </ul>		*(The arrangement silt curtain has bee modified. The deta can be referred to s Curtain Deploymer Plan)
			The Silt Curtain Deployment Plan shall be implemented.	-	



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Specific Measures to be Applied to Land Formation Activities prior to Commencement of Marine Filling Works  Double layer 'Type III' silt curtains to be applied around the active eastern works areas prior to commencement of sand blanket laying activities. The silt curtains shall be configured to minimise SS release during ebb tides. A silt curtain efficiency test shall be conducted to validate the performance of the silt curtains;  Double layer silt curtains to enclose WSRs C7a and silt screens installed at the intake points for both WSR C7a and C8 prior to commencement of construction; and	Within construction site / Duration of the construction phase	N/A  *(The arrangement of silt curtain has been modified. The details can be referred to Silt Curtain Deployment Plan)  For C7a, I  For C8, I  *(The requirement of silt curtain / screen has been modified. The details can be referred to Silt Curtain Deployment Plan)
			■ The silt curtains and silt screens should be regularly checked and maintained.	-	1
			Specific Measures to be Applied to Land Formation Activities during Marine Filling Works  Double layer 'Type II' or 'Type III' silt curtains to be applied around the eastern openings between partially completed seawalls prior to commencement of marine filling activities. The silt curtains shall be configured to minimise SS release during ebb tides;	Within construction site / Duration of the construction phase	t (The arrangement of silt curtain has been modified. The details can be referred to Silt Curtain Deployment Plan)
			<ul> <li>Double layer silt curtains to be applied at the south-western opening prior to commencement of marine filling activities;</li> </ul>		N/A  *(The arrangement of silt curtain has been modified. The details can be referred to Silt Curtain Deployment Plan)
			<ul> <li>Double layer silt curtain to enclose WSR C7a and silt screens installed at the intake points for both WSR C7a and C8 prior to commencement of marine filling activities; and</li> </ul>		N/A *(The requirement of silt curtain / screen has been modified. The details can be referred to Silt Curtain Deployment Plan)
			The silt curtains and silt screens should be regularly checked and maintained.		Deployment Pla



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion	Mitigation Measures Implemented?
				of measures	
			Specific Measures to be Applied to the Field Joint Excavation Works for the Submarine Cable Diversion	Within construction	N/A
			<ul> <li>Only closed grabs designed and maintained to avoid spillage shall be used and should seal tightly when operated. Excavated materials shall be disposed at designated marine disposal area in accordance with the Dumping at Sea Ordinance (DASO) permit conditions; and</li> </ul>	site / Duration of the construction phase	
			<ul> <li>Silt curtains surrounding the closed grab dredger to be deployed as a precautionary measure.</li> </ul>		
8.8.1.4	5.1	-	Modification of the Existing Seawall	At the existing	N/A
			• Silt curtains shall be deployed around the seawall modification activities to completely enclose the active works areas, and care should be taken to avoid splashing of rockfill / rock armour into the surrounding marine environment. For the connecting sections with the existing outfalls, works for these connection areas should be undertaken during the dry season in order that individual drainage culvert cells may be isolated for interconnection works.	northern seawall / Duration of the construction phase	
8.8.1.5	5.1	-	Construction of New Stormwater Outfalls and Modifications to Existing Outfalls	Within construction site / Duration of the construction phase	N/A
		fer ter	<ul> <li>During operation of the temporary drainage channel, runoff control measures such as bunding or silt fence shall be provided on both sides of the channel to prevent accumulation and release of SS via the temporary channel. Measures should also be taken to minimise the ingress of site drainage into the culvert excavations.</li> </ul>		
8.8.1.6	5.1	2.27	Piling Activities for Construction of New Runway Approach Lights and HKIAAA Marker Beacons	Within construction	N/A
8.8.1.7			Silt curtains shall be deployed around the piling activities to completely enclose the piling works and care should be taken to avoid spillage of excavated materials into the surrounding marine environment.	site / Duration of the construction phase	
			For construction of the eastern approach lights at the CMPs		
			<ul> <li>Ground improvement via DCM using a close-spaced layout shall be completed prior to commencement of piling works;</li> </ul>		
			<ul> <li>Steel casings shall be installed to enclose the excavation area prior to commencement of excavation;</li> </ul>		
			<ul> <li>The excavated materials shall be removed using a closed grab within the steel casings;</li> </ul>		
			No discharge of the cement mixed materials into the marine environment will be allowed; and		
			<ul> <li>Excavated materials shall be treated and reused on-site.</li> </ul>		
8.8.1.8	5.1	-	Construction of Site Runoff and Drainage	Within construction	
			The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended:	site / Duration of the construction phase	
			• Install perimeter cut-off drains to direct off-site water around the site and implement internal drainage, erosion and sedimentation control facilities. Channels, earth bunds or sand bag barriers should be provided on site to direct storm water to silt removal facilities. The design of the temporary on-site	-	I



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			drainage system should be undertaken by the Contractors prior to the commencement of construction (for works areas located on the existing Airport island) or as soon as the new land is completed (for works areas located on the new landform);	_	
			Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM-DSS standards under the WPCO. The design of efficient silt removal facilities should make reference to the guidelines in Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the Contractors prior to the commencement of construction;	_	I
			<ul> <li>All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms.</li> <li>Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly;</li> </ul>	_	I
			<ul> <li>Measures should be taken to minimize the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from foundation excavations should be discharged into storm drains via silt removal facilities;</li> </ul>	_	I
			• In the event that contaminated groundwater is identified at excavation areas, this should be treated onsite using a suitable wastewater treatment process. The effluent should be treated according to the requirements of the TM-DSS standards under the WPCO prior to discharge to foul sewers or collected for proper disposal off-site. No direct discharge of contaminated groundwater is permitted; and	_	N/A
			• All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exits. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. All washwater should be treated according to the requirements of the TM-DSS standards under the WPCO prior to discharge.		I
8.8.1.9	5.1	-	Sewage Effluent from Construction Workforce	Within construction	
			Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	site / During construction phase	
8.8.1.10	5.1		General Construction Activities	Within construction	1
8.8.1.11			<ul> <li>Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby storm water drain. Stockpiles of cement and other construction materials should be kept covered when not being used; and</li> </ul>	site / During construction phase	



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures	Mitigation Measures
				Timing of completion of measures	Implemented?^
			• Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby storm water drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event.		
8.8.1.12	5.1	2.28	Drilling Activities for the Submarine Aviation Fuel Pipelines	Within construction	I
8.8.1.13			To prevent potential water quality impacts at Sha Chau, the following measures shall be applied:	site / During	
			<ul> <li>A 'zero-discharge' policy shall be applied for all activities to be conducted at Sha Chau;</li> </ul>	construction phase	
			<ul> <li>No bulk storage of chemicals shall be permitted; and</li> </ul>		
			<ul> <li>A containment pit shall be constructed around the drill holes. This containment pit shall be lined with impermeable lining and bunded on the outside to prevent inflow from off-site areas.</li> </ul>		
			At the airport island side of the drilling works, the following measures shall be applied for treatment of wastewater:	Within construction site / During	1
			<ul> <li>During pipe cleaning, appropriate desilting or sedimentation device should be provided on site for treatment before discharge. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge; and</li> </ul>	construction phase	
			<ul> <li>Drilling fluid used in drilling activities should be reconditioned and reused as far as possible. Temporary enclosed storage locations should be provided on-site for any unused chemicals that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.</li> </ul>		
			Waste Management Implication – Construction Phase		
10.5.1.1	7.1	-	Opportunities to minimise waste generation and maximise the reuse of waste materials generated by the project have been incorporated where possible into the planning, design and construction stages, and the following measures have been recommended:		
			• The relevant construction methods (particularly for the tunnel works) and construction programme have been carefully planned and developed to minimise the extent of excavation and to maximise the on-site reuse of inert C&D materials generated by the project as far as practicable. Temporary stockpiling areas will also be provided to facilitate on-site reuse of inert C&D materials;	Project Site Area / During design and construction phase	1
			<ul> <li>Priority should be given to collect and reuse suitable inert C&amp;D materials generated from other concurrent projects and the Government's PFRF as fill materials for the proposed land formation works;</li> </ul>	-	I
			<ul> <li>Only non-dredged ground improvement methods should be adopted in order to completely avoid the need for dredging and disposal of marine sediment for the proposed land formation work;</li> </ul>	=	I
			<ul> <li>Excavation work for constructing the APM tunnels, BHS tunnels and airside tunnels will not be down to the CMPs beneath the fill materials in order to avoid excavating any sediments; and</li> </ul>	-	1



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			For the marine sediments expected to be excavated from the piling works of TRC, APM & BHS tunnels, airside tunnels and other facilities on the proposed land formation area, piling work of marine sections of the approach lights and HKIAAA beacons, basement works for some of T2 expansion area and excavation works for the proposed APM depot should be treated and reused on-site as backfilling materials, although required treatment level / detail and the specific re-use mode are under development.		I
10.5.1.1	7.1	-	The following good site practices should be performed during the construction activities include:	Project Site Area /	1
			<ul> <li>Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site;</li> </ul>	Construction Phase	
			■ Training of site personnel in proper waste management and chemical waste handling procedures;		
			<ul> <li>Provision of sufficient waste disposal points and regular collection for disposal;</li> </ul>		
			<ul> <li>Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks by tarpaulin/ similar material or by transporting wastes in enclosed containers. The cover should be extended over the edges of the sides and tailboards;</li> </ul>		
			<ul> <li>Stockpiles of C&amp;D materials should be kept wet or covered by impervious sheets to avoid wind-blown dust;</li> </ul>		
			<ul> <li>All dusty materials including C&amp;D materials should be sprayed with water immediately prior to any loading transfer operation so as to keep the dusty material wet during material handling at the barging points/ stockpile areas;</li> </ul>		
			<ul> <li>C&amp;D materials to be delivered to and from the project site by barges or by trucks should be kept wet or covered to avoid wind-blown dust;</li> </ul>		
			• The speed of the trucks including dump trucks carrying C&D or waste materials within the site should be controlled to about 10 km/hour in order to reduce the adverse dust impact and secure the safe movement around the site; and		
			To avoid or minimise dust emission during transport of C&D or waste materials within the site, each and every main temporary access should be paved with concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials. Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.		
10.5.1.3	7.1	-	The following practices should be performed to achieve waste reduction include:	Project Site Area /	1
			<ul> <li>Use of steel or aluminium formworks and falseworks for temporary works as far as practicable;</li> </ul>	Construction Phase	
			<ul> <li>Adoption of repetitive design to allow reuse of formworks as far as practicable;</li> </ul>		
			<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal;</li> </ul>		



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures	Mitigation Measures
				Timing of completion of measures	Implemented?^
			<ul> <li>Encourage collection of aluminium cans, PET bottles and paper by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the work force;</li> </ul>		
			<ul> <li>Any unused chemicals or those with remaining functional capacity should be collected for reused as far as practicable;</li> </ul>		
			<ul> <li>Proper storage and site practices to minimise the potential for damage or contamination of construction materials; and</li> </ul>		
			<ul> <li>Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.</li> </ul>		
10.5.1.5	7.1		<ul> <li>Inert and non-inert C&amp;D materials should be handled and stored separately to avoid mixing the two types of materials.</li> </ul>	Project Site Area / Construction Phase	1
10.5.1.5	7.1	-	<ul> <li>Any recyclable materials should be segregated from the non-inert C&amp;D materials for collection by reputable licensed recyclers whereas the non-recyclable waste materials should be disposed of at the designated landfill site by a reputable licensed waste collector.</li> </ul>	Project Site Area / Construction Phase	I
10.5.1.6	7.1	-	A trip-ticket system promulgated shall be developed in order to monitor the off-site delivery of surplus inert C&D materials that could not be reused on-site for the proposed land formation work at the PFRF and to control fly tipping.	Project Site Area / Construction Phase	1
10.5.1.6	7.1	2.32	<ul> <li>The Contractor should prepare and implement a Waste Management Plan detailing various waste arising and waste management practices.</li> </ul>	Construction Phase	1
10.5.1.16	7.1	-	The following mitigation measures are recommended during excavation and treatment of the sediments:  On-site remediation should be carried out in an enclosed area in order to minimise odour/dust emissions;	Project Site Area / Construction Phase	I
			<ul> <li>The loading, unloading, handling, transfer or storage of treated and untreated sediment should be carried out in such a manner to prevent or minimise dust emissions;</li> </ul>		I
			<ul> <li>All practical measures, including but not limited to speed control for vehicles, should be taken to minimise dust emission;</li> </ul>		I
			<ul> <li>Good housekeeping should be maintained at all times at the sediment treatment facility and storage area;</li> </ul>	-	I
			Treated and untreated sediment should be clearly separated and stored separately; and	<del>-</del>	I
			<ul> <li>Surface runoff from the enclosed area should be properly collected and stored separately, and then properly treated to levels in compliance with the relevant effluent standards as required by the Water Pollution Control Ordinance before final discharge.</li> </ul>	-	I
10.5.1.18	7.1	-	The marine sediments to be removed from the cable field joint area would be disposed of at the designated disposal sites to be allocated by the MFC. The following mitigation measures should be strictly	Project Site Area / Construction Phase	N/A



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			followed to minimise potential impacts on water quality during transportation of the sediments requiring Type 1 disposal:		
			<ul> <li>Bottom opening of barges shall be fitted with tight fitting seals to prevent leakage of material;</li> </ul>		
			<ul> <li>Monitoring of the barge loading shall be conducted to ensure that loss of material does not take place during transportation. Transport barges or vessels shall be equipped with automatic self-monitoring devices as specified by EPD; and</li> </ul>		
			<ul> <li>Barges or hopper barges shall not be filled to a level that would cause the overflow of materials or sediment laden water during loading or transportation.</li> </ul>		
10.5.1.19	7.1	-	Contractor should register with the EPD as a chemical waste producer and to follow the relevant guidelines. The following measures should be implemented:	Project Site Area / Construction Phase	1
			<ul> <li>Good quality containers compatible with the chemical wastes should be used;</li> </ul>		
			<ul><li>Incompatible chemicals should be stored separately;</li></ul>		
			<ul> <li>Appropriate labels must be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc.; and</li> </ul>		
			<ul> <li>The contractor will use a licensed collector to transport and dispose of the chemical wastes at the approved Chemical Waste Treatment Centre or other licensed recycling facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</li> </ul>		
10.5.1.20	7.1	-	<ul> <li>General refuse should be stored in enclosed bins or compaction units separated from inert C&amp;D material. A reputable waste collector should be employed by the contractor to remove general refuse from the site for disposal at designated landfill sites. An enclosed and covered area should be provided to reduce the occurrence of 'wind blown' light material.</li> </ul>	Project Site Area / Construction Phase	I
10.5.1.21	7.1	-	The construction contractors will be required to regularly check and clean any refuse trapped or accumulated along the newly constructed seawall. Such refuse will then be stored and disposed of together with the general refuse.	Project Site Area / Construction Phase	1
			Land Contamination – Construction Phase		
1.10.1.2	8.1	2.32	For areas inaccessible during site reconnaissance survey	Project Site Area	
to 11.10.1.3			• Further site reconnaissance would be conducted once the areas are accessible in order to identify any land contamination concern for the areas.	inaccessible during site reconnaissance / Prior to Construction Phase	1
			<ul> <li>Subject to further site reconnaissance findings, a supplementary Contamination Assessment Plan (CAP) for additional site investigation (SI) (if necessary) may be prepared and submitted to EPD for endorsement prior to the commencement of SI at these areas.</li> </ul>	-	I



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures	Mitigation Measures Implemented?
				Timing of completion of measures	implemented?
			• After completion of SI, the Contamination Assessment Report (CAR) will be prepared and submitted to EPD for approval prior to start of the proposed construction works at the golf course, the underground and above-ground fuel storage tank areas, emergency power generation units, airside petrol filling station and fuel tank room.		I*(CAR for golf course)
			<ul> <li>Should remediation be required, Remediation Action Plan (RAP) and Remediation Report (RR) will be prepared for EPD's approval prior to commencement of the proposed remediation and any construction works respectively.</li> </ul>		N/A
11.8.1.2	8.1	-	If contaminated soil is identified, the following mitigation measures are for the excavation and transportation of contaminated materials (if any):	Project Site Area / Construction Phase	N/A
			<ul> <li>To minimize the incidents of construction workers coming in contact with any contaminated materials, bulk earth-moving excavation equipment should be employed;</li> </ul>		
			<ul> <li>Contact with contaminated materials can be minimised by wearing appropriate clothing and personal protective equipment such as gloves and masks (especially when working directly with contaminated material), provision of washing facilities and prohibition of smoking and eating on site;</li> </ul>		
			<ul> <li>Stockpiling of contaminated excavated materials on site should be avoided as far as possible;</li> </ul>		
			<ul> <li>The use of any contaminated soil for landscaping purpose should be avoided unless pre-treatment was carried out;</li> </ul>		
			<ul> <li>Vehicles containing any excavated materials should be suitably covered to reduce dust emissions and/or release of contaminated wastewater;</li> </ul>		
			<ul> <li>Truck bodies and tailgates should be sealed to prevent any discharge;</li> </ul>		
			<ul> <li>Only licensed waste haulers should be used to collect and transport contaminated material to treatment/disposal site and should be equipped with tracking system to avoid fly tipping;</li> </ul>		
			<ul> <li>Speed control for trucks carrying contaminated materials should be exercised. 8km/h is the recommended speed limit;</li> </ul>		
			<ul> <li>Strictly observe all relevant regulations in relation to waste handling, such as Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 354) and obtain all necessary permits where required; and</li> </ul>		
			<ul> <li>Maintain records of waste generation and disposal quantities and disposal arrangements.</li> </ul>		
			Terrestrial Ecological – Construction Phase		
12.10.1.1	9.2	2.14	Pre-construction Egretry Survey	Breeding season (April	I
			<ul> <li>Conduct ecological survey for Sha Chau egretry to update the latest boundary of the egretry.</li> </ul>	July) prior to commencement of HDD drilling works at HKIA	



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?
12.7.2.3 and	9.1	2.30	Avoidance and Minimisation of Direct Impact to Egretry  The daylighting location will avoid direct encroachment to the Sheung Sha Chau egretry. The daylighting	During construction phase at Sheung Sha	ı
12.7.2.6			location and mooring of flat top barge, if required, will be kept away from the egretry;  In any event, controls such as demarcation of construction site boundary and confining the lighting within the site will be practised to minimise disturbance to off-site habitat at Sheung Sha Chau Island; and	Chau Island	
			■ The containment pit at the daylighting location shall be covered or camouflaged.		
12.7.2.5	9.1	2.30	Preservation of Nesting Vegetation  The proposed daylighting location and the arrangement of connecting pipeline will avoid the need of tree cutting, therefore the trees that are used by ardeids for nesting will be preserved.	During construction phase at Sheung Sha Chau Island	I
12.7.2.4 and 12.7.2.6	9.1	2.30	Timing the Pipe Connection Works outside Ardeid's Breeding Season  All HDD and related construction works on Sheung Sha Chau Island will be scheduled outside the ardeids' breeding season (between April and July). No night-time construction work will be allowed on Sheung Sha Chau Island during all seasons.	During construction phase at Sheung Sha Chau Island	I
12.10.1.1	9.3	-	Ecological Monitoring     During the HDD construction works period from August to March, ecological monitoring will be undertaken monthly at the HDD daylighting location on Sheung Sha Chau Island to identify and evaluate any impacts with appropriate actions taken as required to address and minimise any adverse impact found.	at Sheung Sha Chau Island	I
			Marine Ecological Impact – Pre-construction Phase		
13.11.4.1	10.2.2	-	■ Pre-construction phase Coral Dive Survey.	HKIAAA artificial seawall	I
			Marine Ecological Impact – Construction Phase		
13.11.1.3 to 13.11.1.6	-	-	Minimisation of Land Formation Area  Minimise the overall size of the land formation needed for the additional facilities to minimise the overall loss of habitat for marine resources, especially the CWD population.	Land formation footprint / during detailed design phase to completion of construction	I
13.11.1.7 to 13.11.1.10	-	2.31	Use of Construction Methods with Minimal Risk/Disturbance  Use of non-dredge method for the main land formation and ancillary works including the diversion of the aviation fuel pipeline to the AFRF;	During construction phase at marine works area	1
			<ul> <li>Use of Deep Cement Mixing (DCM) method instead of conventional seabed dredging for the land formation works to reduce the risk of negative impacts through the elevation of suspended solids and contaminants on CWDs, fisheries and the marine environment;</li> </ul>	<del>.</del>	ı



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			<ul> <li>Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway;</li> </ul>		N/A
			<ul> <li>Avoid bored piling during CWD peak calving season (Mar to Jun);</li> </ul>	_	I
			<ul> <li>Prohibition of underwater percussive piling; and</li> </ul>	_	I
			<ul> <li>Use of horizontal directional drilling (HDD) method and water jetting methods for placement of submarine cables and pipelines to minimise the disturbance to the CWDs and other marine ecological resources.</li> </ul>		I
13.11.2.1	-	-	Mitigation for Indirect Disturbance due to Deterioration of Water Quality	All works area during	
to 13.11.2.7			<ul> <li>Water quality mitigation measures during construction phases include consideration of alternative construction methods, deployment of silt curtain and good site practices;</li> </ul>	the construction phase	1
			<ul> <li>Alternative construction methods including use of non-dredge methods for ground improvement (e.g. Deep Cement Mixing (DCM), prefabricated vertical drains (PVD), sand compaction piles, steel cells, stone columns and vertical sand drains);</li> </ul>		I
			<ul> <li>Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; and</li> </ul>		N/A
			Use of horizontal directional drilling (HDD) method and water jetting methods for placement of undersea cables and pipelines to minimise the disturbance to the CWDs and other marine ecological resources.	_	I
13.11.1.12	-	-	Strict Enforcement of No-Dumping Policy	All works area during	I
			<ul> <li>A policy prohibiting dumping of wastes, chemicals, oil, trash, plastic, or any other substance that would potentially be harmful to dolphins and/or their habitat in the work area;</li> </ul>	the construction phase	
			<ul> <li>Mandatory educational programme of the no-dumpling policy be made available to all construction site personnel for all project-related works;</li> </ul>		
			<ul><li>Fines for infractions should be implemented; and</li></ul>		
			<ul> <li>Unscheduled, on-site audits shall be implemented.</li> </ul>		
13.11.1.13	-	-	<ul> <li>Good Construction Site Practices</li> <li>Regular inspection of the integrity and effectiveness of all silt curtains and monitoring of effluents to ensure that any discharge meets effluent discharge guidelines;</li> <li>Keep the number of working or stationary vessels present on-site to the minimum anytime; and</li> <li>Unscheduled, on-site audits for all good site practice restrictions should be conducted, and fines or penalties sufficient to be an effective deterrent need to be levied against violators.</li> </ul>	All works area during the construction phase	I
13.11.1.3	-	-	Minimisation of Land Formation Area	Land formation	1
to 13.11.1.6			<ul> <li>Minimise the overall size of the land formation needed for the additional facilities to minimise the overall loss of habitat for marine resources, especially the CWD population.</li> </ul>	footprint / during detailed design phase	



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures	Mitigation Measures
			Timing of completion of measures	Implemented?^	
				to completion of construction	
13.11.5.4	10.3.1	-	SkyPier High Speed Ferries' Speed Restrictions and Route Diversions	Area between the	I
to 13.11.5.13			SkyPier HSFs operating to / from Zhuhai and Macau would divert north of SCLKC Marine Park with a 15 knot speed limit to apply for the part-journeys that cross high CWD abundance grid squares as indicatively shown in Drawing No. MCL/P132/EIA/13-023 of the EIA Report. Both the alignment of the northerly route and the portion of routings to be subject to the speed limit of 15 knots shall be finalised prior to commencement of construction based on the future review of up-to-date CWD abundance and EM&A data and taking reference to changes in total SkyPier HSF numbers; and	footprint and SCLKC Marine Park during construction phase	
			■ A maximum of 10 knots will be enforced through the designated SCLKC Marine Park area at all times.		
			Other mitigation measures	Area between the	I
			<ul> <li>The ET will audit various parameters including actual daily numbers of HSFs, compliance with the 15-knot speed limit in the speed control zone and diversion compliance for SkyPier HSFs operating to / from Zhuhai and Macau; and</li> </ul>	footprint and SCLKC Marine Park during construction phase	
			<ul> <li>The effectiveness of the CWD mitigation measures after implementation of initial six month SkyPier HSF diversion and speed restriction will be reviewed.</li> </ul>		
13.11.5.14	10.3.1	2.31	Dolphin Exclusion Zone	Marine waters around	
to 13.11.5.18			<ul> <li>Establishment of a 24 hr Dolphin Exclusion Zone (DEZ) with a 250 m radius around the land formation works areas;</li> </ul>	land formation works area during construction phase	1
			<ul> <li>A DEZ would also be implemented during ground improvement works (e.g. DCM), water jetting works for submarine cables diversion, open trench dredging at the field joint locations and seawall construction; and</li> </ul>		I
			<ul> <li>A DEZ would also be implemented during bored piling work but as a precautionary measure only.</li> </ul>		N/A
13.11.5.19	10.4	2.31	Acoustic Decoupling of Construction Equipment	Around coastal works	1
			<ul> <li>Air compressors and other noisy equipment that must be mounted on steel barges should be acoustically-decoupled to the greatest extent feasible, for instance by using rubber or air-filled tyres; and</li> </ul>	area during construction phase	
			<ul> <li>Specific acoustic decoupling measures shall be specified during the detailed design of the project for use during the land formation works.</li> </ul>		
13.11.5.20	10.6.1	2.29	Spill Response Plan	Construction phase	1
			<ul> <li>An oil and hazardous chemical spill response plan is proposed to be established during the construction phase as a precautionary measure so that appropriate actions to prevent or reduce risks to CWDs can be undertaken in the event of an accidental spillage.</li> </ul>		



EIA Ref.	EM&A EP Environmental Protection Measures Ref. Condition		Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
13.11.5.21 to 13.11.5.23	10.6.1	-	Construction Vessel Speed Limits and Skipper Training  A speed limit of 10 knots should be strictly observed for construction vessels at areas with the highest CWD densities; and  Vessels traversing through the work areas should be required to use predefined and regular routes (which would presumably become known to resident dolphins) to reduce disturbance to cetaceans due to vessel movements. Specific marine routes shall be specified by the Contractor prior to construction commencing.	All areas north and west of Lantau Island during construction phase	I
			Fisheries Impact – Construction Phase		
14.9.1.2 to 14.9.1.5	-		Minimisation of Land Formation Area  Minimise the overall size of the land formation needed for the additional facilities to minimise the overall loss of habitat for fisheries resources.	Land formation footprint / during detailed design phase to completion of construction	I
14.9.1.6	-	-	Use of Construction Methods with Minimal Risk/Disturbance  Use of non-dredge method for the main land formation and ancillary works including the diversion of the aviation fuel pipeline to the AFRF;	During construction phase at marine works area	1
			<ul> <li>Use of Deep Cement Mixing (DCM) method instead of conventional seabed dredging for the land formation works to reduce the risk of negative impacts through the elevation of suspended solids and contaminants on fisheries and the marine environment;</li> </ul>	-	1
			<ul> <li>Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; and</li> </ul>		N/A
			<ul> <li>Use of horizontal directional drilling (HDD) method and water jetting methods for placement of undersea cables and pipelines to minimise the disturbance to fisheries resources.</li> </ul>	_	I
14.9.1.11	-		Strict Enforcement of No-Dumping Policy  • A policy prohibiting dumping of wastes, chemicals, oil, trash, plastic, or any other substance that would potentially be harmful to dolphins and/or their habitat in the work area;	All works area during the construction phase	I
			<ul> <li>Mandatory educational programme of the no-dumpling policy be made available to all construction site personnel for all project-related works;</li> </ul>		
			■ Fines for infractions should be implemented; and		
			<ul> <li>Unscheduled, on-site audits shall be implemented.</li> </ul>		
14.9.1.12	-		<ul> <li>Good Construction Site Practices</li> <li>Regular inspection of the integrity and effectiveness of all silt curtains and monitoring of effluents to ensure that any discharge meets effluent discharge guidelines;</li> <li>Keep the number of working or stationary vessels present on-site to the minimum anytime; and</li> </ul>	All works area during the construction phase	I



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			<ul> <li>Unscheduled, on-site audits for all good site practice restrictions should be conducted, and fines or penalties sufficient to be an effective deterrent need to be levied against violators.</li> </ul>		
14.9.1.13	-		Mitigation for Indirect Disturbance due to Deterioration of Water Quality	All works area during	
to 14.9.1.18			<ul> <li>Water quality mitigation measures during construction phases include consideration of alternative construction methods, deployment of silt curtain and good site practices;</li> </ul>	the construction phase	1
			Alternative construction methods including use of non-dredge methods for ground improvement (e.g. Deep Cement Mixing (DCM), prefabricated vertical drains (PVD), sand compaction piles, steel cells, stone columns and vertical sand drains);		1
			<ul> <li>Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; and</li> </ul>		N/A
			<ul> <li>Use of horizontal directional drilling (HDD) method and water jetting methods for placement of undersea cables and pipelines to minimise the disturbance to fisheries resources.</li> </ul>	-	I
			Landscape and Visual Impact – Construction Phase		
Table 15.6	12.3	-	CM1 - The construction area and contractor's temporary works areas should be minimised to avoid impacts on adjacent landscape.	All works areas for duration of works;	I
				Upon handover and completion of works.	
Table 15.6	12.3	-	CM2 - Reduction of construction period to practical minimum.	All works areas for duration of works;	I
				Upon handover and completion of works.	
Table 15.6	12.3	-	CM3 - Phasing of the construction stage to reduce visual impacts during the construction phase.	All works areas for duration of works;	I
				Upon handover and completion of works.	
Table 15.6	12.3	-	<b>CM4 -</b> Construction traffic (land and sea) including construction plants, construction vessels and barges should be kept to a practical minimum.	All works areas for duration of works;	I
				Upon handover and completion of works.	
Table 15.6	12.3	-	CM5 - Erection of decorative mesh screens or construction hoardings around works areas in visually unobtrusive colours.	All works areas for duration of works;	I
				Upon handover and completion of works. –	



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
				may be disassembled in phases	
Table 15.6	12.3	-	CM6 - Avoidance of excessive height and bulk of site buildings and structures.	New passenger concourse, terminal 2 expansion and other proposed airport related buildings and structures under the project; Upon handover and	N/A
				completion of works.	
Table 15.6 12.3 -	-	CM7 - Control of night-time lighting by hooding all lights and through minimisation of night working periods.	All works areas for duration of works;	I	
				Upon handover and completion of works. – may be disassembled in phases	
Table 15.6 12.3 -		-	CM8 - All existing trees shall be carefully protected during construction. Detailed Tree Protection Specification shall be provided in the Contract Specification. Under this specification, the Contractor shall	All existing trees to be retained;	I
			be required to submit, for approval, a detailed working method statement for the protection of trees prior to undertaking any works adjacent to all retained trees, including trees in contractor's works areas.	Upon handover and completion of works.	
Table 15.6	12.3	-	<b>CM9 -</b> Trees unavoidably affected by the works shall be transplanted where practical. A detailed Tree Transplanting Specification shall be provided in the Contract Specification, if applicable. Sufficient time for	All existing trees to be affected by the works;	I
			necessary tree root and crown preparation periods shall be allowed in the project programme.	Upon handover and completion of works.	
Table 15.6	12.3	-	<b>CM10 -</b> Land formation works shall be followed with advanced hydroseeding around taxiways and runways as soon as practical.	All affected existing grass areas around runways and verges/Duration of works;	N/A
				Upon handover and completion of works.	
			Cultural Heritage Impact - Construction Phase		
			Not applicable.		



EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Health Impact - Aircraft Emissions		
			Not applicable.		
			Health Impact - Aircraft Noise		
	•		Not applicable.		

Notes:

I= implemented where applicable;

N/A= not applicable to the construction works implemented during the reporting month. ^ Checked by ET through site inspection and record provided by the Contractor.

# Appendix B. Monitoring Schedule

# Monitoring Schedule of This Reporting Period

# Aug-19

			<del>, , , , , , , , , , , , , , , , , , , </del>			
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1 Site Inspection	Site Inspection	3
					AR1A, AR2 <sup>(2)</sup> NM1A, NM4, NM5, NM6	
				WQ General & Regular DCM <sup>(1)</sup> mid-ebb: 13:11 mid-flood: 20:18		WQ General & Regular DCM mid-ebb: 14:43 mid-flood: 07:49
4	5	6	7	8 8	9	10
•		Site Inspection  AR1A, AR2	Site Inspection CWD Survey (Vessel)	Site Inspection CWD Survey (Vessel)	Site Inspection	10
		NM1A, NM4, NM5, NM6 WQ General & Regular DCM		WQ General & Regular DCM		WQ General & Regular DCM
		mid-ebb: 17:07 mid-flood: 10:37		mid-ebb: 06:59 mid-flood: 13:21		mid-ebb: 09:26 mid-flood: 16:50
11	12	13	14	15	16	17
	CWD Survey (Vessel)	Site Inspection CWD Survey (Vessel)	Site Inspection	Site Inspection CWD Survey (Land-based)	Site Inspection CWD Survey (Vessel)	
	AR1A, AR2 NM1A, NM4, NM5, NM6	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			, , , , , , , , , , , , , , , , , , , ,	AR1A, AR2
		WQ General & Regular DCM		WQ General & Regular DCM		WQ General & Regular DCM
		mid-ebb: 11:53 mid-flood: 04:48		mid-ebb: 13:08 mid-flood: 06:12		mid-ebb: 14:15 mid-flood: 07:29
18	19	20	21	22	23	24
		Site Inspection	Site Inspection	Site Inspection	Site Inspection	
			CWD Survey (Vessel)	CWD Survey (Vessel, Land-based)	AB4A AB2	
					AR1A, AR2 NM1A, NM4, NM5	NM6
		WQ General & Regular DCM mid-ebb: 15:42		WQ General & Regular DCM mid-ebb: 16:53		WQ General & Regular DCM mid-ebb: 06:57
		mid-flood: 13.42		mid-flood: 11:03		mid-flood: 13:46
25	26	27	28	29	30	31
	Site Inspection CWD Survey (Vessel)	Site Inspection CWD Survey (Land-based)	Site Inspection	Site Inspection  AR1A, AR2	Site Inspection	
				NM1A, NM4, NM5, NM6		
		WQ General & Regular DCM mid-ebb: 10:23		WQ General & Regular DCM mid-ebb: 12:07		WQ General & Regular DCM mid-ebb: 13:41
		mid-flood: 17:49		mid-flood: 19:11		mid-flood: 20:25
		Notes:				
		CWD - Chinese White Dolphin	NIMA A /A DA A - Mary Tripe December 1			
		Air quality and Noise Monitoring Station	NM1A/AR1A - Man Tung Road Park NM4 - Ching Chung Hau Po Woon F NM5/AR2 - Village House, Tin Sum NM6 - House No. 1, Sha Lo Wan			
		WQ - Water Quality DCM - Deep Cement Mixing	ININIO - HOUSE INO. 1, SHA LO WAII			
				trong Wond Signal No. 3 and thunderstorm wa 9 to 2 August 2019 due to Strong Wind Signal		

# Tentative Monitoring Schedule of Next Reporting Period

# Sep-19

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1	2 Site Inspection	3 Site Inspection	4 Site Inspection AR1A, AR2 NM1A, NM4, NM5, NM6	5 Site Inspection	6 Site Inspection CWD Survey (Vessel)	7
8	9 CWD Survey (Vessel, Land-based)	WQ General & Regular DCM mid-ebb: 15:55 mid-flood: 09:35  10 Site Inspection CWD Survey (Land-based)	11 Site Inspection CWD Survey (Vessel)	WQ General & Regular DCM mid-ebb: 17:36 mid-flood: 11:50  12 Site Inspection CWD Survey (Vessel)	13 Site Inspection	WQ General & Regular DCM mid-ebb: 07:21 mid-flood: 15:25 14
	CWD Survey (Vessel, Laric-Dased)	AR1A, AR2 NM1A, NM4, NM5, NM6  WQ General & Regular DCM mid-ebb: 10:50 mid-flood: 03:48		WQ General & Regular DCM mid-ebb: 12:10 mid-flood: 05:26		WQ General & Regular DCM mid-ebb: 13:16 mid-flood: 06:44
15	CWD Survey (Vessel) AR1A, AR2 NM1A, NM4, NM5, NM6	Site Inspection CWD Survey (Vessel)	Site Inspection CWD Survey (Vessel)	19 Site Inspection	Site Inspection CWD Survey (Land-based)	<b>21</b> AR1A, AR2
22	23	WQ General & Regular DCM mid-ebb: 14:42 mid-flood: 08:35  24	25	WQ General & Regular DCM mid-ebb: 15:48 mid-flood: 10:00  26	27	WQ General & Regular DCM mid-ebb: 17:22 mid-flood: 12:10 28
	CWD Survey (Vessel)	Site Inspection  WQ General & Regular DCM mid-ebb: 08:42 mid-flood: 16:42	Site Inspection	Site Inspection  WQ General & Regular DCM mid-ebb: 10:56 mid-flood: 18:02	Site Inspection  AR1A, AR2  NM1A, NM4, NM5, NM6	WQ General & Regular DCM mid-ebb: 12:35 mid-flood: 19:08
29	30					
		Air quality and Noise Monitoring Station	NM1A/AR1A - Man Tung Road Park NM4 - Ching Chung Hau Po Woon Pr NM5/AR2 - Village House, Tin Sum NM6 - House No. 1, Sha Lo Wan	rimary School		

# **Appendix C. Monitoring Results**

Air Ouglitu Manitarina Dagulta
Air Quality Monitoring Results

#### 1-hour TSP Results


### Station: AR1A- Man Tung Road Park


Date	Time	Weather	Wind Speed (m/s)	Wind Direction	1-hr TSP (μg/m³)	Action Level	Limit Level
				(deg)	. (1-0)	(μg/m³)	(μg/m³)
02-Aug-19	13:38	Cloudy	6.3	84	25	306	500
02-Aug-19	14:38	Cloudy	9.0	94	23	306	500
02-Aug-19	15:38	Cloudy	9.1	101	18	306	500
06-Aug-19	14:16	Cloudy	1.6	353	23	306	500
06-Aug-19	15:16	Cloudy	3.7	62	22	306	500
06-Aug-19	16:16	Cloudy	3.0	62	25	306	500
12-Aug-19	12:09	Sunny	4.8	248	19	306	500
12-Aug-19	13:09	Sunny	5.3	236	18	306	500
12-Aug-19	14:09	Sunny	7.2	230	17	306	500
17-Aug-19	14:00	Rainy	2.7	281	22	306	500
17-Aug-19	15:00	Rainy	6.7	227	16	306	500
17-Aug-19	16:00	Rainy	5.7	227	24	306	500
23-Aug-19	9:31	Drizzle	2.0	81	80	306	500
23-Aug-19	10:31	Drizzle	4.1	243	77	306	500
23-Aug-19	11:31	Drizzle	3.1	235	99	306	500
29-Aug-19	9:45	Cloudy	8.2	98	32	306	500
29-Aug-19	10:45	Cloudy	8.3	105	27	306	500
29-Aug-19	11:45	Cloudy	9.1	103	40	306	500

#### 1-hour TSP Results

Station: AR2- Village House, Tin Sum

Station. Alva- Villag	c mouse, min.	Julii			T.	,	
Date	Time	Weather	Wind Speed (m/s)	Wind Direction (deg)	1-hr TSP (μg/m³)	Action Level (μg/m³)	Limit Level (µg/m³)
02-Aug-19	9:30	Cloudy	6.3	84	31	298	500
02-Aug-19	10:30	Cloudy	9.0	94	25	298	500
02-Aug-19	11:30	Cloudy	9.1	101	23	298	500
06-Aug-19	9:42	Cloudy	2.4	21	19	298	500
06-Aug-19	10:42	Cloudy	2.5	8	20	298	500
06-Aug-19	11:42	Cloudy	1.3	Variable	15	298	500
12-Aug-19	9:31	Sunny	4.4	235	22	298	500
12-Aug-19	10:31	Sunny	4.0	239	21	298	500
12-Aug-19	11:31	Sunny	3.8	247	22	298	500
17-Aug-19	9:45	Rainy	2.4	347	51	298	500
17-Aug-19	10:45	Rainy	2.0	8	61	298	500
17-Aug-19	11:45	Rainy	1.8	127	25	298	500
23-Aug-19	12:02	Drizzle	3.8	272	91	298	500
23-Aug-19	13:02	Drizzle	3.1	271	43	298	500
23-Aug-19	14:02	Drizzle	1.9	286	64	298	500
29-Aug-19	9:40	Cloudy	8.5	102	25	298	500
29-Aug-19	10:40	Cloudy	8.1	104	24	298	500
29-Aug-19	11:40	Cloudy	8.7	100	25	298	500

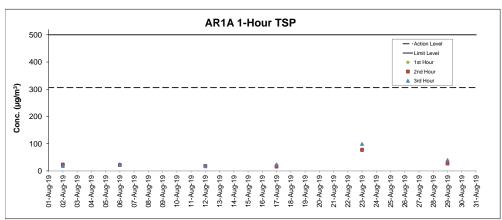

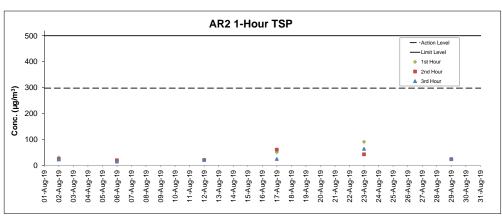

- Notes

  1. Major site activities carried out during the reporting period are summarized in Section 1.4 of the monthly EM&A report.

  2. Weather conditions during monitoring are presented in the data tables above.

  3. QA/QC requirements as stipulated in the EM&A Manual were carried out during measurement.

Noise Monitoring Results	

Mott MacDonald | Expansion of Hong Kong International Airport into a Three-Runway System

### **Noise Measurement Results**

Station: NM1A- Man Tung Road Park

Date	Weather	Time	Measured	Measured	1 1974)
Date	weather	Time	<b>L</b> <sub>10</sub> dB(A)	<b>L</b> <sub>90</sub> dB(A)	L <sub>eq(30mins)</sub> dB(A)
02-Aug-19	Cloudy	13:49	73.1	55.6	
02-Aug-19	Cloudy	13:54	72.8	55.5	
02-Aug-19	Cloudy	13:59	73.5	56.6	72
02-Aug-19	Cloudy	14:04	71.3	54.7	/2
02-Aug-19	Cloudy	14:09	71.4	54.7	
02-Aug-19	Cloudy	14:14	74.0	55.7	
06-Aug-19	Cloudy	14:45	67.0	60.5	
06-Aug-19	Cloudy	14:50	70.3	61.2	
06-Aug-19	Cloudy	14:55	66.7	61.1	71
06-Aug-19	Cloudy	15:00	71.7	57.3	/1
06-Aug-19	Cloudy	15:05	71.6	60.0	
06-Aug-19	Cloudy	15:10	70.3	58.0	
12-Aug-19	Sunny	12:22	71.0	58.0	
12-Aug-19	Sunny	12:27	68.6	56.0	
12-Aug-19	Sunny	12:32	68.5	56.4	70
12-Aug-19	Sunny	12:37	70.6	56.6	70
12-Aug-19	Sunny	12:42	71.1	57.1	
12-Aug-19	Sunny	12:47	68.3	58.7	
23-Aug-19	Cloudy	10:47	73.0	56.8	
23-Aug-19	Cloudy	10:52	75.7	58.2	
23-Aug-19	Cloudy	10:57	76.4	56.7	67
23-Aug-19	Cloudy	11:02	75.4	56.7	67
23-Aug-19	Cloudy	11:07	75.1	54.1	
23-Aug-19	Cloudy	11:12	76.2	56.4	
29-Aug-19	Cloudy	11:04	71.8	59.1	
29-Aug-19	Cloudy	11:09	73.9	59.8	
29-Aug-19	Cloudy	11:14	73.0	58.6	72
29-Aug-19	Cloudy	11:19	73.7	59.3	/2
29-Aug-19	Cloudy	11:24	71.7	57.2	
29-Aug-19	Cloudy	11:29	70.9	58.5	

### Noise Measurement Results

Station: NM4- Ching Chung Hau Po Woon Primary School

Date	Weather		Measured	Measured	
Date	weather	Time	$\mathbf{L}_{10}  \mathrm{dB}(A)$	<b>L</b> <sub>90</sub> dB(A)	L <sub>eq(30mins)</sub> dB(A)
02-Aug-19	Cloudy	11:39	63.5	59.7	
02-Aug-19	Cloudy	11:44	63.8	59.9	
02-Aug-19	Cloudy	11:49	63.3	59.6	65
02-Aug-19	Cloudy	11:54	66.2	60.2	65
02-Aug-19	Cloudy	11:59	64.4	59.6	
02-Aug-19	Cloudy	12:04	63.2	58.9	
06-Aug-19	Cloudy	17:08	59.5	56.2	
06-Aug-19	Cloudy	17:13	58.1	56.6	
06-Aug-19	Cloudy	17:18	57.5	54.7	59
06-Aug-19	Cloudy	17:23	56.4	54.0	39
06-Aug-19	Cloudy	17:28	56.6	52.7	
06-Aug-19	Cloudy	17:33	57.7	51.7	
12-Aug-19	Sunny	14:22	61.4	56.8	
12-Aug-19	Sunny	14:27	59.0	56.7	
12-Aug-19	Sunny	14:32	60.4	56.9	62
12-Aug-19	Sunny	14:37	61.7	58.0	02
12-Aug-19	Sunny	14:42	61.5	57.5	
12-Aug-19	Sunny	14:47	61.7	57.7	
23-Aug-19	Cloudy	15:56	61.9	58.1	
23-Aug-19	Cloudy	16:01	62.5	58.4	
23-Aug-19	Cloudy	16:06	63.4	58.6	65
23-Aug-19	Cloudy	16:11	63.0	57.9	03
23-Aug-19	Cloudy	16:16	64.4	58.9	
23-Aug-19	Cloudy	16:21	63.8	58.7	
29-Aug-19	Drizzle	14:15	62.1	57.5	
29-Aug-19	Drizzle	14:20	60.5	57.2	
29-Aug-19	Drizzle	14:25	59.9	57.0	62
29-Aug-19	Drizzle	14:30	59.3	56.5	02
29-Aug-19	Drizzle	14:35	59.2	57.1	
29-Aug-19	Drizzle	14:40	58.5	57.0	

Remarks: +3dB (A) correction was applied to free-field measurement.

Remarks: +3dB (A) correction was applied to free-field measurement.

### **Noise Measurement Results**

Station: NM5- Village House, Tin Sum

Date	Weather	Time	Measured	Measured	1 40(4)
Date	weather	Time	<b>L</b> <sub>10</sub> dB(A)	<b>L</b> <sub>90</sub> dB(A)	L <sub>eq(30mins)</sub> dB(A)
02-Aug-19	Cloudy	9:39	53.3	46.7	
02-Aug-19	Cloudy	9:44	57.1	48.4	
02-Aug-19	Cloudy	9:49	51.1	46.0	57
02-Aug-19	Cloudy	9:54	51.4	46.9	37
02-Aug-19	Cloudy	9:59	59.0	47.7	
02-Aug-19	Cloudy	10:04	55.4	48.5	
06-Aug-19	Cloudy	9:48	56.6	48.2	
06-Aug-19	Cloudy	9:53	53.7	47.5	
06-Aug-19	Cloudy	9:58	53.5	48.3	57
06-Aug-19	Cloudy	10:03	60.3	48.8	5/
06-Aug-19	Cloudy	10:08	56.2	50.2	
06-Aug-19	Cloudy	10:13	54.0	46.6	
12-Aug-19	Sunny	10:33	53.1	43.8	
12-Aug-19	Sunny	10:38	52.1	46.7	
12-Aug-19	Sunny	10:43	53.8	47.0	55
12-Aug-19	Sunny	10:48	49.1	43.2	33
12-Aug-19	Sunny	10:53	55.2	46.5	
12-Aug-19	Sunny	10:58	54.8	45.9	
23-Aug-19	Cloudy	12:35	53.0	45.4	
23-Aug-19	Cloudy	12:40	52.2	45.8	
23-Aug-19	Cloudy	12:45	52.7	45.0	55
23-Aug-19	Cloudy	12:50	52.7	43.7	33
23-Aug-19	Cloudy	12:55	58.3	45.3	
23-Aug-19	Cloudy	13:00	51.6	46.4	
29-Aug-19	Cloudy	9:42	67.2	49.0	
29-Aug-19	Cloudy	9:47	57.4	48.6	
29-Aug-19	Cloudy	9:52	55.0	48.0	64
29-Aug-19	Cloudy	9:57	55.4	48.7	04
29-Aug-19	Cloudy	10:02	53.5	48.2	
29-Aug-19	Cloudy	10:07	57.1	48.7	


### **Noise Measurement Results**


Station: NM6- House No.1 Sha Lo Wan


Date	Weather	Time	Measured	Measured	I dp(A)
			<b>L</b> <sub>10</sub> dB(A)	L <sub>90</sub> dB(A)	L <sub>eq(30mins)</sub> dB(A)
02-Aug-19	Cloudy	9:48	63.8	59.4	
02-Aug-19	Cloudy	9:53	62.5	59.5	
02-Aug-19	Cloudy	9:58	62.5	59.3	- 66
02-Aug-19	Cloudy	10:03	66.9	59.5	00
02-Aug-19	Cloudy	10:08	64.4	59.7	
02-Aug-19	Cloudy	10:13	71.9	59.4	
06-Aug-19	Sunny	15:44	69.6	54.9	
06-Aug-19	Sunny	15:49	65.8	60.6	
06-Aug-19	Sunny	15:54	67.4	62.5	67
06-Aug-19	Sunny	15:59	70.2	56.1	0/
06-Aug-19	Sunny	16:04	65.9	56.6	
06-Aug-19	Sunny	16:09	65.1	56.7	
12-Aug-19	Sunny	15:42	72.4	48.0	
12-Aug-19	Sunny	15:47	69.0	47.2	
12-Aug-19	Sunny	15:52	68.8	46.5	66
12-Aug-19	Sunny	15:57	70.1	47.2	- 00
12-Aug-19	Sunny	16:02	71.4	47.1	
12-Aug-19	Sunny	16:07	70.8	46.6	
24-Aug-19	Cloudy	9:49	74.2	50.8	
24-Aug-19	Cloudy	9:54	72.3	48.7	
24-Aug-19	Cloudy	9:59	71.4	47.4	68
24-Aug-19	Cloudy	10:04	71.3	45.4	00
24-Aug-19	Cloudy	10:09	74.3	48.2	
24-Aug-19	Cloudy	10:14	63.5	46.6	
29-Aug-19	Cloudy	15:39	70.1	60.6	
29-Aug-19	Cloudy	15:44	69.6	58.2	
29-Aug-19	Cloudy	15:49	61.3	52.5	68
29-Aug-19	Cloudy	15:54	67.6	51.1	00
29-Aug-19	Cloudy	15:59	71.3	60.6	
29-Aug-19	Cloudy	16:04	67.1	57.6	


Remarks:
+3dB (A) correction was applied to free-field measurement.

Remarks:
+3dB (A) correction was applied to free-field measurement.

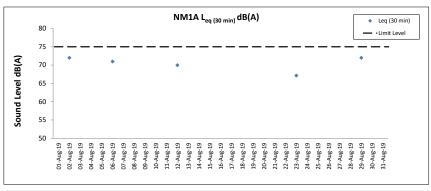

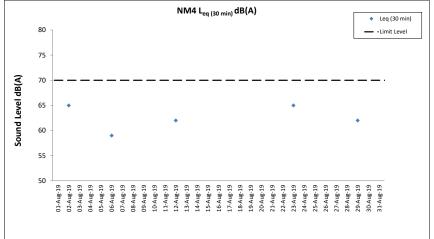

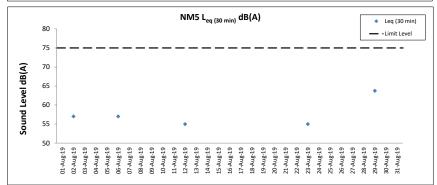

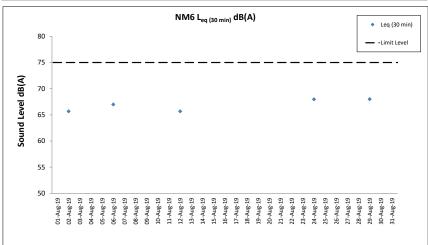

### Notes

- 1. Major site activities carried out during the reporting period are summarized in Section 1.4 of the monthly EM&A report.
- Weather conditions during monitoring are presented in the data tables above.
   QA/QC requirements as stipulated in the EM&A Manual were carried out during measurement.

Nott MacDonald   Expansion of Hong Kong International Airport into a Three-Runway System
Mator Quality Monitoring Posults
Water Quality Monitoring Results

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 03 August 19 during N

03 August 19 during Mid-Ebb Tide

Water Qua	lity Moni	toring Res	ults on		03 August 19	during Mid-	Ebb Tid	е																				
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	th (m)	Current Speed	Current	Water Te	emperature (°C)		pН	Salin	ity (ppt)	DOS	aturation (%)	Dissolve Oxyger		Turbidity(f	NTU)	Suspende (mg.		Total Alkali (ppm)	Coordina HK Gri			ım Nickel (μg/	/L)
Station	Condition	Condition	Time	Depth (m)		, ,	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value D	DA	Value	DA	Value	DA	Value D	A (Northin	g) (Easting)	) Value E	DA Value D	Α
					Surface	1.0	0.4	199 207	26.5 26.5	26.5	7.9 7.9	7.9	25.9 25.9	25.9	77.5 77.4	77.5	5.4	. F	2.0		6 7		84 84			<0.2	1.4	
C1	Rainy	Moderate	13:54	7.8	Middle	3.9 3.9	0.6 0.6	192 194	26.5 26.5	26.5	7.9 7.9	7.9	26.8 26.8	26.8	74.0 74.0	74.0	5.1 5.1	5.3	3.3	4.0	8	8	87 87	7 81563	804247	<0.2	0.2 1.4 1.	.4
					Bottom	6.8 6.8	0.4	194 199	26.6 26.6	26.6	7.9 7.9	7.9	27.1	27.1	73.8 73.8	73.8	5.1 5.1	i.1	6.8 6.8	Ī	8		91 91			<0.2	1.5	
					Surface	1.0	0.3	57 57	27.3	27.3	7.7	7.7	18.8	18.8	79.0 79.0	79.0	5.6	F	5.6		12		82			<0.2	1.1	T
C2	Cloudy	Rough	12:59	8.1	Middle	4.1	0.6	104 110	27.2	27.2	7.7	7.7	19.4	19.4	79.4 79.5	79.5	5.7	5.7	7.5 7.5	7.0	10	11	86 87	7 82566	806950	40.2	0.2 1.2 1.	.1
					Bottom	7.1	0.6	91 98	27.1	27.1	7.7	7.7	19.6	19.6	79.7 79.7	79.7	5.7	5.7	8.0	Ī	9		91			<0.2	1.1	
					Surface	1.0	0.6	95	27.1	27.1	7.9	7.9	21.1	21.1	80.1	80.0	5.7		0.8		6		82			<0.2	1.0	T
СЗ	Cloudy	Rough	15:05	11.8	Middle	1.0 5.9	0.7 0.5	100 90	27.1 26.7	26.7	7.9 7.9	7.9	21.1	23.7	79.9 74.6	74.6	5.2	5.5	0.8 1.2	1.4	4 6	5	83 87 8	7 82210	817804	<0.2	0.2 0.9 1.	.0
	,				Bottom	5.9 10.8	0.5	98 118	26.7 26.7	26.7	7.9 8.0	8.0	23.7 24.1	24.1	74.6 77.3	77.4	5.2 5.4	5.4	1.2 2.1		5 4		87 91			<0.2	1.1	
					Surface	10.8	0.3	118 180	26.7	28.3	7.9	7.9	24.1 14.1	14.1	77.4 98.4	98.5	7.1		2.0 3.6		4 11		91 85			<0.2	1.0	$\dashv$
IM1	Rainy	Moderate	13:40	5.6	Middle	1.0	0.3	181 -	28.3		7.9		14.1	-	98.5		7.1 7	1.1	3.6	4.5	12	9	85 - 8	7 81795	807128	<0.2	0.2 - 1.	.0
	ramy	Wodorato	10.10	0.0	Bottom	4.6	0.3	165	28.3	28.3	8.0	8.0	14.1	14.1	99.2	99.3	7.2	.2	5.5		- 6		- 88	01100	007.120	<0.2	1.0	
					Surface	4.6 1.0	0.3	175 111	28.2 27.3	27.4	8.0	8.0	14.1 19.4	19.4	99.3 90.5	90.5	7.2 <sup>7</sup>		5.3 6.3		5 11		88 84			<0.2	1.0	-
IM2	Rainy	Moderate	13:35	8.9	Middle	1.0 4.5	0.3	112 134	27.4 27.3	27.3	8.0	8.0	19.4 18.8	18.8	90.5 90.9	90.9	6.5	6.5	6.2 6.5	7.2	12 12	11	84 87	7 81815	806180	<0.2	0.9	.0
IIVIZ	reality	Woderate	15.55	0.3	Bottom	4.5 7.9	0.2	142 160	27.3 27.2	27.2	8.0	8.0	18.8 19.6	19.6	90.9 91.1	91.2	6.5 6.5	5.5	6.9 8.5	'	11 10		86 89	01013	000100	<0.2	1.0	.0
					Surface	7.9 1.0	0.1	167 258	27.2		8.0		19.6 18.5		91.2 91.7		6.5	0.5	8.5 4.7		11		89 85		1	<0.2	0.9 1.0	_
11.40	D.:		40.00	0.4		1.0 4.6	0.1 0.2	279 188	27.7 27.8	27.7	8.0	8.0	18.5 18.0	18.5	91.8 92.6	91.8	6.5 6.6	6.6	4.6 5.4		12 10		84	04070		<0.2	1.0	
IM3	Rainy	Moderate	13:29	9.1	Middle	4.6 8.1	0.2	204 203	27.8 27.2	27.8	8.0 8.0	8.0	18.0 20.6	18.0	92.9 92.9	92.8	6.6		5.5 7.6	5.9	11 11	11	86	81879	805578	<0.2	0.2 1.0 1. 1.0	.0
					Bottom	8.1 1.0	0.4	205 172	27.2 27.4	27.2	8.0	8.0	20.6 19.3	20.6	92.9 89.5	92.9	6.6	5.6	7.6 5.4		12 9		88 88		-	<0.2	0.9	=
					Surface	1.0	0.9	176 180	27.4	27.4	8.0	8.0	19.3	19.3	89.7 90.6	89.6	6.4	5.5	5.3	F	8		88			<0.2	0.9	
IM4	Rainy	Moderate	13:21	9.3	Middle	4.7 8.3	0.9	197 169	27.5	27.6	8.0	8.0	18.3	18.3	90.4	90.5	6.5	_	5.9 7.1	6.1	10	10	85 85	81974	804607	<0.2	0.2 0.9 0.	.9
					Bottom	8.3 1.0	0.6	183	27.3	27.3	8.0 7.9	8.0	22.0	22.0	90.0	90.0	6.3 6.5	5.3	7.2	-	12		85 88		_	<0.2	0.9	_
					Surface	1.0	0.6	214 243	27.8 27.8	27.8	7.9 8.0	7.9	16.5 16.7	16.5	90.5	90.5	e e	5.5	5.4 5.6		6		88 86			<0.2	1.0	
IM5	Rainy	Moderate	13:12	8.7	Middle	4.4	0.6	255 221	27.7	27.8	8.0	8.0	16.7	16.7	90.7	90.7	6.5		5.9 7.2	6.1	4 5	5	85 89	82072	804882	<0.2	0.2 0.9 0.	.9
					Bottom	7.7	0.6	228	27.2	27.2	8.0	8.0	20.7	20.7	90.0	90.0	6.4	6.4	7.2	-	4		89			<0.2	0.9	
					Surface	1.0	0.4	212 237	27.5 27.5 27.4	27.5	7.9	7.9	17.4	17.4	89.3 89.2	89.3	6.4 6.4 6.3	5.4	4.9 5.0 5.5	Į	7		84 85 88			<0.2	0.9	
IM6	Rainy	Moderate	13:05	8.6	Middle	4.3	0.4	245	27.4	27.4	8.0	8.0	17.4	17.4	88.4 88.3	88.4	6.3		5.7	6.1	5	6	87	7 82103	805818	<0.2	0.2 0.9 0.	.9
					Bottom	7.6 7.6	0.3	226 245	27.3 27.4	27.4	8.0	8.0	19.7 19.7	19.7	88.2 88.3	88.3	6.3	5.3	7.5 7.9	-	5		89 89			<0.2	0.9	
					Surface	1.0	0.4	189 205	27.6 27.6	27.6	7.9 7.9	7.9	16.2 16.2	16.2	87.8 87.8	87.8	6.3	5.4	4.3		8 7		83 82			<0.2	0.8	
IM7	Rainy	Moderate	12:59	9.0	Middle	4.5 4.5	0.3	211 222	27.7 27.7	27.7	7.9 7.9	7.9	16.1 16.2	16.1	88.2 88.3	88.3	6.4	ŀ	4.9 5.0	5.0	7 6	6	85 86	82137	806825	<0.2	0.8	.8
					Bottom	8.0 8.0	0.1 0.1	192 194	27.6 27.6	27.6	7.9 7.9	7.9	17.6 17.6	17.6	88.5 88.5	88.5	6.3	5.3	5.6 5.7	-	5 5		88 88			<0.2	0.9	
					Surface	1.0	0.1	37 39	27.3 27.3	27.3	7.6 7.6	7.6	18.3 18.3	18.3	79.4 79.5	79.5	5.7 5.7	5.8	5.0 5.0	E	6 7		83 83			<0.2	1.0	
IM8	Cloudy	Rough	13:39	8.2	Middle	4.1 4.1	0.4 0.4	51 52	27.2 27.2	27.2	7.7	7.7	19.7 19.7	19.7	82.7 82.8	82.8	5.9	_	5.9 5.9	6.0	6	6	91 8	82182	808135	<0.2	0.2 0.8 0.	.9
					Bottom	7.2 7.2	0.6 0.7	53 57	27.1 27.1	27.1	7.8 7.8	7.8	21.0	21.0	83.8 83.9	83.9	5.9 5.9	5.9	7.2 7.2	I	7		91 91			<0.2	0.9 1.0	

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

Note: The monitoring session on 1 August 2019 was cancelled due to Strong Wind Signal No. 3 and thunderstorm warning.

Water Quality Monitoring
Water Quality Monitoring Results on

Water Qua	lity Monit	oring Resu	ults on		03 August 19	during Mid-	Ebb Tid	е																						
Monitoring	Weather	Sea	Sampling	Water	Sampling Dept	h (m)	Current Speed	Current	Water Te	mperature (°C)		рН	Salir	nity (ppt)		aturation (%)	Dissol Oxyg		Turbidity(I	NTU)	Suspende (mg/		Total A		Coordinate HK Grid	Coordinate HK Grid	Chrom (µg/		Nickel (	μg/L)
Station	Condition	Condition	Time	Depth (m)	5		(m/s)	Direction	Value	Average		Average		Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA		DA
					Surface	1.0	0.4	189 201	27.4	27.4	7.7	7.7	18.3	18.3	82.1 82.1	82.1	5.9 5.9		3.3	-	8 7		82 82	ł			<0.2		0.9	
IM9	Cloudy	Rough	13:44	7.9	Middle	4.0 4.0	0.2	149 153	27.1 27.1	27.1	7.7	7.7	20.6	20.6	82.8 82.7	82.8	5.9 5.9	5.9	6.4	6.6	7	7	86 87	87	822101	808806	<0.2	<0.2	0.8	0.9
					Bottom	6.9	0.4	122	27.0	27.0	7.8	7.8	21.7	21.7	83.1	83.1	5.9	5.9	10.1	į	7		91				<0.2		1.0	
						6.9 1.0	0.4	124 124	27.0 27.5		7.8		21.7 18.0		83.0 81.2		5.9 5.8	0.0	10.1 3.2		7		91 82				<0.2		0.9	_
					Surface	1.0	0.4	136	27.5	27.5	7.7	7.7	18.0	18.0	81.1	81.2	5.8	5.9	3.2	-	8		83 87				<0.2	. [	0.9	
IM10	Cloudy	Rough	13:51	7.6	Middle	3.8	0.4	121 125	27.3 27.3	27.3	7.7	7.7	18.8	18.8	82.2 82.2	82.2	5.9 5.9	-	6.1 6.2	6.2	8 7	8	87	87	822405	809803	<0.2		1.0 0.8	0.9
					Bottom	6.6	0.2	105 111	27.0 27.0	27.0	7.8	7.8	21.3	21.3	83.3 83.4	83.4	5.9 5.9	5.9	9.1 9.1	-	9		91 91	1			<0.2		0.9	
					Surface	1.0 1.0	0.6	70 72	27.4 27.4	27.4	7.8	7.8	19.1 19.1	19.1	78.9 78.6	78.8	5.6 5.6	L	4.0 4.0	ļ	9 10		83 83				<0.2	ŀ	0.8	
IM11	Cloudy	Rough	14:01	7.8	Middle	3.9	0.6	67	27.0	27.0	7.8	7.8	20.7	20.7	76.1	76.1	5.4	5.5	5.2	5.7	9	q	86	87	822038	811451	<0.2	<0.2	0.9	0.9
	Cloudy	rtougii	11.01	7.0		3.9 6.8	0.6	71 60	27.0 26.6		7.8 7.9		20.7		76.1 72.8	72.8	5.4 5.1	5.1	5.3 7.7	-	9	Ü	87 90		022000	011101	<0.2		0.9	0.0
					Bottom	6.8 1.0	0.4	62 108	26.6 27.4	26.6	7.9 7.8	7.9	23.9	23.9	72.8 79.4		5.1	5.1	7.7		9		91 79				<0.2		0.8	
					Surface	1.0	0.5	108	27.4	27.4	7.8	7.8	19.1	19.0	79.5	79.5	5.7	5.6	3.7	ŀ	8		83				<0.2		0.8	
IM12	Cloudy	Rough	14:07	7.3	Middle	3.7	0.7	110 118	27.0 27.0	27.0	7.8	7.8	21.0	21.0	76.8 76.8	76.8	5.4	5.0	4.1 4.1	4.5	8 9	9	87 87	86	821479	812028	<0.2	<0.2	1.0	0.9
					Bottom	6.3	0.6	127	26.7	26.7	7.9	7.9	22.7	22.7	74.8 74.8	74.8	5.3	5.3	5.5	ļ	9		90	1			<0.2	. [	0.9	
					Surface	1.0	0.6	127	26.7	27.1	7.9	7.9	20.3	20.3	77.2	77.3	5.5		4.4		7		- 91				- <0.2		-	-
						1.0 2.0	-	-	27.1	27.1	7.9	7.5	20.3	20.3	77.3	11.3	5.5	5.5	4.5	-	8		-	-			-		-	
SR1A	Cloudy	Rough	14:32	3.9	Middle	2.0	-	-	-	-	-	-				-	-		-	5.2	-	7	-	-	819972	812662	-		-	-
					Bottom	2.9 2.9	-	-	26.9 26.9	26.9	7.9 7.9	7.9	22.1	22.1	77.3 77.2	77.3	5.5 5.5	5.5	5.9 5.9	ŀ	6 7		-	1			-		-	
					Surface	1.0 1.0	0.6	95 101	27.2 27.2	27.2	7.8 7.8	7.8	20.1	20.1	79.9 79.8	79.9	5.7 5.7		3.5 3.6		7		79 83				<0.2	F	0.9	
SR2	Cloudy	Rough	14:48	4.7	Middle	-	-	-	-	-	-		-		-	-	-	5.7	-	5.9	-	8		84	821481	814158	-	<0.2	-	0.9
					Bottom	3.7	0.2	146	26.9	26.9	7.9	7.9	22.0	22.0	76.5	76.5	5.4		8.2		7		- 86				<0.2		0.9	
						3.7 1.0	0.2	159 270	26.9 27.4		7.9 7.6		22.0 17.4		76.4 78.7		5.4 5.7	5.4	8.3 3.0		8 11		87				<0.2	<u> </u>	0.9	_
					Surface	1.0	0.1	295	27.4	27.4	7.6	7.6	17.4	17.4	78.8	78.8	5.7	5.7	3.1		12		-				-	. [	-	
SR3	Cloudy	Rough	13:33	7.9	Middle	4.0 4.0	0.2	43 43	27.2 27.2	27.2	7.7	7.7	19.0 19.0	19.0	78.6 78.4	78.5	5.6 5.6		8.0	6.8	12 11	12	-	-	822140	807592	-		-	-
					Bottom	6.9	0.5	52 52	27.1	27.1	7.9	7.9	19.4 19.4	19.4	84.2 84.5	84.4	6.0	6.0	9.4 9.4		12 12		-				-	. F	-	
					Surface	1.0	0.2	242	26.7	26.7	7.9	7.9	24.5	24.5	74.6	74.6	5.2		3.3		9		-							
SR4A	Deieu	Calm	14:08	9.9	Middle	1.0 5.0	0.2	262 79	26.7 26.5		7.9 7.9		24.5 25.5	25.5	74.5 69.3	69.4	5.2 4.8	5.0	3.3 8.3	5.2	8	0	-	1	817176	807787	-	.	-	
SR4A	Rainy	Caim	14:06	9.9		5.0 8.9	0.1	83 84	26.5 26.5	26.5	7.9 7.9	7.9	25.5 26.0		69.4 68.4		4.8 4.8		7.8 4.0	5.2	9 10	9	-		817176	00//0/	-		-	-
					Bottom	8.9	0.0	85	26.5	26.5	7.9	7.9	26.0	26.0	68.4	68.4	4.8	4.8	4.4		8									
					Surface	1.0	0.1 0.1	270 291	26.5 26.5	26.5	7.9 7.9	7.9	26.1 26.1	26.1	77.8 77.6	77.7	5.4 5.4	5.4	2.6	ŀ	9		-				-	.	-	
SR5A	Rainy	Calm	14:22	3.7	Middle	-	-	-	-	-	-	-	-		-	-	-	3.4	-	5.1	-	8	-	-	816614	810682	-		-	-
					Bottom	2.7	0.2	52	26.6	26.6	7.9	7.9	27.4	27.4	74.6	74.6	5.1	5.1	7.7	ļ	7		-				-	.	-	
					Surface	2.7 1.0	0.2	56 122	26.6 26.6	26.6	7.9 7.9	7.9	27.4 26.0	26.0	74.6 80.0	80.0	5.1 5.6		7.6 3.2		8 12		-				-		-	_
						1.0	0.2	128	26.6	20.0	7.9	7.5	26.0	20.0	80.0	80.0	5.6	5.6	3.2		12		-				-	. [	-	
SR6	Rainy	Calm	14:53	4.0	Middle	-	-	-		-		-	-	-		-	-		-	4.4	-	11	-	-	817912	814659	-		-	-
					Bottom	3.0	0.1	165 174	26.5 26.5	26.5	7.9 7.9	7.9	26.1 26.1	26.1	77.8 77.6	77.7	5.4 5.4	5.4	5.6 5.6	ŀ	10 11		-	1			-	<u> </u>	-	
					Surface	1.0	0.5	113 116	26.7 26.7	26.7	7.9 7.9	7.9	24.7	24.7	72.8 72.9	72.9	5.1 5.1		1.7	-	9						-	ī	-	
SR7	Cloudy	Rough	15:30	15.8	Middle	7.9	0.3	97	26.5	26.5	7.9	7.9	25.1	25.1	71.6	71.7	5.0	5.1	2.4	2.3	6	7	÷		823649	823742			-	_
	,					7.9 14.8	0.3	100 135	26.5 26.5		7.9 7.9		25.2 25.2		71.7 72.5		5.0 5.1	-	2.5		7	•	-				-	. }	-	
					Bottom	14.8	0.3	143	26.5	26.5	7.9	7.9	25.2	25.2	72.5	72.5	5.1	5.1	2.6		6		-					‡	-	
					Surface	1.0		-	27.5 27.4	27.4	7.8	7.8	18.8 18.8	18.8	80.5 80.5	80.5	5.7	5.7	3.9 3.8	ŀ	11 10								-	
SR8	Cloudy	Rough	14:20	3.8	Middle	-	-	-	-	-	-	-	-	-	-	-	-		-	3.7	-	10	-	-	820367	811619	-		-	-
					Bottom	2.8	-	-	27.1	27.1	7.8	7.8	19.8	19.8	79.4	79.4	5.7	5.7	3.6	ļ	10		-	1			-	,	-	
L	l l		1 1			2.8	-	-	27.1		7.8		19.8		79.3		5.6		3.6		9		-		l		ㅗㅗㅗ			

DA: Depth-Averaged
Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher
Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher
Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined
Note: The monitoring session on 1 August 2019 was cancelled due to Strong Wind Signal No. 3 and thunderstorm warning.

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 03 August 19 during N

03 August 19 during Mid-Flood Tide

Water Qua	lity Monit	oring Res	ults on		03 August 19	during Mid-	-Flood T	ide																					
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	oth (m)	Current Speed	Current	Water Te	emperature (°C)		pН	Salin	ity (ppt)	DO S	aturation (%)	Dissolve Oxyge		Turbidity(f	NTU)	uspende (mg	d Solids /L)	Total Alk (ppn		Coordinate HK Grid	Coordinate HK Grid	Chromiur (µg/L)		μg/L)
Station	Condition	Condition	Time	Depth (m)	Jan., p 9 2 3 p		(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average		DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)			DA
					Surface	1.0	0.2	50 55	26.6 26.6	26.6	7.9	7.9	25.3 25.3	25.3	79.8 79.8	79.8	5.6 5.6		3.4	-	9		86 85				<0.2	0.9	
C1	Rainy	Moderate	08:03	8.1	Middle	4.1	0.2	29	26.6	26.6	8.0	8.0	28.5	28.5	74.8	74.8	5.1	5.4	4.7	4.5	10	9	88	88	815625	804250	<0.2	1.0	0.9
	,				Bottom	7.1	0.2	32 21	26.6 26.6		8.0		28.5 28.9		74.8 74.0	74.0	5.1 5.1	5.1	4.7 5.3	H	11	ŀ	87 91				<0.2	0.8	
					Bottom	7.1	0.4	23 64	26.6 27.2	26.6	8.0 7.7	8.0	28.9 18.9	28.9	74.0 79.5		5.1 S	5.1	5.3 6.2		8 12		91 79				<0.2	1.0 0.9	
					Surface	1.0	0.4	65	27.2	27.2	7.7	7.7	18.9	18.9	79.7	79.6	5.7	5.8	6.3		11		83				<0.2	0.9	
C2	Rainy	Rough	09:07	7.8	Middle	3.9	0.5	64 68	27.2 27.2	27.2	7.7	7.7	19.3	19.3	81.0 81.2	81.1	5.8	-	8.2 8.3	7.8	10	11	87 87	86	825680	806928	<0.2	0.2 1.6	1.4
					Bottom	6.8	0.4	90 94	27.1 27.1	27.1	7.8 7.8	7.8	19.7 19.7	19.7	82.5 82.6	82.6	5.9 5.9	5.9	9.0 9.0	-	12 11		90 91				<0.2	1.6	
					Surface	1.0	0.1	233	26.5	26.5	7.7	7.7	24.9	24.9	71.5	71.5	5.0	Ī	7.3		7		82				<0.2	1.7	
C3	Rainv	Rough	07:10	12.4	Middle	1.0 6.2	0.1	244 217	26.5 26.4	26.4	7.7 7.7	7.7	24.9 25.2	25.2	71.5 71.6	71.6	5.0	5.0	7.2 9.3	8.9	7	q	82 87	87	822087	817814	<0.2	0.2	1.6
03	reality	rtougii	07.10	12.4		6.2 11.4	0.4	221 255	26.4 26.4		7.7		25.2 25.3		71.6 76.1		5.0	_	9.3	0.5	12		88 90	01	022007	017014	<0.2	1.6	1.0
					Bottom	11.4	0.3	258 22	26.4	26.4	7.7	7.7	25.2 14.6	25.3	79.0	77.6	5.5	5.4	10.2		12		90				<0.2	1.6	
					Surface	1.0	0.1	23	28.6	28.6	8.0	8.0	14.6	14.6	96.0	96.0	6.0	6.9	3.6		7		83				<0.2	1.8	
IM1	Rainy	Moderate	08:13	5.1	Middle	-	-	-	-	-	-	-	-	-	-		- `	-	-	4.0	-	6	-	85	817965	807108	- <0	0.2	1.8
					Bottom	4.1 4.1	0.2	20 20	28.4 28.5	28.5	8.0	8.0	16.3 16.3	16.3	94.9 95.3	95.1	6.7	6.8	4.6 4.4		6	İ	87 86				<0.2	1.7	
					Surface	1.0	0.3	22	27.4	27.4	7.9	7.9	16.3	16.3	92.1	92.1	6.7		3.0		6		83				<0.2	1.8	_
IM2	Rainy	Moderate	08:19	8.6	Middle	1.0 4.3	0.3	23 19	27.4 27.5	27.5	7.9 8.0	8.0	16.3 17.5	17.5	92.0 92.0	92.0	6.6	6.6	3.1 4.7	4.7	5 4	6	83 86	86	818174	806163	<0.2	1.8 1.8	1.8
IIVIZ	reality	Woderate	00.13	0.0		4.3 7.6	0.3	19 17	27.5 27.5		8.0		17.5 19.3		92.0 92.2		6.6		4.7 6.4	~  -	6	Ů	86 88	00	010174	000103	<0.2	1.7	1.0
					Bottom	7.6 1.0	0.1	19 14	27.5 27.6	27.5	8.0 7.9	8.0	19.3 15.7	19.3	92.3	92.3	6.6	6.6	6.4 4.0		7		88 83				<0.2	1.7	
					Surface	1.0	0.2	15	27.6	27.6	7.9	7.9	15.7	15.7	93.5 93.4	93.5	6.8	6.8	4.0		6		82				<0.2	1.6	
IM3	Rainy	Moderate	08:24	8.8	Middle	4.4	0.2	45 44	27.6 27.6	27.6	7.9 7.9	7.9	16.4 16.4	16.4	93.1 92.9	93.0	6.7	-	4.1 4.4	4.8	5 6	6	84 84	85	818801	805584	<0.2	0.2 1.6	1.6
					Bottom	7.8 7.8	0.2	48 47	27.5 27.5	27.5	7.9	7.9	18.2	18.2	92.3	92.3	6.6	6.6	6.1	-	7		87 87				<0.2	1.5	
					Surface	1.0	0.6	16 17	28.0	28.0	7.9	7.9	14.8	14.8	94.9	94.9	6.8		3.2		6		82 82				<0.2	1.5	
IM4	Rainy	Moderate	08:31	9.1	Middle	4.6	0.6	46	27.8	27.8	7.9	7.9	15.3	15.4	93.6	93.4	6.8	6.8	3.7	4.1	5	6	84	84	819743	804613	<0.2	1.6	1.6
					Bottom	4.6 8.1	0.6	47 46	27.7 27.5	27.6	7.9 7.9		15.4 18.5	18.5	93.2 92.1	92.1	6.6	6.6	3.9 5.3	···	7	-	84 87	•			<0.2	1.5	
						8.1 1.0	0.4	46 29	27.7		7.9 7.9	7.9	18.4 15.7		92.1 91.7		6.5	0.0	5.0 4.0		6 5		87 86				<0.2	1.7	
					Surface	1.0	0.5	26	27.8	27.8	7.9	7.9	15.7	15.7	91.8	91.8	6.6	6.6	3.9		5	•	86				<0.2	1.5	
IM5	Rainy	Moderate	08:38	8.7	Middle	4.4 4.4	0.5 0.5	49 50	27.8 27.7	27.8	8.0	8.0	15.5 15.5	15.5	91.8 91.5	91.7	6.6	-	4.3 4.7	4.7	5 6	6	83 82	85	820751	804858	<0.2	1.4	1.5
					Bottom	7.7	0.4	52 54	27.4 27.4	27.4	8.0	8.0	19.5 19.5	19.5	91.4 91.6	91.5	6.5	6.5	6.0 5.5	-	7		87 87				<0.2	1.5	
					Surface	1.0	0.3	19 19	27.9 27.9	27.9	7.9 7.9	7.9	15.6 15.6	15.6	90.2	90.3	6.5 6.5		4.0 4.1		7		82 82				<0.2	1.5	
IM6	Rainy	Moderate	08:43	8.4	Middle	4.2	0.3	20	27.9	27.9	7.9	7.9	15.8	15.8	90.4	90.4	6.5	6.5	4.2	4.8	6	6	84	84	821083	805831	<0.2	1.7	1.6
					Bottom	4.2 7.4	0.3	21 20	27.9 27.6	27.6	7.9 8.0	8.0	15.8 19.1	19.1	90.4 91.3	91.4	6.5	6.5	4.2 6.4		6		84 86				<0.2	1.7	
						7.4	0.2	21 18	27.6 27.6		8.0 7.9		19.1 16.4		91.5 88.7		6.5	0.5	6.1 4.4		7		87 82				<0.2	1.6	_
					Surface	1.0	0.3	20	27.7	27.7	7.9	7.9	16.3	16.3	88.9	88.8	6.4	6.4	4.2	F	6		82				<0.2	1.5	
IM7	Rainy	Moderate	08:48	8.9	Middle	4.5 4.5	0.3	22 24	27.8 27.8	27.8	7.9	7.9	16.2 16.2	16.2	89.7 89.7	89.7	6.4		5.1 5.2	5.0	5	5	82 83	84	821367	806827	<0.2	1.7	1.5
					Bottom	7.9 7.9	0.1	18 19	27.6 27.6	27.6	7.9	7.9	17.5 17.5	17.5	90.4	90.6	6.5	6.5	5.7 5.6	-	5		86 86				<0.2	1.5	
					Surface	1.0	0.3	347 336	27.4 27.4	27.4	7.6	7.6	17.3	17.3	78.1 78.2	78.2	5.6	F	6.3	ļ	8		83 83				<0.2	1.5	
IM8	Rainy	Rough	08:26	7.6	Middle	3.8	0.4	340	27.2	27.2	7.7	7.7	18.5	18.5	82.8	82.9	5.9	5.8	5.9	6.6	6	7	87	87	821821	808118	<0.2	1.6	1.6
		9				3.8 6.6	0.4	313 316	27.2 27.1		7.7		18.5 21.3		82.9 89.0		5.9 6.3	-	6.0 7.4	-	7	•	87 90				<0.2	1.7	
					Bottom	6.6	0.4	335	27.1	27.1	7.7	7.7	21.3	21.3	89.2	89.1	6.3	6.3	7.3		6	İ	91				<0.2	1.6	

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher

Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

Note: The monitoring session on 1 August 2019 was cancelled due to Strong Wind Signal No. 3 and thunderstorm warning.

Water Quality Monitoring
Water Quality Monitoring Re 03 August 19 during Mid-Flood Tide

Water Qua	lity Monit	toring Res	ults on		03 August 19	during Mid-l		ide																					
Monitoring	Weather	Sea	Sampling	Water	Camalian Da	-4h ()	Current Speed	Current	Water Te	emperature (°C)	р	Н	Salin	ity (ppt)		aturation (%)	Disso	olved gen	Turbidity(	NTU)	Suspende (mg/		Total A		Coordinate	Coordinate	Chrom (µg/		kel (µg/L)
Station	Condition	Condition	Time	Depth (m)	Sampling De	pth (m)	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	HK Grid (Northing)	HK Grid (Easting)	Value	DA Valu	ue DA
					Surface	1.0	0.4	281	27.3	27.3	7.7	7.7	18.0	18.0	78.5	78.6	5.6		3.4		7		82				<0.2	1.7	
11.40	D.:	D I	00.04	~.		1.0 3.7	0.5	289 276	27.3 27.1		7.7		18.0 19.1		78.7 80.2		5.7 5.7	5.7	3.3 5.6		8 10	40	83 86		000007	000004	<0.2	1.5	2
IM9	Rainy	Rough	08:21	7.4	Middle	3.7 6.4	0.4 0.3	300 289	27.1 27.1	27.1	7.7 7.7	7.7	19.1	19.1	80.2	80.2	5.7 5.7		5.6 8.4	5.8	11 12	10	87 90	87	822087	808801	<0.2 <0.2	<0.2 1.8 1.6	3 1.6
					Bottom	6.4	0.3	289	27.1	27.1	7.7	7.7	21.1	21.1	80.2	80.3	5.7	5.7	8.4		11		91				<0.2	1.6	3
					Surface	1.0	0.4	306 332	27.2 27.2	27.2	7.7	7.7	18.5 18.5	18.5	80.0 79.8	79.9	5.7		5.7 5.7		7 8		79 82				<0.2	1.7	
IM10	Rainy	Rough	08:14	7.5	Middle	3.8	0.3	291	27.1	27.1	7.7	7.7	19.3	19.3	80.0	80.1	5.7	5.7	7.1	9.3	7	7	86	86	822381	809803	<0.2	1.6	1 7
						3.8 6.5	0.4	301 263	27.1 27.1		7.7	7.7	19.3 20.0	20.0	80.2 79.8		5.7 5.7		7.2 14.9		8		86 90	1			<0.2	1.6	
					Bottom	6.5 1.0	0.4	287 300	27.1 27.0	27.1	7.7 7.6		20.0		79.6 79.4	79.7	5.7 5.6	5.7	14.9 5.1		7 10		91 83				<0.2	1.7	
					Surface	1.0	0.7	310	27.0	27.0	7.6	7.6	20.6	20.6	79.4	79.4	5.6	5.7	5.1	ŀ	11		83	i			<0.2	1.7	7
IM11	Rainy	Rough	08:04	7.2	Middle	3.6	0.4	317 326	27.0 27.0	27.0	7.7	7.7	20.7	20.7	80.3 80.4	80.4	5.7	J.,	7.1 7.1	6.1	12 11	11	87 87	87	822078	811481	<0.2	<0.2	
					Bottom	6.2	0.1	309	27.0	27.0	7.7	7.7	20.9	20.9	81.5	81.7	5.8	5.8	6.2		11		90				<0.2	1.6	6
-						6.2 1.0	0.1	318 305	27.0 27.0		7.7		20.9		81.9 78.3		5.8 5.6		6.2 7.4		12 12		90 83				<0.2	1.4	
					Surface	1.0	0.1	309	27.0	27.0	7.7	7.7	21.2	21.2	78.3	78.3	5.5	5.6	7.3		13		83	1			<0.2	1.7	7
IM12	Rainy	Rough	07:59	6.8	Middle	3.4 3.4	0.2	349 321	26.9 26.9	26.9	7.7	7.7	21.4	21.4	79.6 79.5	79.6	5.6 5.6		9.5 9.5	9.1	12 14	14	86 86	87	821438	812054	<0.2	<0.2	
					Bottom	5.8 5.8	0.2	345 317	26.9 26.9	26.9	7.8 7.8	7.8	21.8 21.9	21.9	81.8 82.6	82.2	5.8 5.8	5.8	10.4 10.4		15 16		90 91				<0.2	1.6	
					Surface	1.0	-	-	27.0	27.0	7.7	7.7	19.7	19.7	81.6	81.7	5.8		3.6		7		-				-	-	$\pm$
						1.0 2.3	-	-	27.0	27.0	7.7		19.7	10.7	81.7	01	5.8	5.8	3.6		7		-	ł			-	-	-
SR1A	Rainy	Rough	07:42	4.6	Middle	2.3	-	-	-	-	-	-	-	•	-	-	-			4.6	-	7	-		819979	812655	-	· 🖃	<b>∃</b> '
					Bottom	3.6 3.6	-		26.9 26.9	26.9	7.7	7.7	20.5	20.5	83.2 83.2	83.2	5.9 5.9	5.9	5.5 5.6		7 8		-				-	-	_
					Surface	1.0	0.5 0.5	274 290	27.0 27.0	27.0	7.7	7.7	20.4	20.4	79.7 79.8	79.8	5.7 5.7		9.0 8.9		8		82 82				<0.2	1.6 1.6	H
SR2	Rainy	Rough	07:30	5.2	Middle	-	-	-	-		-	-	-		-		-	5.7	-	8.8	-	7	-	84	821474	814146	-	<0.2	1.6
	,					4.2	0.5	256	27.0		7.7		20.4		79.9		5.7		8.5		- 6	-	- 86				<0.2	1.6	;- · · · I
					Bottom	4.2	0.5	268	27.0	27.0	7.7	7.7	20.4	20.4	79.9	79.9	5.7	5.7	8.6		7		87				<0.2	1.6	
					Surface	1.0	0.2	176 188	27.3 27.3	27.3	7.7	7.7	17.7 17.6	17.6	80.4	80.4	5.8	5.8	4.7 4.7	ŀ	9		-				-		_
SR3	Rainy	Rough	08:31	8.1	Middle	4.1	0.1	49 52	27.2 27.2	27.2	7.7	7.7	19.1 19.1	19.1	81.2 81.3	81.3	5.8 5.8	3.6	6.3 6.3	7.2	6 7	7	-	-	822163	807561	-		7 - 1
					Bottom	7.1	0.2	41	27.1	27.1	7.8	7.8	20.2	20.2	84.6	84.6	6.0	6.0	10.6		6		-				-	_	<b>=</b>
						7.1 1.0	0.2	41 290	27.1		7.8 7.9		20.2		84.6 84.4		6.0 5.9		10.7 3.7		7		-				-	-	
					Surface	1.0 4.7	0.4	296	26.8	26.9	7.9	7.9	24.8	24.8	84.4	84.4	5.9	5.7	3.8		7		-	1			-	_	<b>I</b> I
SR4A	Rainy	Calm	07:48	9.3	Middle	4.7	0.2	283 290	26.4 26.4	26.4	7.9	7.9	25.9 26.0	26.0	77.3 77.2	77.3	5.4 5.4		5.4 5.5	5.7	5 6	6	-	-	817170	807803	-	- 🗀	
					Bottom	8.3 8.3	0.2	247 250	26.4 26.4	26.4	7.9	7.9	27.0 27.0	27.0	75.8 75.7	75.8	5.2	5.2	7.8 7.8		7 6		-				-	-	
					Surface	1.0	0.0	136	26.8	26.8	7.9	7.9	25.0	25.0	84.6	84.6	5.9		4.0		7		-				-		_
						1.0	0.0	142	26.8		7.9		25.0		84.6		5.9	5.9	4.0		7	_	-	1			-	-	-
SR5A	Rainy	Calm	07:34	3.9	Middle	-	-	-	-	-	-	-	-	-	-	-	-			5.4	-	8	-	-	816587	810686	-	· 🖃	<b>∃</b> '
					Bottom	2.9	0.0	333 333	26.4 26.4	26.4	7.9 7.9	7.9	26.7	26.7	77.0 77.1	77.1	5.3	5.3	6.9 6.9		10 9		-				-	-	-
					Surface	1.0	0.1 0.1	205 220	26.7 26.7	26.7	7.9 7.9	7.9	25.1 25.1	25.1	82.0 82.0	82.0	5.7 5.7		3.6 3.6		8 7		-				-	T	T
SR6	Rainy	Calm	07:09	4.2	Middle	-	-	-	-		-		-	_	-	-	-	5.7	-	4.7	-	7	-		817897	814654	-	. 🗀	∄ . ∣
	,					3.2	0.1	154	26.4		7.9		26.3		75.8		5.3		5.8		- 6	-	-	1			-	<u> </u>	-
					Bottom	3.2	0.1	159	26.4	26.4	7.9	7.9	26.3	26.3	75.7	75.8	5.3	5.3	5.8		7		-				-	-	1
					Surface	1.0	0.1	44 47	26.6 26.6	26.6	7.5	7.5	24.0	24.0	82.0 82.1	82.1	5.9	5.4	3.8 3.9	}	5 5		-	1			-	-	_
SR7	Rainy	Rough	06:45	16.4	Middle	8.2 8.2	0.1 0.1	268 272	26.5 26.5	26.5	7.5 7.5	7.5	25.0 25.0	25.0	69.7 69.7	69.7	4.9 4.9	5.4	6.2 6.2	6.4	6 7	9	-	-	823618	823738	-		4 - 1
					Bottom	15.4	0.1	277	26.4	26.4	7.5	7.5	25.4	25.3	72.5	72.5	5.1	5.1	9.2		14		-	1			-		<b>1</b>
			+ +			15.4 1.0	0.1	281	26.4		7.6 7.6		25.3 18.5		72.5 71.3		5.1		9.2 4.5		14 8		-				-	-	+
					Surface	1.0	-	-	27.2	27.2	7.6	7.6	18.5	18.5	71.2	71.3	5.0	5.0	4.5		6		-	1			-	_	<b>4</b>
SR8	Rainy	Rough	07:50	4.2	Middle	-	-	-	-		-	-	-	-	=	-	-	╚	-	5.3	-	6	-	-	820385	811634	-		_ ⊢
					Bottom	3.2 3.2	-	-	27.0 27.0	27.0	7.7	7.7	21.0	21.0	83.3	83.3	5.9 5.9	5.9	6.1 6.2		6 5		-	-			-	-	7
DA: Depth-Aver	hane				1	J.2	,		21.0	<u> </u>	1 1.1		21.0		100.0		, J.J		V.Z		J		,		I		<u>, '  </u>		

DA: Depth-Averaged
Calm: Small or no wave: Moderate: Between calm and rough; Rough; White capped or rougher
Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined
Note: The monitoring session on 1 August 2019 was cancelled due to Strong Wind Signal No. 3 and thunderstorm warning.

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 06 August 19 during

06 August 19 during Mid-Ebb Tide

Water Qual	ity Monito	oring Resu	lts on		06 August 19	during Mid-	Ebb Tide	)																			
Monitoring Station	Weather	Sea	Sampling	Water	Sampling [	Depth (m)	Current Speed	Current Direction	Water Te	mperature (°C)		pН	Salin	ity (ppt)	DO Satur (%)	ration	Dissolved Oxygen	Turbidity(	NTU)	Suspended (mg/L)		tal Alkalinity (ppm)	Coordinate HK Grid	HK Grid	Chromium (µg/L)	Nickel	l (µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)		Value	Average	Value	Average	Value	Average \	'alue Av	erage	Value DA	Value	DA	Value		lue DA	(Northing)	(Easting)	Value DA		DA
					Surface	1.0	0.1	213 211	28.5 28.5	28.5	7.7	7.7	16.7 16.7		30.4 30.3		5.7	3.6	ŀ	5		34			<0.2	1.7	ł
C1	Cloudy	Moderate	16:36	8.2	Middle	4.1 4.1	0.3	164 164	27.8 27.8	27.8	7.6 7.6	7.6	23.1	23.1	70 1		5.4 5.4	5.3 5.2	6.5	4 5	5 8	88	815610	804259	<0.2 <0.2	1.6	
					Bottom	7.2	0.3	160	27.5	27.5	7.5	7.5	27.3	27.3	79.8	79.9	5.4	10.7		6	9	1			<0.2	1.6	İ
						7.2 1.0	0.3	155 143	27.5 28.0		7.5 7.7		27.3 17.3		79.9		5.4 S.4 4.7	10.6 5.3		6		16			<0.2	1.7 2.1	-
					Surface	1.0 6.2	0.4	143 116	28.0 27.9	28.0	7.7 7.8	7.7	17.3 20.1	17.3	65.8	05.0	4.7 4.8	5.3 11.7	I	6	8	37			<0.2	2.1	į
C2	Cloudy	Moderate	15:22	12.3	Middle	6.2	0.3	115	27.9	27.9	7.8	7.8	20.1	20.1	68.1	08.1	4.8	11.8	10.4	6	5 8	88	825680	806921	<0.2	2.2	
					Bottom	11.3 11.3	0.4	125 149	27.6 27.7	27.7	7.7	7.7	22.9 22.9		66.7 66.9		4.6 4.6	14.2 13.9		3 4		90			<0.2	2.1	
					Surface	1.0	0.3	30 40	27.5 27.5	27.5	7.9 7.9	7.9	25.6 25.6		72.9 72.9		5.0	3.2		7	8	16 16			<0.2	2.4	
СЗ	Cloudy	Moderate	17:21	11.8	Middle	5.9	0.3	44	27.3	27.3	7.9	7.9	27.0	27.0	69.0	60.1	4.7	5.2	4.6	7	8 8	88 88	822112	817810	<0.2	2.4	
					Bottom	5.9 10.8	0.3	42 61	27.3 27.3	27.3	7.9 7.9	7.9	27.0 27.1	27.1	70.8	71.0	4.7 4.8 4.9	5.1 5.5	Ŀ	8	8	19			<0.2	2.3	İ
					1	10.8	0.0	64 219	27.3 28.5		7.9 7.6		27.1 16.8		71.1		4.9 6.0	5.4 3.7		5		34 34			<0.2	2.6 1.9	<u> </u>
					Surface	1.0	0.2	230	28.5	28.5	7.6	7.6	16.8	16.8	34.3		6.0	3.6	ļ	4	8	34			<0.2	1.9	‡
IM1	Cloudy	Moderate	16:07	5.3	Middle	-	-		-	-	Ė	-		-	-	-	-	-	4.5	-	4	- 88	817936	807111	- <0.2	-	1.9
					Bottom	4.3	0.0	226 234	28.2 28.2	28.2	7.5 7.5	7.5	19.9 19.9		91.7	91.9	6.4 6.4	5.4 5.4		3		12			<0.2	1.8	ł
					Surface	1.0	0.3	212 200	28.3 28.4	28.3	7.6 7.6	7.6	18.2 17.0		79.0 79.3		5.6	4.3 4.3		4		18			<0.2	1.8	-
IM2	Cloudy	Moderate	16:01	7.5	Middle	3.8	0.3	225	28.1	28.1	7.6	7.6	20.5	20.5	79.1		5.5	6.1	7.5	3	, 8	9 89	818140	806185	<0.2	, 1.7	
					Bottom	3.8 6.5	0.3	218 222	28.1 27.8	27.8	7.6 7.5	7.5	20.6 24.1	2/1	79.2 '	86.4	5.5 5.9 6.0	6.1 12.1		4	9	11			<0.2 <0.2	1.7	1
						6.5 1.0	0.3	224 218	27.8 28.3		7.5 7.6		24.1 16.7	- 1	36.6	-	5.6	12.0 4.9		5 4		33			<0.2	1.7	├─
					Surface	1.0	0.4	229 244	28.3 27.8	28.3	7.6 7.6	7.6	16.7 23.4	16.7	79.3	19.3	5.6 5.3	4.9 7.0	ļ	3	8	13			<0.2	1.7	-
IM3	Cloudy	Moderate	15:55	7.7	Middle	3.9	0.4	257	27.8	27.8	7.6	7.6	23.3	23.3	77.5	//.5	5.3	7.1	7.0	4	4 8	88	818767	805585	<0.2	1.7	1.7
					Bottom	6.7	0.3	237 210	27.7 27.7	27.7	7.5 7.5	7.5	24.4		78.7 78.8	78.8	5.4 5.4	8.9 8.9		4		91			<0.2	1.6	<u> </u>
					Surface	1.0	0.7	234 236	28.3 28.3	28.3	7.6 7.6	7.6	16.2 16.2		79.9 79.9		5.7	3.7		4	8	34 34			<0.2	1.6	
IM4	Cloudy	Moderate	15:47	8.1	Middle	4.1	0.6	225 211	28.0	28.0	7.6	7.6	21.6	21.6	70.4		5.5 5.5	4.3	4.7	6	5 8	88 88	819718	804604	<0.2 <0.2	17	
					Bottom	7.1	0.5	200	27.7	27.7	7.6	7.6	24.5	24.5	32.6	82.7	5.7	6.3		6	9	91			<0.2	1.8	1
						7.1	0.5 1.0	201 222	27.7 28.3	28.3	7.6 7.6		24.5 19.8		32.8		5.7	6.2 6.8		5		13	1		<0.2	1.9	<del> </del>
					Surface	1.0 4.0	1.0	223 217	28.3 27.8		7.6 7.6	7.6	19.8 23.8	19.0	31.2	51.5	5.7 5.3	6.9 8.1	I	5 6	8	13			<0.2	1.9	ĺ
IM5	Cloudy	Moderate	15:36	7.9	Middle	4.0	1.0	216	27.8	27.8	7.6	7.6	23.8	23.8	77.2	//.2	5.3	8.0	8.4	7	8	88	820753	804865	<0.2	1.9	
					Bottom	6.9	0.7	198 204	27.7 27.7	27.7	7.6 7.6	7.6	24.2		79.1 79.2	79.2	5.4 5.4	10.2 10.3		7	9	91			<0.2 <0.2	1.8	<u> </u>
					Surface	1.0	0.1	198 182	28.1 28.1	28.1	7.6 7.6	7.6	21.6 21.6		78.2 78.2		5.4	8.3 8.6		13 12		34 34			<0.2	1.6	-
IM6	Cloudy	Moderate	15:30	7.8	Middle	3.9	0.1	208	28.0	28.0	7.6	7.6	21.8	21.8	70.6		5.4 5.5 5.5	10.2	10.5	9	10 8	88 88	821083	805844	<0.2 <0.2	10	
					Bottom	6.8	0.1 0.1	224 184	28.0	27.9	7.6	7.6	22.3	22.3	30.5	80.6	5.6	10.2 12.9		7	9	91			<0.2	1.9	İ
						6.8 1.0	0.1	187 183	27.9 28.4		7.6 7.5		22.3 16.8		30.6	-	5.6	12.9 5.2		5		13			<0.2	2.0 1.6	-
					Surface	1.0 4.1	0.2	185 161	28.4 28.2	28.4	7.5 7.6	7.5	16.7 20.1	10.7	76.0	70.0	5.4 5.4	5.2 7.9	I	6	8	34			<0.2	1.7	1
IM7	Cloudy	Moderate	15:23	8.2	Middle	4.1	0.6	162	28.2	28.2	7.6	7.6	20.1	20.1	77.9	77.9	5.4	7.9	7.3	6	8	88	821366	806849	<0.2	1.7	1.7
					Bottom	7.2 7.2	0.4	166 168	28.1 28.1	28.1	7.5 7.5	7.5	22.5 22.5		77.6 77.6	77.6	5.4 5.4	8.7 8.7		5 6		12			<0.2	1.6	<u> </u>
	Ī				Surface	1.0	0.2	178 183	28.3 28.3	28.3	7.8 7.8	7.8	15.9 16.0		72.8 72.8	72.8	5.2	4.0 4.3		5	8	35 35			<0.2 <0.2	2.0	
IM8	Cloudy	Moderate	15:51	8.0	Middle	4.0	0.3	155	28.0	28.0	7.8	7.8	18.7	18.7	74.0	74.1	5.2	8.9	8.8	4	5 8	88 88	821816	808132	<0.2	2.0	2.0
					Bottom	4.0 7.0	0.3	155 152	28.0 27.9	28.0	7.8 7.8	7.8	18.8 21.8	21.8	74.1	7/1 1	5.2 5.1 5.1	9.4 13.1	ŀ	5 5	8	19			<0.2	2.1	1
DA: Depth-Avera	and				BUILUIT	7.0	0.3	154	28.1	20.0	7.8	1.0	21.7	21.0	74.2	71	5.1	13.1	ľ	4	9	00			<0.2	2.0	Щ_

DA: Depth-Averaged
Caim: Small or no wave; Moderate: Between caim and rough; Rough: White capped or rougher
Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring

during Mid-Ebb Tide Water Quality Monitoring Results on 06 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water рΗ Coordinate Sampling Water Temperature (°C) Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Average 0.4 1.0 0.5 161 28.5 7.7 15.6 73.2 5.2 3.3 86 <0.2 2.2 3.9 0.4 140 28.2 7.7 18.2 18.2 71.3 71.2 5.0 5.0 4 5 88 <0.2 2.2 Cloudy IM9 Moderate 15:57 7.8 Middle 7.7 6.6 88 822097 808787 <0.2 7.7 3.9 145 0.4 28.2 6.8 0.2 142 28.5 72.4 72.8 4 89 < 0.2 2.1 7.7 19.5 5.0 11.4 Bottom 28.6 7.7 19.5 72.6 5.1 5.1 7.7 6.8 0.2 151 194 11.5 22 28.7 89 <0.2 0.5 155 28.5 2.2 5.3 4.1 Surface 28.5 7.7 16.4 74.3 7.7 16.4 74.2 5.3 86 2.2 1.0 0.5 150 28.5 4.2 < 0.2 0.3 137 28.2 28.3 5.9 5.9 2.1 72.6 72.6 5.1 88 88 <0.2 4.0 7.8 18.3 IM10 Cloudy Moderate 16:05 7.9 Middle 28.3 7.8 18.3 72.6 88 822366 809782 <0.2 4.0 7.8 18.3 6.9 0.2 138 28.1 7.7 70.3 4.9 6.7 6 90 <0.2 2.3 21.1 7.7 21.1 4.9 Bottom 28.2 70.3 6.9 0.2 129 28.2 7.7 21.1 70.3 4.9 6.4 90 < 0.2 2.4 1.0 0.3 143 4.8 86 2.1 28.0 7.8 72.2 5.0 20.7 8 <0.2 Surface 28.0 7.8 20.7 72.2 1.0 0.3 149 28.0 7.8 20.7 72.1 5.0 4.8 86 <0.2 2.0 5.0 4.3 0.1 138 27.8 7.8 4.9 8.6 88 <0.2 2.0 21.5 69.9 IM11 Cloudy 822076 811439 Moderate 16:15 8.5 Middle 27.8 7.8 21.5 69.8 88 <0.2 4.3 0.1 9.6 89 154 <0.2 7.5 126 7.8 69.2 69.4 4.8 15.8 89 <0.2 2.0 69.3 4.8 Rottom 27.6 7.8 24.0 7.5 0.2 141 27.6 7.8 24.0 15.4 89 128 7.8 72.0 72.0 4.4 86 <0.2 2.0 Surface 28.0 7.8 20.7 72.0 1.0 0.2 126 28.0 7.8 20.7 5.0 4.3 9 86 <0.2 2.2 4.5 0.2 127 27.7 68.8 10.8 9 87 <0.2 2.2 16:23 Middle 68.9 821457 IM12 Cloudy Moderate 7.8 22.7 4.5 0.2 119 27.7 68.9 4.8 10.7 88 2.2 79 0.2 117 27.6 7.8 69.4 4.8 11.6 89 <0.2 2.2 Bottom 27.6 7.8 23.6 69.5 4.8 69.6 7.9 0.2 104 27.6 7.8 23.5 4.8 11.6 8 89 <0.2 2.3 1.0 27.9 7.8 21.1 75.5 5.3 47 Surface 27.9 7.8 21.1 75.7 1.0 27.9 7.8 21.1 75.9 5.3 4.7 8 2.5 Cloudy Calm 16:48 5.0 Middle 819983 812664 2.5 4.0 27.6 68.1 4.7 9.9 6 4.8 Bottom 27.6 7.8 22.7 68.3 4.0 27.6 7.8 22.7 68.4 4.8 9.1 1.0 0.3 34 28.1 7.8 73.9 4.1 85 <0.2 2.3 Surface 28.1 7.8 20.4 73.9 1.0 0.3 33 28.1 7.8 20.4 73.9 5.2 4.1 9 85 <0.2 2.3 5.2 SR2 Cloudy Moderate 17:00 5.4 Middle 821477 814142 <0.2 2.3 4.4 22.7 70.3 70.5 4.9 2.3 Bottom 70.4 4.9 44 0.2 11 27.7 7.8 4.9 9.1 88 <0.2 2.2 1.0 0.1 135 28.3 77 16.7 70.9 5.0 3.5 6 7.7 16.7 70.9 1.0 0.1 143 28.2 77 16.7 70.9 5.0 3.6 5 4.5 0.3 164 28.1 7.8 18.2 71.6 5.1 4.8 5 SR3 Moderate 15:45 9.0 71.8 822158 807564 Cloudy 4.5 0.3 168 28.1 7.8 18.2 71.9 5.1 4.9 5 0.3 27.9 27.9 74.3 74.0 5.2 14.2 8.0 161 163 7.9 4 Bottom 7.9 74.2 5.2 7.9 1.0 0.5 78 28.2 7.6 19.1 77.9 5.5 3.6 Surface 28.2 7.6 19.1 77.9 77.9 3.7 7.2 1.0 0.5 7.6 19.1 5.5 83 28.2 8 -5.1 0.5 5.4 28.0 7.5 20.8 77.3 8 7.5 807797 SR4A Cloudy Moderate 17:04 10.1 Middle 28.0 20.8 77.3 817210 5.1 0.6 87 28.0 7.5 20.8 77.3 5.4 7.3 0.5 28.0 9.1 69 22.1 78.8 5.5 9.4 Rottom 28.0 7.5 22.1 78.9 5.5 9.1 0.5 71 28.0 28.5 7.5 22.1 78.9 5.5 9.4 1.0 0.3 93 7.6 10 7.6 5.6 20.0 81.1 Surface 28.5 7.6 20.0 81.1 1.0 0.3 101 28.5 7.6 20.0 81.1 5.6 7.7 10 SR5A 17:17 Middle 816607 810711 Cloudy Moderate 3.9 2.9 0.4 103 28.5 6.0 7.6 20.1 86.8 8.2 Bottom 28.5 7.6 20.1 87.0 6.1 2.9 0.5 110 28.5 7.5 Surface 28.5 7.5 19.1 81.8 28.5 7.5 4.5 SR6 Moderate 17:45 4.3 Middle 817895 814655 Cloudy 0.1 169 28.1 85.1 5.9 6.0 4 Bottom 7.6 85.3 0.1 181 28.1 1.0 0.2 77 27.5 7.9 23.8 74.6 5.2 2.4 Surface 7.9 1.0 0.3 80 27.5 79 75.7 5.2 2.3 8 1 0.1 49 27.2 7.9 26.6 67.5 47 4.5 7 SR7 Cloudy Moderate 17:52 Middle 26.7 67.6 823623 823742 8.1 0.1 53 27.2 79 26.8 67.6 47 46 8 4.6 15.2 0.2 65 27.2 7.9 68.4 5.1 5 Bottom 7.9 28.2 68.5 15.2 0.2 68 27.2 7.9 68.5 4.9 28.0 28.0 1.0 7.8 20.9 5.0 4.9 72.3 Surface 28.0 7.8 4.9 8 --SR8 Cloudy Calm 16:34 4.8 Middle 6.7 820376 811607 3.8 27.6 7.8 7.8 22.7 68.6 4.8 8.8 8 Bottom 27.7 7.8 22.7 68.8 4.8

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

## Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 06 August 19 during

06 August 19 during Mid-Flood Tide

Water Qua	lity Monite	oring Resu	lts on		06 August 19	during Mid-	Flood Ti	de																			
Monitoring	Weather	Sea	Sampling	Water	Sampling D	enth (m)	Current Speed	Current	Water Te	emperature (°C)		рН	Salir	nity (ppt)		aturation (%)	Disso Oxy		Turbidity(	NTU)	Suspende (mg	ed Solids /L)	Total Alkalinity (ppm)	Coordinate HK Grid	Coordinate HK Grid	Chror (µg.	
Station	Condition	Condition	Time	Depth (m)	Camping E		(m/s)	Direction	Value	Average	Value	Average	Value	Ů		Average	Value	DA	Value	DA	Value	DA	Value DA	(Northing)	(Easting)	Value	DA Value DA
					Surface	1.0	0.4	19 20	28.2 28.2	28.2	7.6	7.6	18.2	18.1	77.6 77.6	77.6	5.5 5.5		3.2		6		83			<0.2	1.8
C1	Rainy	Moderate	10:16	7.1	Middle	3.6	0.3	32	27.6	27.6	7.6	7.6	25.5	25.5	76.7	76.7	5.2	5.4	7.7	6.8	5	6	87 07	815608	804268	<0.2	1.6
	,			***		3.6 6.1	0.3	34 29	27.6 27.6		7.6 7.6		25.5 25.5		76.7 78.3		5.2 5.4		7.7 9.4		5 6		88 91			<0.2	1.7
					Bottom	6.1	0.3	29	27.6	27.6	7.6	7.6	25.5	25.5	78.4	78.4	5.4	5.4	9.4		8		91			<0.2	1.8
					Surface	1.0	0.4	4	28.1 28.1	28.1	7.7	7.7	18.7 18.7	18.7	68.4 68.4	68.4	4.8 4.8	4.0	3.4		5 4		87 88			<0.2	1.9
C2	Cloudy	Moderate	11:36	11.9	Middle	6.0 6.0	0.3	17 18	27.8 27.7	27.8	7.8	7.8	20.1	20.1	67.1 66.5	66.8	4.7	4.8	15.2 15.1	11.9	4 5	5	89 89	825692	806938	<0.2	22
					Bottom	10.9	0.4	323	27.5	27.5	7.8	7.8	22.6	22.6	66.0	66.0	4.6	4.6	17.2		5		90			<0.2	<0.2 2.1 2.1
						10.9	0.4	336 266	27.5 28.1		7.8	1	22.6 19.3		66.0 74.1		4.6 5.2	4.0	17.3 2.8		5		91 86			<0.2	2.1 1.9
					Surface	1.0	0.7	283	28.1	28.1	7.8	7.8	19.3	19.3	74.1	74.1	5.2	5.0	2.7		5		87			<0.2	1.9
СЗ	Cloudy	Moderate	09:43	13.5	Middle	6.8	0.6	254 278	27.5 27.5	27.5	7.8	7.8	23.5	23.5	68.8 68.8	68.8	4.8 4.8		3.2 3.2	4.8	4	4	88 89	822127	817787	<0.2	<0.2 1.9 2.1
					Bottom	12.5	0.4	291	27.4	27.4	7.8	7.8	26.3	26.3	66.1	66.1	4.5	4.5	8.8		4	İ	90			<0.2	2.3
					Surface	12.5 1.0	0.4	301 15	27.4 28.2	28.2	7.8	7.6	26.3 19.8	19.8	66.0 81.7	81.7	4.5 5.7		8.4 3.3		6		90 83			<0.2 <0.2	2.3 1.9
						1.0	0.5	15	28.2		7.6	7.0	19.8	19.0	81.7	01.7	5.7	5.7	3.3		7		84			<0.2	1.9
IM1	Rainy	Moderate	10:45	5.1	Middle	-	-		-	-		-	-	-	-	-	-		-	4.5	-	6	- 88	817957	807139	-	<0.2
					Bottom	4.1	0.4	353 325	28.1 28.1	28.1	7.6	7.6	21.1	21.1	82.7 82.8	82.8	5.7 5.8	5.8	5.7 5.7		5 5		91 92			<0.2	1.9
					Surface	1.0	0.4	35	28.2 28.2	28.2	7.6 7.6	7.6	20.6	20.6	82.2 82.1	82.2	5.7 5.7		3.9		4		83			<0.2	1.5
IM2	Rainy	Moderate	10:50	6.9	Middle	1.0 3.5	0.4	37 18	28.2	28.1	7.6	7.6	20.6 21.6	21.6	82.9	83.0	5.8	5.8	3.9 4.5	4.8	4	4	83 88 87	818142	806152	<0.2	<0.2 1.5
IIVIZ	Railly	Widderate	10.50	0.5		3.5 5.9	0.4	19 356	28.1 28.0		7.6 7.6	-	21.6 22.0		83.1 82.3		5.8 5.7		4.5 5.8	4.0	4	7	91	010142	800132	<0.2	1.4
					Bottom	5.9	0.5	328	28.0	28.0	7.6	7.6	22.1	22.0	82.7	82.5	5.7	5.7	5.9		4		91			<0.2	1.3
					Surface	1.0	0.5	323 349	28.3 28.3	28.3	7.6	7.6	20.5	20.5	83.7 83.5	83.6	5.8 5.8		5.2 5.2		3		83			<0.2	1.3
IM3	Cloudy	Moderate	10:57	7.3	Middle	3.7	0.5	331	27.8	27.8	7.6	7.6	23.4	23.4	77.2	77.2	5.3	5.6	8.2	8.7	5	4	87 07	818794	805591	<0.2	.0.0 1.4 4.4
					Bottom	3.7 6.3	0.5	348 317	27.8 27.7	27.7	7.6 7.6	7.6	23.4 25.1	25.1	77.2 78.1	78.2	5.3 5.4	5.4	8.3 12.6		4 5		88 91			<0.2	1.3
						6.3 1.0	0.4	344 358	27.7		7.6 7.6	1	25.1		78.2 87.8		5.4 6.1	5.4	12.6 6.0		4		92 83			<0.2 <0.2	1.4
					Surface	1.0	0.8	329	28.4	28.4	7.6	7.6	20.0	20.0	87.8	87.8	6.1	6.1	6.1		4		83			<0.2	1.4
IM4	Cloudy	Moderate	11:12	8.0	Middle	4.0	0.7	9	28.3 28.3	28.3	7.6	7.6	20.0	20.0	87.0 86.9	87.0	6.1 6.1		4.9 4.9	5.6	5 4	4	88 88	819736	804628	<0.2	<0.2 1.4 1.5
					Bottom	7.0	0.5	344	28.3	28.3	7.6	7.6	20.1	20.1	86.9 86.9	86.9	6.1	6.1	5.8		4	ļ	91			<0.2 <0.2	1.4
					Surface	7.0 1.0	0.5	359 7	28.3 28.1	28.1	7.6 7.6	7.6	20.1	21.2	78.8	78.8	6.1 5.5		5.8 1.5		5 5		92 83		<u> </u>	<0.2	1.5
						1.0 4.2	0.9 1.0	7 8	28.1 27.8		7.6 7.6	1	21.2		78.8 78.1		5.5 5.4	5.5	1.5 2.9		6 5	Ī	83 88			<0.2	1.5
IM5	Cloudy	Moderate	11:18	8.4	Middle	4.2	1.0	8	27.8	27.8	7.6	7.6	23.6	23.6	78.2	78.2	5.4		2.9	3.5	5	5	88	820745	804844	<0.2	1.4
					Bottom	7.4	0.8	5	27.7 27.7	27.7	7.6	7.6	24.6	24.6	82.1 82.4	82.3	5.6 5.7	5.7	6.4		4		91 91			<0.2	1.4
					Surface	1.0	0.1	85	28.2	28.2	7.6	7.6	21.0	21.0	78.2	78.2	5.4		5.3		3		83			<0.2	1.4
IM6	Cloudy	Moderate	11:25	8.2	Middle	1.0 4.1	0.1	90 54	28.2 28.0	20.0	7.6 7.6	7.6	21.0	22.4	78.2 78.7	78.8	5.4 5.4	5.4	5.2 7.7	7.5	4	4	83 88 87	821071	805808	<0.2	<0.2 1.4
livio	Cloudy	Woderate	11.25	0.2		4.1 7.2	0.2	58 76	28.0 27.8	28.0	7.6 7.6		22.4 24.5		78.8 85.7		5.5 5.9		7.7 9.5	7.5	5 4	-	91	621071	003000	<0.2	1.5
					Bottom	7.2	0.3	79	27.8	27.8	7.6	7.6	24.5	24.5	86.0	85.9	5.9	5.9	9.4		4		91			<0.2	1.4
		<u></u>			Surface	1.0	0.1	24 24	28.5 28.5	28.5	7.5 7.5	7.5	16.4 16.4	16.4	76.5 76.6	76.6	5.4 5.4		4.7		3 4		83			<0.2	1.4
IM7	Cloudy	Moderate	11:31	8.0	Middle	4.0	0.5	63	28.3	28.3	7.5	7.5	19.6	19.6	78.9	79.0	5.5	5.5	6.9	6.4	2	3	87 07	821365	806823	<0.2	-0.2 1.5 1.5
						4.0 7.0	0.6	67 62	28.3 28.2	28.2	7.5 7.5		19.6 20.2		79.0 80.2	80.2	5.5 5.6	5.6	6.9 7.5		3	1	91			<0.2 <0.2	1.4
			1		Bottom	7.0 1.0	0.4	63 50	28.2 28.5		7.5	7.5	20.3	20.2	80.2		5.6	5.6	7.4 3.2		2		92 86	<u> </u>	<u> </u>	<0.2	1.5 1.9
					Surface	1.0	0.2	50	28.5	28.5	7.7	7.7	15.6 15.6	15.6	73.0 73.0	73.0	5.2 5.2	5.2	3.3		4	1	86			<0.2	2.0
IM8	Rainy	Moderate	11:09	8.1	Middle	4.1 4.1	0.1	58 62	28.4 28.4	28.4	7.7	7.7	16.7 16.7	16.7	72.4 72.3	72.4	5.1 5.1	J.2	3.3 3.1	5.0	4	4	89 88	821829	808141	<0.2 <0.2	<0.2 2.0 2.0
					Bottom	7.1	0.1	194	28.2	28.2	7.7	7.7	18.2	18.2	71.5	71.5	5.0	5.0	8.7		4		88			<0.2	2.1
DA: Depth-Ave						7.1	0.1	194	28.2		7.7	1	18.2		71.5		5.0		8.6		3	<u> </u>	89		<u> </u>	<0.2	2.1

during Mid-Flood Tide Water Quality Monitoring Results on 06 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Average 0.3 1.0 0.3 296 28.2 19.2 71.6 5.0 10.3 85 <0.2 2.3 3.8 0.2 284 28.0 7.7 19.9 70.0 70.0 4.9 4.9 11.2 88 <0.2 2.2 IM9 Moderate 11:02 7.6 Middle 7.7 19.9 70.0 88 822078 808807 <0.2 7.7 3.8 0.2 284 11.6 28.0 6.6 0.2 267 28.2 20.0 19.9 71.0 71.2 5.0 5.0 9 89 < 0.2 2.3 7.7 13.2 Bottom 28.3 7.7 19.9 71.1 5.0 7.7 6.6 0.2 267 28.3 13.0 90 22 <0.2 0.9 304 28.2 3.3 5.2 Surface 28.2 7.8 18.7 73.2 7.8 18.6 73.2 5.2 86 1.8 1.0 0.9 323 28.2 3.4 3 < 0.2 0.9 28.1 28.1 6.8 1.8 3.8 300 310 19.6 19.6 71.3 71.4 88 88 <0.2 7.8 5.0 4 IM10 Cloudy Moderate 10:53 7.5 Middle 28 1 7.8 19.6 71.4 88 822362 809786 <0.2 6.5 0.6 304 27.9 7.7 70.2 4.9 11.7 90 <0.2 1.8 21.5 7.7 21.4 70.3 4.9 Bottom 28.0 6.5 0.6 307 28.0 7.7 70.4 4.9 11.7 90 < 0.2 1.8 1.0 0.8 299 74.4 86 2.2 28.2 7.8 5.2 2.9 4 <0.2 19.1 74.4 Surface 28.2 7.8 19.1 1.0 0.9 322 28.2 7.8 74.3 5.2 2.9 87 <0.2 2.0 4.0 0.7 280 27.9 7.8 20.7 70.8 5.0 8.0 88 <0.2 2.0 IM11 Cloudy 822052 811473 Moderate 10:44 8.0 Middle 27.9 7.8 20.7 70.8 88 <0.2 4.0 0.7 8.4 88 <0.2 7.8 69.9 69.9 7.3 89 <0.2 2.3 Rottom 27.8 7.8 21.3 69.9 49 7.0 0.3 298 27.8 7.8 21.3 4.9 7.8 89 2.4 28.1 7.8 20.1 73.8 73.8 5.3 86 <0.2 2.1 Surface 28.1 7.8 20.1 73.8 1.0 0.7 28.1 7.8 20.1 5.2 5.2 6 86 <0.2 1.9 4.3 0.6 280 27.9 8.6 6 88 <0.2 1.9 10:37 Middle 821440 IM12 Cloudy Moderate 27.9 7.8 20.8 70.9 4.3 0.6 27.9 7.8 9.4 89 2.0 7.6 0.5 271 27.9 7.8 20.9 71.1 12.2 4 90 <0.2 2.0 Bottom 28.0 7.8 20.8 71.2 5.0 7.6 0.5 277 28.0 7.8 20.8 71.2 5.0 12.7 90 <0.2 2.2 1.0 28.4 7.7 17.4 76.8 5.4 2.6 Surface 28.4 7.7 17.4 76.7 28.4 7.7 17.4 76.6 5.4 2.6 3 2.3 SR1A Cloudy Calm 10:17 4.6 Middle 819977 812663 2.3 3.6 28.4 28.4 73.5 73.4 7.7 5.2 2.8 Bottom 28.4 7.7 18.6 73.5 5.2 77 18.5 1.0 0.7 305 28.0 7.8 19.8 72.6 5.1 41 85 <0.2 22 Surface 28.0 7.8 19.8 72.6 1.0 0.8 5.1 316 7.8 199 72.5 4.5 6 86 2.3 28.0 < 0.2 -SR2 Cloudy Moderate 10:05 5.5 Middle 87 821479 814148 2.7 4.5 0.5 292 315 28.1 20.3 71.0 70.6 5.0 4.9 9.9 88 <0.2 7.8 Bottom 28.2 20.2 70.8 5.0 4.5 0.5 7.8 28.2 6 88 < 0.2 2.7 1.0 0.1 343 28.6 7.7 15.1 15.3 72.8 5.2 6 Surface 28.6 7.7 15.3 72.9 1.0 0.1 7.7 15.3 5.2 15.1 316 28.6 72.9 4.6 3.3 28.3 17.4 71.1 5.0 SR3 11:15 Middle 7.7 822124 807585 Cloudy Moderate 9.2 28.3 17.4 71.1 4.6 0.1 21 28.3 7.7 17.5 5.0 3.4 4 . 7.7 8.2 0.2 28.0 19.4 70.3 70.6 4.9 5.0 7.3 7.2 4 93 7.7 70.5 Rottom 28 1 19.3 5.0 28.1 7.7 1.0 0.4 254 28.3 7.5 5.4 6.2 20.1 77.2 6 Surface 28.3 7.5 20.1 77.2 1.0 77.2 5.4 6.1 0.4 264 28.3 4.8 0.4 8.6 258 28.2 7.5 20.2 76.9 5.4 SR4A Cloudy Moderate 09:45 9.6 Middle 28.2 7.5 20.2 76.9 817193 807809 4.8 0.4 270 28.2 7.6 8.7 8.6 0.4 269 28.1 21.5 5.4 10.6 Bottom 28.1 7.5 21.5 77.6 5.4 8.6 287 28.1 77.7 1.0 0.2 28.3 8.3 10 7.5 20.1 78.5 5.5 Surface 28.3 7.5 20.1 78.6 1.0 0.2 312 28.3 78.6 5.5 8.2 9 Cloudy Moderate 09:30 Middle 816574 810683 0.2 323 28.3 7.5 80.6 5.6 10.3 8 Bottom 7.5 3.2 331 28.3 10.4 1.0 0.1 225 28.4 7.4 19.0 87.3 6.1 42 87.4 4.2 1.0 0.1 229 28.4 7.4 19.0 6.1 -SR6 Moderate 09:07 4.6 Middle 817882 814660 Cloudy 3.6 0.1 76 28.4 7.4 88.1 88.7 6.2 6.2 6.6 -7.4 88.4 Bottom 19.0 3.6 0.1 79 28.4 6.7 1.0 0.3 194 28.0 7.7 7.7 20.6 74.8 74.8 5.2 5.2 7.2 7.2 Surface 28.0 7.7 20.6 74.8 1.0 0.3 200 28.0 7.9 0.1 192 27.5 7.8 23.5 73.2 73.1 5.1 2.8 2 --7.8 73.2 09:14 23.5 823659 823757 SR7 Rainy Moderate 15.8 Middle 27.5 7.8 5.1 7.9 0.1 207 27.5 2.7 -14.8 0.3 64 27.3 7.7 26.7 26.6 4.7 3.7 3 -69.1 Bottom 27.3 7.7 26.6 69.2 4.7 7.7 3.7 14.8 0.3 65 27.3 5.4 5.4 28.8 28.8 7.7 17.1 76.5 76.5 4.4 1.0 5 4 Surface 28.8 7.7 17.1 76.5 7.8 17.1 4.4 SR8 Cloudy Calm 10:28 5.1 Middle 820389 811638 8.3 11.7 28.0 7.8 69.8 28.0 7.8 19.6 69.7 4.9 Bottom

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

Water Quality Monitoring Results on 08 August 19 during Mid-Ebb Tide

Vater Qual	ity Monito	oring Resu	lts on		08 August 19	during Mid-	Ebb Tide	)																				
Monitoring	Weather	Sea	Sampling	Water	Sampling E	Depth (m)	Current Speed	Current	Water Te	mperature (°C)		рН	Salin	ity (ppt)		turation %)	Dissolved Oxygen	Turbidity	(NTU)	Suspender (mg/l		otal Alk (ppn		Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	el (µg/L
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value DA		
					Surface	1.0	0.1	115 120	29.4 29.4	29.4	8.1 8.1	8.1	14.3	14.3	86.3 86.3	86.3	6.1	2.7	-	2	-	84 85			1	<0.2	1.2	
C1	Sunny	Moderate	06:39	8.9	Middle	4.5	0.3	166	28.7	28.7	8.0	8.0	24.8	24.8	65.7	65.7	4.4	3.8	5.4	<2	2	89	89	815614	804265	<0.2	1.6	] ,,
01	Guilly	Woderate	00.55	0.5	Wilde	4.5 7.9	0.3	168 162	28.7 28.5		8.0		24.8 26.8		65.7 65.9		4.4	3.8 9.6	3.4	<2 2	´  -	90	03	013014	1	<0.2	1.7	_
					Bottom	7.9	0.3	163	28.5	28.5	8.0	8.0	26.8	26.8	66.0	66.0	4.4	9.6		2	-	94			L	<0.2	1.6	
					Surface	1.0	0.5	199 210	29.2 29.3	29.3	7.6	7.6	12.5	12.5	71.0	71.1	5.1	8.2 8.1	-	5 6	-	84 85			l	<0.2	1.4	
C2	Fine	Moderate	08:02	11.2	Middle	5.6	0.1	205	28.0	28.0	7.7	7.7	23.4	23.4	67.2	67.3	4.6	6.3	7.5	4	5	86	87	825665	806945	<0.2	1.3	Ι.,
02	1 11.0	Moderate	00.02			5.6 10.2	0.1	185 138	28.0 28.0		7.7		23.4		67.3 68.1		4.6	6.5 8.0	1	4	Ť	88 89	.	020000	1	<0.2	1.3	
					Bottom	10.2	0.2	126	28.1	28.1	7.7	7.7	23.4	23.4	68.3	68.2	4.7	8.0		5		89			<u>.                                    </u>	<0.2	1.1	
					Surface	1.0	0.5	83 89	28.3 28.3	28.3	7.8	7.8	22.4	22.4	75.5 75.4	75.5	5.2	3.8	1	3	-	84 85			I	<0.2	1.3	
СЗ	Fine	Moderate	06:11	11.0	Middle	5.5	0.4	89	28.0	28.0	7.8	7.8	22.9	22.9	71.2	71.1	4.9	4.6	4.5	3	3	86	87	822087	817815	<0.2	1.3	] ,
					_	5.5 10.0	0.4	79 71	28.0 27.6		7.8 7.8		22.9		71.0 70.8		4.9	4.5 5.1	1	3 4	-	88 89			ı	<0.2	1.5	
					Bottom	10.0	0.2	74	27.6	27.6	7.8	7.8	27.1	27.2	70.9	70.9	4.8	5.2		4		89			<u> </u>	<0.2	1.1	1
					Surface	1.0	0.2	152 157	29.0 29.0	29.0	8.0	8.0	30.2	30.2	78.4 78.4	78.4	5.1	5.0	1	3	-	90 90			I	<0.2	1.3	+
IM1	Sunny	Moderate	07:04	5.1	Middle	-	-	-	-	-	-		-	-	-	-	5.1	-	6.4	-	2	-	92	817945	807140	02		1.5
					Bottom	4.1	0.0	222	28.7	28.7	8.0	8.0	31.5	31.4	70.2	70.2	4.5 4.5	7.7	1	<2	-	93			I	<0.2	1.6	†
					Bollom	4.1 1.0	0.0	239 118	28.7	20.7	8.0	0.0	31.4	31.4	70.2		4.5 4.8	7.7 4.4		<2		93				<0.2	1.8	
					Surface	1.0	0.3	119	29.1 29.1	29.1	8.0	8.0	26.0 25.9	25.9	71.7 71.8	71.8	4.8 4.6	4.4	1	<2 <2		86 87			ı	<0.2	1.2	1
IM2	Sunny	Moderate	07:13	7.2	Middle	3.6	0.3	130 132	28.7 28.7	28.7	8.0	8.0	31.5 31.5	31.5	64.4 64.3	64.4	4.3	9.2	8.5	<2 2	2	90 91	90	818149	806174	<0.2	2 1.2	
					Bottom	6.2	0.3	121	28.6	28.6	8.0	8.0	32.1	32.1	65.2	65.2	4.2	11.9	1	3	E	93			ı	<0.2	1.9	1
						6.2 1.0	0.3	122 160	28.6 29.3		8.0		32.1 21.8		65.2 80.0		4.2 5.4	11.8 4.1		2		94 86	<del></del>			<0.2	1.8	
					Surface	1.0	0.4	151	29.3	29.3	8.0	8.0	21.9	21.8	79.9	80.0	5.4	4.1	1	2		87			I	<0.2	1.3	
IM3	Sunny	Moderate	07:22	7.3	Middle	3.7	0.4	141	28.8 28.8	28.8	8.0	8.0	30.0	30.0	66.5 66.5	66.5	4.4	9.0	7.2	<2 2	2	90 92	90	818793	805581	<0.2	2 1.4	
					Bottom	6.3	0.3	132	28.7	28.7	8.0	8.0	31.3	31.3	67.9	68.1	4.4	8.4	1	<2		94			ı	<0.2	1.1	T
						6.3 1.0	0.3	134 133	28.7 29.7		8.0		31.3 13.8		68.2 90.3		4.4 6.4	8.4 4.0		<2 <2		93 89	$\dashv$			<0.2	1.2	
					Surface	1.0	0.8	134	29.7	29.7	8.0	8.0	13.8	13.8	90.1	90.2	6.3	4.0	1	<2		89			ı	<0.2	1.7	
IM4	Sunny	Moderate	07:33	7.4	Middle	3.7	0.6	111 124	29.2 29.2	29.2	8.0	8.0	23.4	23.4	74.3	74.2	5.0	8.3 8.5	7.8	<2 <2	<2	92 93	92	819740	804598	<0.2	2 1.2	1.5
					Bottom	6.4	0.5	109	28.8	28.8	8.0	8.0	31.0	31.0	70.9	71.0	4.6	11.0		<2		94			I	<0.2	1.3	
					Surface	1.0	0.5 1.0	118 150	28.8 29.6	29.6	8.0	8.0	31.0 14.9	15.0	71.1 89.8	89.8	4.6 4.0 6.3	11.2 3.6		<2 <2		95 88	$\dashv$	$\overline{}$		<0.2	1.2	
					Surface	1.0 3.5	1.0	152 109	29.6 29.1		8.0	0.0	15.0 25.5		89.7 70.1		6.3 4.7 5.5	3.6 5.0		<2 <2	F	88 88			I	<0.2	1.4	
IM5	Sunny	Moderate	07:47	7.0	Middle	3.5	1.1	111	29.1	29.1	8.0	8.0	25.6	25.6	70.1	70.1	4.7	5.1	5.6	<2	2	89	90	820718	804861	<0.2	1.8	1.8
					Bottom	6.0	0.7	153 142	28.8 28.8	28.8	8.0	8.0	30.0	30.0	71.4	71.6	4.7 4.7	8.1 7.9		<2 3		92 92			I	<0.2	1.9 2.1	
					Surface	1.0	0.1	159	29.7	29.7	8.0	8.0	16.9	16.9	82.5	82.4	5.7	3.4		<2		87	= †			<0.2	1.7	
						1.0	0.1	163 133	29.7 29.0		8.0 7.9		16.9 26.8		82.3 64.4		5.7 4.3 5.0	3.4 6.3	1	<2 <2	-	90			I	<0.2	1.5	
IM6	Sunny	Moderate	07:58	6.7	Middle	3.4	0.1	135	29.0	29.0	7.9	7.9	26.8	26.8	64.3	64.4	4.3	6.4	6.3	2	2	91	90	821075	805833	<0.2	1.0	] '*
					Bottom	5.7 5.7	0.1	138 146	28.8 28.8	28.8	8.0	8.0	30.2	30.2	65.0 65.0	65.0	4.2 4.3	9.2	1	<2 2	-	93 94			I	<0.2	1.3	
					Surface	1.0	0.2	169	29.7	29.7	8.0	8.0	18.3	18.3	85.7	85.6	5.9	2.6		2		85				<0.2	1.3	
						1.0 4.1	0.2	152 166	29.7 29.1		8.0 7.9		18.3 23.0		85.5 71.7		5.9 4.8 5.4	2.6	1	<2 <2	_ }	87 90			l	<0.2	1.2	7
IM7	Sunny	Moderate	08:08	8.1	Middle	4.1	0.6	171	29.1	29.1	7.9	7.9	23.0	23.0	71.4	71.6	4.8	2.7	5.2	<2	2	90	90	821345	806857	<0.2	1.5	1.4
					Bottom	7.1 7.1	0.5	181 164	28.8 28.8	28.8	8.0	8.0	31.3	31.2	68.9 69.1	69.0	4.5 4.5	10.6	1	<2 2	-	94 95			ı	<0.2	1.6	
					Surface	1.0	0.3	165	29.2	29.2	7.7	7.7	9.1	9.1	75.3	75.3	5.5	6.7		5		84	寸			<0.2	1.5	
	_	Maderite	07:21	7.2	Middle	1.0 3.6	0.4	171 160	29.2 28.9		7.7		9.1 11.7		75.2 73.3		5.5 5.3	6.7 6.1	-	4	4	85 86	.	994994	000110	<0.2	1.4	7
IN A C									28.9	28.9	7.7	7.7	11.6	11.6	73.2	73.3	5.3	6.2	6.3	5	4	87	87	821824	808119	<0.2	1.6	
IM8	Fine	Moderate	07.21	1.2	middle	3.6 6.2	0.4	164 168	28.6		7.7		19.2		69.5	69.6	4.8	6.2	1	4	⊢	89		l	1	<0.2	1.5	

during Mid-Ebb Tide Water Quality Monitoring Results on 08 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Value Average 0.2 5.7 1.0 0.2 156 29.3 7.7 9.4 78.8 5.9 84 <0.2 1.8 3.4 0.2 169 172 29.2 7.7 10.4 78.8 78.7 5.7 5.7 5.7 5.7 4 86 87 <0.2 1.7 IM9 Fine Moderate 07:15 6.8 Middle 7.7 10.4 78.8 6.0 87 822076 808826 <0.2 7.7 3.4 0.2 29.2 5.8 0.2 149 28.6 71.6 71.7 89 < 0.2 1.7 7.7 18.3 5.0 6.1 Bottom 28.6 7.7 18.3 71.7 5.0 5.0 5.8 0.2 150 77 18.4 6.3 88 16 28.6 <0.2 0.1 137 29.3 84 1.5 78.4 Surface 29.3 7.7 9.2 78.3 7.7 9.2 78.2 5.7 85 1.6 1.0 0.1 139 29.2 5.7 < 0.2 29.1 29.1 1.6 0.1 135 141 12.3 12.3 77.3 77.3 5.6 5.6 5.4 86 86 <0.2 3.6 4 IM10 Fine Moderate 07:10 7.2 Middle 29.1 7.7 12.3 77.3 87 822405 809813 <0.2 0.1 5.4 6.2 0.0 107 28.5 7.7 18.7 73.8 5.2 5.4 89 <0.2 1.6 7.7 18.7 73.9 5.2 Bottom 28.5 6.2 0.0 113 28.5 7.7 74.0 5.2 5.4 89 < 0.2 1.7 0.2 82 7.7 5.4 85 1.7 1.0 28.8 15.0 76.6 5.5 4 <0.2 Surface 28.8 7.7 15.0 76.6 1.0 0.2 83 28.8 76.6 5.5 5.5 84 <0.2 1.7 3.7 0.2 45 28.4 7.8 19.9 71.6 5.0 7.2 86 <0.2 1.7 IM11 822040 811440 Fine Moderate 07:05 7.4 Middle 28.4 7.8 19.9 71.7 <0.2 3.7 7.4 88 1.6 28.4 <0.2 0.2 6.4 253 28.3 7.8 72.7 5.0 9.2 <0.2 1.6 Rottom 28.3 7.8 21.7 72.8 5.0 6.4 0.2 265 28.3 7.8 21.7 72.8 5.0 9.2 89 1.7 29.1 77.6 4.9 <0.2 1.8 Surface 29.1 7.7 14.8 77.7 7.7 1.0 0.4 89 29.0 14.8 5.5 5.0 85 <0.2 1.7 3.9 0.2 22 28.5 5.7 87 <0.2 1.7 Middle 71.2 821476 IM12 Fine Moderate 06:52 28.5 7.8 19.7 0.2 28.5 7.8 19.7 71.1 5.8 <2 87 1.5 4.7 6.7 0.1 325 28.1 7.8 68.0 9.2 89 <0.2 1.4 Bottom 28.1 7.8 22.5 67.8 4.7 357 67.5 6.7 0.1 28.1 7.8 22.6 4.6 9.1 2 90 <0.2 1.6 1.0 28.6 7.8 17.2 76.4 5.4 5.9 Surface 28.6 7.8 17.2 76.4 1.0 28.6 7.8 17.2 76.3 5.4 6.2 2 2.6 SR1A Fine Moderate 06:37 Middle 819971 812656 2.6 4.1 28.6 7.8 76.5 5.3 10.0 5.4 Bottom 28.6 7.8 19.0 76.7 4.1 28.6 7.8 19.0 76.9 5.4 9.8 3 1.0 0.2 77 28.8 7.8 78.7 4.2 85 <0.2 1.7 Surface 28.8 7.8 16.8 78.6 1.0 0.2 78 28.7 7.8 16.8 78.5 5.5 4.2 3 85 <0.2 1.8 SR2 Fine Moderate 06:31 4.6 Middle 821473 814173 <0.2 79.3 79.5 5.5 5.6 4.4 <0.2 1.4 Bottom 18.5 79.4 5.6 3.6 0.1 92 28.6 7.8 18.5 44 88 <0.2 1.5 1.0 0.3 167 28.9 77 15.3 70.1 5.0 6.6 4 7.7 15.3 70.1 1.0 0.3 158 28.9 77 15.2 70.0 5.0 6.6 3 4.3 0.2 146 28.7 7.7 16.8 68.1 4.8 5.0 4 -SR3 Fine Moderate 07:29 8.6 7.7 822164 807594 4.3 0.2 150 28.7 7.7 16.8 68.0 4.8 5.0 0.3 28.5 28.5 65.6 65.6 4.6 4.6 6.1 7.6 7.6 154 165 7.7 Bottom 7.7 65.6 4.6 7.7 1.0 0.5 81 29.1 8.0 22.7 72.9 4.9 4.8 <2 Surface 29.1 8.0 22.7 72.8 72.7 1.0 0.5 81 29.1 8.0 22.7 4.9 4.8 <2 -<2 4.5 0.5 88 8.0 4.5 6.0 28.7 23.5 66.2 807791 SR4A Sunny Calm 06:19 9.0 Middle 8.0 23.5 66.2 <2 817200 4.5 0.6 89 28.7 8.0 66.2 4.5 6.0 <2 23.5 28.7 0.5 8.0 68.2 68.3 10.7 8.0 23.4 4.6 Rottom 28.7 8.0 23.4 68.3 4.6 28.7 29.5 8.0 0.5 80 8.0 23.4 4.6 10.8 <2 <2 1.0 99 0.3 7.9 5.2 4.0 22.5 77.3 Surface 29.5 7.9 22.5 77.3 1.0 0.3 99 29.5 7.9 22.5 77.3 5.2 4.0 <2 SR5A 06:02 Middle <2 816576 810698 Sunny Calm 5.3 4.3 0.5 101 28.8 7.9 64.8 4.4 <2 25.4 9.0 Bottom 28.8 7.9 25.4 64.9 4.4 4.3 0.5 28.8 <2 7.9 3.8 Surface 29.3 7.9 24.0 83.0 39 29.3 7.9 3.8 <2 5.5 SR6A 05:36 4.6 Middle <2 817986 814749 Sunny Calm 3.6 172 29.0 59.0 59.1 <2 Bottom 7.7 59.1 0.1 181 1.0 0.4 97 28.2 7.8 21.8 76.6 5.3 3.5 <2 Surface 7.8 76.6 1.0 0.4 100 28.2 7.8 21.8 76.5 5.3 3.5 <2 8.4 0.1 335 28.2 7.9 22.2 75.0 5.2 3.8 <2 SR7 Fine Moderate 05:38 Middle 22.2 75.0 823644 823743 8.4 0.1 308 28.2 79 22.2 74 9 5.2 3.8 <2 15.7 0.0 67 28.0 7.9 71.9 4.9 3.4 <2 Bottom 7.9 25.2 71.9 15.7 0.0 73 28.0 7.9 71.9 4.9 3.3 28.9 28.9 1.0 7.7 78.0 77.7 5.6 5.6 5.1 2 <2 Surface 28.9 7.7 77 13.7 5.2 --SR8 Fine Moderate 06:45 5.0 Middle 2 820411 811626 4.0 28.5 7.7 19.7 72.8 5.7 5.1 Bottom 28.5 7.7 19.7 72.9 28.5

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 08 August 19 during

08 August 19 during Mid-Flood Tide

Water Qual	ity Monite	oring Resu	lts on		08 August 19	during Mid-	Flood Ti	de																					
Monitoring	Weather	Sea	Sampling	Water	Sampling [	Depth (m)	Current Speed	Current	Water Te	mperature (°C)	1	pН	Salir	nity (ppt)		aturation %)	Dissolv Oxyge		Turbidity(I	NTU)	Suspende (mg/			lkalinity m)	Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	(µg/L)
Station	Condition	Condition	Time	Depth (m)	, 3		(m/s)	Direction	Value	Average	Value	Average		Average	Value	Average			Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value DA		DA
					Surface	1.0	0.4	22	30.4 30.4	30.4	8.1 8.1	8.1	19.8 19.8	19.8	106.8 106.6	106.7	7.2		5.4 5.3	ŀ	<2 <2	ŀ	87 88	1			<0.2	2.2	İ
C1	Sunny	Moderate	12:51	7.7	Middle	3.9	0.3	39 41	29.7 29.6	29.6	8.1 8.1	8.1	21.3	21.3	80.0 79.4	79.7	5.4		7.0 7.1	8.6	<2 <2	<2	93 94	92	815643	804229	<0.2	1.6	1.8
					Bottom	6.7	0.3	32	28.7	28.7	8.0	8.0	31.9	31.9	71.5	71.7	4.6	4.7	13.5	İ	<2		96				<0.2	1.4	ŀ
					Surface	6.7 1.0	0.3	33 225	28.7 28.9	28.9	8.0 7.6	7.6	31.9 13.1	13.0	71.8 69.8	69.8	5.0		13.5 6.1		<2 2		96 84				<0.2 <0.2	1.6	
	_					1.0 5.8	0.6	240 291	28.9 28.1		7.6		12.9 23.3		69.7 68.1		5.0 4.7		6.0		<2 2		85 86	_			<0.2	1.6	í
C2	Fine	Moderate	11:41	11.6	Middle	5.8 10.6	0.1	303 4	28.1 28.1	28.1	7.7	7.7	23.3	23.3	68.6 69.1	68.4	4.7		6.1 7.4	6.5	<2 3	2	87 89	87	825699	806968	<0.2 <0.2 <0.2	1.8	1.8
					Bottom	10.6	0.1	4 260	28.1	28.1	7.7	7.7	23.3	23.3	69.3	69.2	4.8	4.8	7.4		3 <2		88				<0.2	1.8	
					Surface	1.0	0.3	268	28.8	28.9	7.8	7.8	20.2	20.2	86.0 85.8	85.9	5.9	53 🗀	8.2	þ	<2		84	1			<0.2	1.9	ļ
C3	Fine	Moderate	13:15	12.1	Middle	6.1	0.4	264 264	27.8 27.8	27.8	7.8	7.8	24.9	24.9	67.3 67.2	67.3	4.6		4.4	6.3	<2 2	2	87 87	87	822129	817796	<0.2 <0.2	1.9	1.9
					Bottom	11.1	0.3	302 328	27.5 27.5	27.5	7.8 7.8	7.8	28.5 28.5	28.5	66.7 66.9	66.8	4.5		6.4	F	<2 <2		89 90				<0.2	1.9	ſ
					Surface	1.0	0.5	19 19	29.9 29.9	29.9	8.0	8.0	24.9	24.9	79.0 78.8	78.9	5.2 5.2		6.3 6.4	ĺ	3	i	89 90				<0.2 <0.2	2.0 1.9	
IM1	Sunny	Moderate	12:32	4.6	Middle	-	-	-	-	-	-	-	-	-	-	-	-	5.2	-	8.6	-	3	-	91	817931	807117	- <0.2		1.9
					Bottom	3.6	0.4	350	29.0	29.0	8.0	8.0	29.3	29.3	71.0	71.0	4.6		10.6	Ŀ	3		91				<0.2	1.9	ļ
					Surface	3.6 1.0	0.4	322 40	29.0 30.1	30.1	8.0 8.1	8.1	29.4	21.9	71.0 93.3	93.2	4.7 6.2		10.9 6.1		<2 <2		92 88				<0.2	1.9	
						1.0 3.4	0.4	42 24	30.1 29.0		8.1 8.0		21.9 27.3		93.0 69.3		6.2 4.6		6.1 8.0		<2 <2		89 93				<0.2	1.8	í
IM2	Sunny	Moderate	12:25	6.7	Middle	3.4 5.7	0.5	25 357	29.0 28.8	29.0	8.0	8.0	27.3 31.1	27.3	69.2 68.1	69.3	4.6 4.4		8.0 9.7	8.0	3	3	93 96	93	818145	806186	<0.2 <0.2 <0.2	1.1	1.3
					Bottom	5.7	0.4	328	28.8	28.8	8.0	8.0	31.1	31.1	68.2	68.2	4.4	4.4	9.9	-	4		96				<0.2	1.1	
					Surface	1.0	0.5 0.5	328 356	29.9 30.0	29.9	8.1 8.1	8.1	20.1	20.1	92.1 91.9	92.0	6.2	🗀	8.3 8.1	t	4		88 88				<0.2 <0.2	1.0	ļ
IM3	Sunny	Moderate	12:19	6.8	Middle	3.4	0.5	333 306	29.0 29.0	29.0	8.0	8.0	27.6 27.6	27.6	69.1 69.1	69.1	4.6		10.2	9.7	<2 3	3	91 92	92	818777	805588	<0.2 <0.2	1.1	1.1
					Bottom	5.8 5.8	0.4	318 342	28.7 28.7	28.7	8.0	8.0	31.6 31.6	31.6	67.8 67.9	67.9	4.4		10.6	F	<2 3	ŀ	97 96				<0.2	1.0	ſ
					Surface	1.0	0.7	359 332	30.4 30.4	30.4	8.0	8.0	17.6 17.6	17.6	98.7 98.5	98.6	6.7		4.1	Ì	<2 <2	Ì	87 88				<0.2 <0.2	1.1	· ·
IM4	Sunny	Moderate	12:10	7.0	Middle	3.5 3.5	0.7	11	29.5	29.5	8.0	8.0	22.4	22.4	78.0 77.9	78.0	5.3	0.0	8.7	8.1	2	2	91 92	92	819712	804608	<0.2 <0.2 <0.2	1.1	1.1
					Bottom	6.0	0.5	340	29.5 29.0	29.0	8.0	8.0	27.2	27.2	70.5	70.5	4.7	4 7	11.3	Į	2		96	1			<0.2	1.1	ļ
					Surface	6.0 1.0	0.5	354 10	29.0 29.8	29.8	8.0 8.0	8.0	27.2 19.2	19.2	70.5 88.4	88.3	4.7 6.0		11.4 4.2		<2 4		96 89				<0.2 <0.2	1.1	
18.45	0	Madaga	40.00	0.5		1.0 3.3	0.9 1.0	10 9	29.8 29.2		8.0 7.9		19.2 23.6		88.2 73.7		6.0 5.0		4.2 6.7		5 4	4	90 93		000700	004070	<0.2	1.1	í
IM5	Sunny	Moderate	12:03	6.5	Middle	3.3 5.5	1.0 0.8	9	29.2 29.1	29.2	7.9 7.9	7.9	23.6 25.2	23.6	73.7 73.1	73.7	5.0 4.9		6.7 9.2	6.7	5 3	4	93 94	92	820726	804872	<0.2 <0.2 <0.2	1.0	1.1
					Bottom	5.5	0.9	9	29.1	29.1	7.9	7.9	25.2 19.5	25.2	73.2 84.4	73.2	4.9	4.9	9.2		5		94				<0.2	1.1	
					Surface	1.0	0.1	89	29.6	29.6	8.0	8.0	19.5	19.5	84.3	84.4	5.8	52	3.5	þ	6	ļ	88	1			<0.2	1.1	ļ
IM6	Sunny	Moderate	11:56	6.2	Middle	3.1	0.2	50 51	29.0 29.0	29.0	7.9 7.9	7.9	25.8 25.8	25.8	66.6 66.7	66.7	4.5		7.1	7.7	6 7	6	93 94	92	821077	805850	<0.2	1./	1.5
					Bottom	5.2 5.2	0.3	79 85	28.9 28.9	28.9	7.9	7.9	26.8 26.8	26.8	66.1 66.2	66.2	4.4		12.3 12.3	-	5 5	-	95 96				<0.2	1.7	i I
					Surface	1.0	0.1	21 21	29.8 29.8	29.8	8.0	8.0	18.3 18.3	18.3	90.4 90.3	90.4	6.2		3.2	Ì	6 5	Ì	88 89				<0.2 <0.2	1.7	
IM7	Sunny	Moderate	11:50	7.5	Middle	3.8	0.6	70	29.5	29.5	7.9	7.9	20.1	20.1	84.1 84.0	84.1	5.7	0.0	2.8	3.1	3	4	91	92	821326	806821	<0.2 <0.2 <0.2	1.5	1.6
					Bottom	3.8 6.5	0.6	75 65	29.5 29.3	29.3	7.9	7.9	22.1	22.1	79.1	79.1	5.4	5.4	3.3	-	3	ŀ	91 95				<0.2	1.6	ŀ
					Surface	6.5 1.0	0.3	65 205	29.3 29.5	29.5	7.9 7.6	7.6	7.9	7.9	79.1 76.6	76.6	5.4		3.3 6.6		4 6		95 85		<u> </u>		<0.2 <0.2	1.6	
						1.0	0.3	206 238	29.5 29.2		7.6 7.7		7.9 10.6		76.6 76.1		5.6 5.5		6.5 5.8	[	5 6	_ [	86 86	_			<0.2	1.7	í
IM8	Fine	Moderate	11:58	7.8	Middle	3.9	0.2	260 213	29.2	29.2	7.7	7.7	10.6	10.6	76.1 70.8	76.1	5.5		5.9	6.7	6	6	87 89	87	821809	808156	<0.2 <0.2 <0.2	1.8	1.7
DA: Denth-Aver					Bottom	6.8	0.2	213	28.5	28.5	7.7	7.7	19.6	19.6	70.8	70.9	4.9		7.5		5		89				<0.2	1.5	

during Mid-Flood Tide Water Quality Monitoring Results on 08 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value Value DA (Northing) (Easting) Value DA Value Average 0.2 77.8 1.0 0.2 221 29.2 7.7 10.3 5.6 5.6 4 84 <0.2 1.6 3.5 0.1 279 302 29.1 7.7 11.1 77.3 77.3 5.6 5.6 5.7 5.8 5 86 87 <0.2 1.8 IM9 Fine Moderate 12:04 6.9 Middle 7.7 11.1 77.3 6.0 87 822075 808808 <0.2 7.7 0.1 29.0 5.9 0.3 289 28.5 69.3 69.4 6 89 <0.2 1.6 7.7 19.1 4.8 6.8 Bottom 28.5 7.7 19.0 69.4 4.9 7.7 19.0 4.9 0.3 28.5 6.7 89 16 5.9 297 <0.2 0.1 29.7 1.6 5.8 80.4 < 0.2 Surface 29.7 7.7 11.2 80.4 7.7 11.2 80.4 5.7 84 1.6 1.0 0.1 195 29.7 5.3 < 0.2 0.2 28.5 28.5 1.4 3.8 17.8 17.8 72.4 72.4 5.1 6.6 86 87 <0.2 IM10 Fine Moderate 12:10 7.6 Middle 28.5 7.7 17.8 72.4 87 822396 809785 <0.2 6.6 0.3 292 28.3 7.7 68.9 4.8 9.5 89 <0.2 1.5 21.9 7.7 21.9 69.0 4.8 Bottom 28.3 6.6 0.3 309 28.3 7.7 69.1 4.8 9.5 90 < 0.2 1.5 1.0 0.3 352 7.7 77.2 7.5 84 1.4 29.0 15.7 5.5 <0.2 Surface 29.0 7.7 15.7 77.2 1.0 0.3 29.0 77.2 5.5 7.5 85 <0.2 1.4 1.4 3.9 0.4 315 28.3 7.8 20.2 68.5 4.8 6.8 87 <0.2 IM11 67.8 822033 811475 Fine Moderate 12:20 7.8 Middle 28.2 7.8 21.4 <0.2 0.4 6.8 88 1.5 3.9 <0.2 326 28.1 6.8 273 28.0 23.7 67.9 5.7 89 <0.2 1.5 Rottom 28.0 7.7 23.7 68.0 47 6.8 0.3 274 28.0 7.7 23.7 68.1 4.7 5.5 90 1.7 334 28.9 13.8 79.4 79.2 4.8 <0.2 1.7 Surface 28.9 7.7 13.7 79.3 7.7 1.0 0.1 307 28.8 13.7 5.7 4.8 84 <0.2 1.6 4.1 0.2 286 28.1 4.1 87 <0.2 1.4 70.7 IM12 12:21 Middle 821446 812063 Fine Moderate 7.7 20.5 70.6 4.1 0.2 28.1 7.7 4.9 4.1 88 1.4 7 1 0.2 264 27.8 77 24.9 63.6 4.3 79 89 <0.2 1.3 Bottom 27.8 7.7 24.9 63.7 4.4 24 9 63.7 7.1 0.2 273 27.8 77 44 7.9 6 90 <0.2 1.4 1.0 29.1 7.8 15.1 88.7 6.3 4.2 Surface 29.1 7.8 15.1 88.8 1.0 29.1 7.8 15.1 88.8 6.3 4.2 5 2.6 SR1A Fine Moderate 12:35 5.1 Middle 819974 812659 2.6 29.0 29.0 84.0 83.9 5.8 5.8 4.1 7.8 19.3 4.4 Bottom 7.8 19.4 84.0 5.8 41 7.8 44 194 1.0 0.2 335 29.2 7.8 18 1 88.2 61 41 85 <0.2 1.4 Surface 29.2 7.8 18.1 88.2 1.0 0.2 15 308 7.8 18 1 61 41 6 84 29.2 88.2 < 0.2 -SR2 Fine Moderate 12:43 4.6 Middle 87 821444 814177 1.5 3.6 0.3 334 307 29.0 20.3 88.9 89.2 6.1 4.1 88 <0.2 7.8 Bottom 29.0 20.3 89.1 6.1 0.3 7.8 4.1 1.3 29.0 89 < 0.2 1.0 0.2 215 7.6 29.3 9.4 73.5 5.4 6.0 6 Surface 29.3 7.6 9.0 73.5 1.0 7.6 73.4 5.4 5.9 0.2 218 29.2 8.6 4.3 5.3 5.1 211 28.9 15.3 72.3 SR3 11:54 Middle 7.7 822149 807578 Fine Moderate 8.6 28.9 15.3 72.3 4.3 0.2 228 28.9 7.7 15.2 72.2 5.1 5.3 5 . 7.7 7.6 0.1 28.7 71.5 5.0 5.0 7.6 7.9 4 212 17.8 Rottom 28.7 7.7 17.8 71.6 5.0 28.7 7.7 1.0 0.4 255 29.8 8.0 81.9 5.6 7.1 20.6 Surface 29.8 8.0 20.6 81.8 1.0 277 29.8 20.6 5.5 7.2 0.4 4.9 4.0 0.4 29.1 4.2 9.2 250 8.0 26.8 63.3 SR4A Calm 13:10 8.0 Middle 29.1 8.0 26.8 63.3 817176 807830 Sunny 4.0 0.4 266 29.1 8.0 4.2 9.2 0.4 273 28.9 8.0 29.5 63.7 4.2 12.5 Bottom 28.9 8.0 29.5 63.8 4.2 7.0 28.9 12.4 275 1.0 0.2 300 29.7 8.0 6.0 21.5 88.7 6.0 Surface 29.7 8.0 21.5 88.7 1.0 0.3 302 29.7 8.0 88.6 6.0 6.0 4 Sunny Calm 13:27 Middle 810680 3.8 0.2 328 29.2 7.9 70.1 4.7 9.7 6 Bottom 7.9 4.7 3.8 354 29.2 7 0 17 9.7 1.0 222 0.1 30.1 8.2 19.6 122.5 8.3 3.9 1.0 0.1 229 30.1 8.2 196 122.2 8.3 3.9 4 8.3 -SR6A Calm 13:58 3.9 Middle 817944 814747 Sunny 2.9 0.1 79 29.2 7.9 7.9 74.0 74.1 5.0 5.0 7.2 -7.9 74.1 Bottom 2.9 0.1 86 29.2 23.4 1.0 0.1 311 28.3 7.8 7.8 23.3 79.8 79.8 5.4 5.4 3.0 Surface 28.3 7.8 23.3 79.8 1.0 0.1 330 28.3 3.0 8.3 0.0 143 27.7 7.8 26.9 26.9 76.2 76.2 5.1 4.7 5 -7.8 76.2 13:44 27.7 26.9 823627 823728 SR7 Fine Moderate 16.6 Middle 5.1 7.8 8.3 0.0 152 27.7 4.9 4 -15.6 0.2 87 27.5 7.8 29.2 29.2 4.6 6.5 4 -68.7 Bottom 27.5 7.8 29.2 68.8 4.6 7.8 68.8 4.6 27.5 15.6 0.2 6.4 6.0 30.3 7.7 13.2 13.1 85.9 85.5 7.1 1.0 5 Surface 30.3 7.7 85.7 13.2 7.7 7.0 6.0 SR8 Fine 12:27 5.2 Middle 820374 811621 Moderate 5.2 5.2 28.3 21.2 28.3 7.7 21.2 74.8 5.2 Bottom

DA: Depth-Averaged

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 10 August 19 during

10 August 19 during Mid-Ebb Tide

Water Qual	lity Monit	oring Resu	ilts on		10 August 19	during Mid-Ebb	Tide																					
Monitoring	Weather	Sea	Sampling	Water	Sampling De	90		Water T	emperature (°C)		рН	Salir	nity (ppt)		aturation (%)	Disse Oxy		Turbidity(	NTU) Su	ended So (mg/L)		l Alkalinity (ppm)	. 000	rdinate Grid	Coordinate HK Grid	Chromi (µg/L		lickel (µg/L)
Station	Condition	Condition	Time	Depth (m)			/s) Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA V	lue D	A Valu	ue DA		rthing)	(Easting)	Value	DA Va	alue DA
					Surface		.1 211	28.8 28.8	28.8	8.2	8.2	17.0	17.0	94.9	94.9	6.7	-	7.6 7.6		3	84 84					<0.2		1.5
C1	Fine	Moderate	08:46	8.9	Middle	4.5 0	.2 187	28.4	28.4	8.2	8.2	19.5	19.5	91.9	91.9	6.4	6.6	7.3	7.5	5 6	86	86	6 81	5605	804225	-O 2	-0.2	1.4
					Bottom	7.9 0	.4 221	28.1	28.1	8.2	8.2	22.1	22.1	89.4	89.4	6.2	6.2	7.7		,	86 88	;				<0.2	1	1.3
					Surface		.4 224	28.1	29.1	8.2 8.1	8.1	22.1 15.2	15.2	89.4 97.2	97.1	6.2		7.7 3.8		5	88			$\rightarrow$		<0.2		1.3
							.3 132 .3 126	29.1 27.7		8.1 8.0		15.2 23.8		96.9 68.1		6.8 4.7	5.8	3.8		j .	83 87	.				<0.2 <0.2	1	1.3
C2	Sunny	Moderate	10:58	10.8	Middle	5.4 0	.3 126	27.7	27.7	8.0	8.0	23.7	23.8	68.2	68.2	4.7		3.9	6.9	5 .	87 91	. 0/	7 82	5662	806959	<0.2	<0.2	1.5 1.5
					Bottom	9.8 0	.3 80 .3 83	27.5 27.4	27.5	8.0	8.0	25.3 25.3	25.3	64.9 65.4	65.2	4.5 4.5	4.5	13.0		<u> </u>	91					<0.2 <0.2	1	1.5
					Surface		.2 266 .2 276	27.7 27.7	27.7	8.0	8.0	24.5	24.5	80.0	80.1	5.5 5.5	6.5	2.7		5	83 84					<0.2 <0.2		1.4
C3	Sunny	Moderate	08:16	12.3	Middle		.2 306 .2 314	28.8 28.8	28.8	8.1 8.1	8.1	18.8 18.8	18.8	106.0 106.0	106.0	7.4	6.5	2.4 2.4		5 5	87 88		8 82	2100	817793	<0.2		1.5 1.5
					Bottom	11.3	.2 33	28.6	28.6	8.1	8.1	19.6	19.6	100.4	100.6	7.0	7.0	2.4		5	92	!				<0.2	_1	1.8
					Surface	1.0 0	.2 34	28.6 28.8	28.8	8.2	8.2	16.0	16.0	95.7	95.6	6.8		8.3		6	81			$\overline{}$		<0.2	1	1.3
IM1	Fine	Moderate	09:12	5.1	Middle		.3 22	28.8		8.2		16.0		95.5		6.8	6.8	8.4	_	· .	81		2 04	7937	807154	<0.2	_	1.4
IIVI	rine	Woderate	09.12	5.1				28.2	-	8.1		19.4		85.9		6.0		12.1		· '	- 84		3 01	1931	607154	<0.2		1.4
					Bottom	4.1 0	.3 35	28.2	28.2	8.1	8.1	19.4	19.4	85.9	85.9	6.0	6.0	12.1		S	85					<0.2	1	1.2
					Surface	1.0 0	.5 176 .5 183	29.2 29.2	29.2	8.1 8.1	8.1	14.9	14.9	92.2 92.0	92.1	6.5 6.5	6.2	8.2 8.2		5	85 85	i				<0.2	4	4.5 4.8
IM2	Fine	Moderate	09:20	7.2	Middle		.0 216	28.4 28.4	28.4	8.1 8.1	8.1	18.0 18.0	18.0	84.3 84.2	84.3	5.9 5.9		8.5 8.6		5 6	88 89		8 81	8175	806170	<0.2		1.4 1.4
					Bottom		.1 44	28.0 28.0	28.0	8.1 8.1	8.1	20.7	20.7	82.4 82.6	82.5	5.7 5.8	5.8	10.1 10.0		3	90					<0.2		1.4
					Surface		.8 199 .8 218	29.1 29.1	29.1	8.1 8.1	8.1	14.7	14.7	95.1 95.0	95.1	6.7		8.8		5	84 85					<0.2		1.2
IM3	Fine	Moderate	09:30	7.3	Middle	3.7	.8 200	27.9	27.9	8.0	8.0	21.7	21.7	75.6	75.6	5.3	6.0	15.2	13.6	5 .	87	. 87	7 81	8792	805598	<0.2	-0.2	1.2
					Bottom	6.3	.8 200 .3 216	27.9 27.7	27.7	8.0	8.0	21.7 22.4	22.4	75.6 77.4	77.4	5.3 5.4	5.4	15.2 16.9		5	88 89	1				<0.2 <0.2	_1	1.2
					Surface		.4 <u>226</u> .8 177	27.7 29.0	29.0	8.0 8.1	8.1	22.4 15.9	15.9	77.4 85.8	85.6	5.4 6.1		16.9 10.5		5	90			$\rightarrow$		<0.2 <0.2	1	1.7
							.9 193 .9 190	29.0 28.2		8.1 8.0		15.9 19.8		85.4 78.1		6.0 5.5	5.8	10.5 13.8		3 ,	85 87		_			<0.2	-	1.8
IM4	Fine	Moderate	09:40	7.4	Middle	3.7	.9 206 .2 201	28.1	28.1	8.0	8.0	19.8	19.8	78.0 75.5	78.1	5.5		14.0	15.0	5 5	88	۰′	7 81	9720	804630	<0.2	<0.2	1.7 1.5
					Bottom	6.4 0	.2 208	27.7	27.7	8.0	8.0	22.7	22.7	75.5	75.5	5.2	5.2	20.5		ı	90	)				<0.2	1	1.5
					Surface		.8 192 .9 192	29.0 29.0	29.0	8.1 8.1	8.1	14.1	14.1	92.3 92.1	92.2	6.6	6.2	8.9 8.9		1	85 86					<0.2 <0.2		1.7 1.5
IM5	Fine	Moderate	09:55	7.0	Middle		.7 215 .7 224	28.3	28.3	8.1	8.1	19.8	19.8	81.5 81.5	81.5	5.7	0.2	10.2		5 5	88		8 82	0747	804844	<0.2		1.6
					Bottom		.7 243 .7 249	27.9 27.9	27.9	8.0	8.0	21.7	21.7	79.0 79.0	79.0	5.5 5.5	5.5	17.1 17.1		5	89 90					<0.2		1.7 1.5
					Surface	1.0 0	.5 218 .5 228	29.0	29.0	8.1 8.1	8.1	14.0	14.1	94.6 94.5	94.6	6.7		8.5 8.5		5	85 85	i		$\exists$		<0.2	1	1.4
IM6	Fine	Moderate	10:06	6.7	Middle	3.4 0	.5 243	28.1	28.1	8.1	8.1	20.0	20.0	79.6	79.7	5.6	6.2	10.4	10.6	5 .	88		8 82	1058	805821	<0.2	-0.2	1.6
					Bottom		.5 252 .4 277	28.1 27.8	27.8	8.1 8.1	8.1	20.0	22.1	79.7 79.1	79.2	5.6 5.5	5.5	10.4 13.0		3	88 90					<0.2 <0.2	_ 1	1.6
							.5 288 .4 256	27.8		8.1 8.1		22.1 15.1		79.2 91.3		5.5 6.5	5.5	13.0 8.6		1	89 84					<0.2		1.4
					Surface	1.0 0	.4 279	28.8	28.8	8.1	8.1	15.1	15.1	91.1	91.2	6.5	6.2	8.6 9.4			85					<0.2	1	1.2
IM7	Fine	Moderate	10:16	8.1	Middle	4.1 0	.6 245	28.5	28.5	8.1 8.1	8.1	17.2	17.2	84.0 83.8	83.9	5.9 5.9		9.4	10.2	5	88	۰/	7 82	1342	806850	<0.2	1	1.2
					Bottom	7.1 0	.3 250 .3 267	27.8 27.8	27.8	8.0	8.0	21.8	21.8	77.1 77.1	77.1	5.4 5.4	5.4	12.7 12.7		5	89 90	)				<0.2 <0.2	1	1.4
					Surface		.8 82 .9 87	29.1 29.1	29.1	8.1 8.1	8.1	15.3 15.3	15.3	97.6 97.6	97.6	6.9	T	3.8		j.	83 83					<0.2		1.4
IM8	Sunny	Moderate	10:32	7.7	Middle	3.9 0	.7 104 .8 109	28.7	28.7	8.0	8.0	16.2	16.3	87.3 86.6	87.0	6.2	6.5	3.8	4.8	2	88	07	7 82	1820	808159	-n 2	.0.2	1.4
					Bottom	6.7	.4 73	27.4	27.4	8.0	8.0	25.3	25.3	63.8	63.9	4.4	4.4	7.1		ļ	92	!				<0.2	1	1.3
DA: Depth-Aver						6.7	.4 77	27.4		8.0		25.3		64.0		4.4		7.0		5	91					<0.2		1.3

during Mid-Ebb Tide Water Quality Monitoring Results on 10 August 19 Turbidity(NTU) Suspended Solids Salinity (ppt) Nickel (µg/L) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitorino Current Sampling Depth (m) HK Grid HK Grid Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Average Value Value DA Value DA Value Value DA (Northing) (Easting) DA Value Average Value 0.8 1.3 8.1 0.9 99 29.0 97.0 6.9 3.8 4 84 1.1 6.3 3.6 0.6 112 28.4 8.1 8.1 19.4 80.8 80.4 5.6 5.6 3.3 6 5 87 88 1.1 IM9 Sunny Moderate 10:26 7.1 Middle 80.6 4.8 88 822111 808790 1.2 0.6 19.6 28.4 <0.2 6.1 0.4 102 27.4 7.2 4 92 1.2 8.0 25.3 65.5 4.5 <0.2 Bottom 27.4 8.0 25.3 65.8 4.5 4.5 8.0 6.1 0.4 104 27.4 66.1 74 91 12 25.4 84 29.0 3.9 1.6 8.2 Surface 29.0 8.2 15.4 97.9 29.0 8.2 15.4 97.8 6.9 83 1.5 1.0 0.8 86 3.9 5 < 0.2 79.6 79.9 3.4 107 28.2 28.2 5.6 5.6 5 1.5 4.2 0.6 8.1 18.6 88 87 <0.2 IM10 Sunny Moderate 10:15 8.3 Middle 28.2 8.1 19.5 79.8 87 822384 809816 <n 2 0.6 7.3 67.3 0.4 87 27.5 8.0 25.1 67.0 6.2 6 91 <0.2 1.6 27.5 8.0 4.6 Bottom 25.1 7.3 0.4 87 27.5 8.0 25.1 67.6 4.6 6.2 91 <0.2 1.4 1.0 0.7 106 29.0 3.7 1.5 8.1 15.9 6.7 5 83 <0.2 94.5 94.3 Surface 29.0 8.1 15.9 1.0 29.0 8.1 94.1 6.6 3.7 4 83 <0.2 1.4 3.8 0.5 107 27.7 68.1 88 <0.2 1.4 8.0 23.8 IM11 68.1 822048 811447 Sunny Moderate 10:00 7.6 Middle 27.7 8.0 23.8 114 4.7 4.7 88 <0.2 1.4 0.5 3.8 108 27.5 8.0 67.6 4.6 9.4 6 <0.2 1.4 4.7 Bottom 27.5 8.0 25.1 6.6 0.3 116 27.5 8.0 67.7 9.1 92 1.4 28.9 95.8 95.7 95.8 6.7 83 <0.2 1.4 Surface 28.9 8.1 16.6 1.0 0.6 81 28.9 8.1 16.6 3.7 5 87 <0.2 1.4 4.9 0.5 94 28.5 8.1 3.4 6 88 <0.2 1.4 Middle 821462 IM12 Sunny Moderate 09:54 28.5 8.1 19.7 84.4 4.9 8.1 6.0 3.4 87 1.6 8.7 0.4 100 28.3 8.0 19.9 81.2 5.7 3.5 9 92 <0.2 2.0 Bottom 28.3 8.0 19.8 81.2 5.7 5.7 81.1 8.7 0.5 102 28.3 8.0 19.8 3.4 9 91 <0.2 1.8 1.0 28.8 8.1 18.3 92.5 6.5 5.1 6 Surface 28.8 8.1 18.3 92.4 1.0 28.8 8.1 18.3 92.3 6.4 5.1 6 2.8 Sunny Moderate 09:34 Middle 819978 812664 2.8 4.5 28.4 8.1 84.6 4.3 84.8 5.9 Bottom 28.4 8.1 20.5 4.5 28.4 8.1 20.5 84 9 5.9 4.3 6 1.0 0.6 88 29.0 16.6 3.5 83 <0.2 1.5 Surface 29.0 8.1 16.6 97.6 1.0 0.6 93 28.9 8.1 16.6 97.5 6.9 3.5 5 83 <0.2 1.5 SR2 Sunny Moderate 09:20 4.8 Middle 821456 814158 < 0.2 3.8 110 81.0 81.2 5.6 5.6 81.1 87 3.8 0.3 116 28.2 8.0 4.0 5 < 0.2 1.7 1.0 0.8 106 29.1 8.1 15.3 97.0 6.9 3.8 5 Surface 8.1 15.3 96.9 1.0 0.9 116 29.1 8.1 15.3 96.7 6.8 3.7 6 4.2 0.7 120 27.6 8.0 24.5 65.7 4.5 5.9 5 SR3 Moderate 10:38 8.4 24.5 65.7 822155 807559 Sunny 4.5 4.2 0.7 128 27.6 8.0 24.5 65.7 5.9 4 0.5 27.5 27.4 8.0 65.4 65.6 4.5 4.5 7.5 7.8 7.4 96 103 5 4 Bottom 27.5 8.0 25.3 65.5 4.5 1.0 0.1 346 28.8 8.2 16.9 96.3 6.8 7.5 5 Surface 28.8 8.2 96.4 7.6 7.5 1.0 0.1 348 28.8 8.2 96.4 6.8 4 6.7 4.5 258 6.5 4 28.4 8.2 92.8 807810 SR4A Fine Calm 08:27 9.0 Middle 28.4 8.2 19.0 92.8 817188 4.5 271 8.2 6.5 7.5 0.2 28.4 92.8 4 0.1 28.4 8.0 246 8.2 92.6 6.5 7.4 Rottom 28.4 8.2 19.7 92.6 6.5 269 85 28.4 28.5 7.4 8.0 0.2 8.2 92.6 6.5 4 1.0 0.1 7.4 3 8.2 18.9 95.5 6.7 Surface 28.5 8.2 18.9 95.5 1.0 0.1 88 28.5 8.2 18.9 95.4 6.7 7.4 3 SR5A 08:10 5.3 Middle 816596 810690 Fine Calm 4.3 0.0 121 28.3 7.6 8.2 94.3 6.6 8.2 Bottom 28.3 20.1 94.4 6.6 4.3 0.0 127 28.3 8.2 Surface 28.3 8.2 20.0 93.0 50 28.3 6.5 7.7 4 SR6A 07:44 4.6 Middle 817968 814724 Fine Calm 3.6 236 28.2 92.3 6.4 4 Bottom 253 1.0 0.5 98 28.8 8.1 7.3 2.4 4 Surface 1.0 0.5 99 28.8 8.1 18.7 105.0 7.3 2.5 6 7.3 0.3 114 28.6 8.0 19.9 96.8 6.7 2.3 5 SR7 Sunny Moderate 08:12 Middle 823645 823751 73 0.3 118 28.6 8.0 199 96.6 6.7 2.3 4 5.2 13.6 0.3 73 27.3 8.0 26.6 75.5 2.4 5 Bottom 75.4 13.6 0.3 78 27.2 8.0 29.2 29.1 89.4 88.9 1.0 8.1 5.9 5.8 Surface 29.2 89.2 18 9 6.2 5 8 1 6.2 -SR8 Sunny Moderate 09:45 4.2 Middle 820413 811617

8.0

8.0

27.8

23.1

23.1

70.8

71.1

4.9

4.9

8.5

8

DA: Depth-Averaged

3.2

27.8

Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 10 August 19 during

10 August 19 during Mid-Flood Tide

Water Qual	lity Monit	oring Resi	ılts on		10 August 19	during Mid-	Flood Tic	de																					
Monitoring	Weather	Sea	Sampling	Water	Sampling De	pth (m)	Current Speed	Current	Water Te	emperature (°C)		рН	Salir	ity (ppt)		aturation %)	Dissol Oxyg		Turbidity(	NTU)	Suspende (mg/		Total Alkali (ppm)	, 00	oordinate HK Grid	Coordinate HK Grid	Chromi (µg/L		kel (µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value D		lorthing)	(Easting)	Value	DA Valu	ue DA
					Surface	1.0	0.1	68 76	29.3 29.3	29.3	8.3 8.3	8.3	18.4	18.4	99.6 99.1	99.4	6.9	-	8.9 8.9		5 5		85 85				<0.2	1.3	
C1	Fine	Moderate	16:29	7.7	Middle	3.9	0.1	50	28.3	28.3	8.1	8.1	20.7	20.7	82.7	82.7	5.7	6.3	10.1	10.8	6	6	89	8 8	315625	804237	<0.2	1.2	2 1.5
			10.20	• • •		3.9 6.7	0.1	51 32	28.3 27.8		8.1 8.1		20.7		82.6 82.1		5.7 5.7		10.1 13.2		5 6		90	.   .			<0.2	1.3	
					Bottom	6.7	0.1	30	27.8	27.8	8.1	8.1	23.5	23.5	82.3	82.2	5.7	5.7	13.4		7		91				<0.2	1.8	3
					Surface	1.0	0.2	76 78	29.1	29.1	8.1	8.1	15.2	15.2	99.0	99.0	7.0		3.7	-	5 5		85 86				<0.2	1.5	
C2	Fine	Moderate	15:07	8.5	Middle	4.3	0.3	70	29.0	29.0	8.1	8.1	15.8	15.8	94.0	93.8	6.6	6.8	3.8	4.3	6	6	89	9 8	325685	806943	<0.2	-0.2 1.4	4 14
					Bottom	4.3 7.5	0.3	76 29	29.0 27.6	27.7	8.1	8.0	15.8 24.8	24.8	93.6 65.7	65.8	6.6 4.5	4.5	3.8 5.5		7		93				<0.2	1.2	
					Bollom	7.5 1.0	0.1	26 311	27.7 28.8	21.1	8.0	0.0	24.8 19.2	24.0	65.8 104.1		4.5 7.2	4.5	5.3 3.3		6		93 85				<0.2 <0.2	1.4 1.6	
					Surface	1.0	0.1	319	28.8	28.8	8.2	8.2	19.2	19.2	104.1	104.3	7.3	6.3	3.4	Ŀ	5		85				<0.2	1.4	4
С3	Fine	Moderate	16:48	10.8	Middle	5.4 5.4	0.3	350 355	27.9 27.9	27.9	8.1 8.1	8.1	22.8	22.8	78.6 78.7	78.7	5.4 5.4	0.0	3.8	3.6	4 5	5	89 88	9 8	322092	817814	<0.2	<0.2 1.4	1.6
					Bottom	9.8	0.1	282	27.4	27.4	8.2	8.2	26.6	26.7	71.3	71.2	4.9	4.9	3.7		5		93				<0.2	1.8	3
						9.8	0.1	288	27.3 29.6		8.2		26.8 12.6		71.1 98.2		4.9 7.0		3.8 8.6		5 4		92 84				<0.2	1.7 4.9	
					Surface	1.0	0.2	23	29.6	29.6	8.1	8.1	12.6	12.6	98.0	98.1	7.0	7.0	8.6	ļ	5		85				<0.2	5.1	1
IM1	Sunny	Moderate	16:08	4.6	Middle	-	-		-	-	-	-	<del>-</del>	-	-	-	-		-	8.5	-	4	- 8	6 8	317936	807110	<del>  </del> -	<0.2	
					Bottom	3.6	0.1	299	28.7	28.7	8.0	8.0	16.7	16.7	92.6	92.7	6.5	6.5	8.3	ļ	4		88				<0.2	4.7	
					Surface	3.6 1.0	0.1	323 60	28.7	29.7	8.0	8.1	16.7 12.4	12.4	92.7 99.2	99.2	6.5 7.1		8.3 8.7		6		88 85				<0.2 <0.2	4.5 1.4	4
						1.0 3.4	0.8	68 64	29.7 28.6		8.1 8.1		12.4 16.8		99.1 88.4		7.0 6.2	6.6	8.7 8.4	F	6 4		85				<0.2 <0.2	1.6	
IM2	Sunny	Moderate	15:59	6.7	Middle	3.4	0.8	63	28.6	28.6	8.1	8.1	16.8	16.8	88.3	88.4	6.2		8.4	8.6	4	5	89	8 8	318166	806172	<0.2	1.6	î 1.6
					Bottom	5.7	0.3	42 44	28.4 28.4	28.4	8.0	8.0	18.4	18.4	87.7 87.7	87.7	6.2	6.2	8.8	-	5 6		90				<0.2	1.6	
					Surface	1.0	0.7	51	28.9	28.9	8.0	8.0	14.5	14.5	87.8	87.8	6.3		8.4		5		85				<0.2	1.4	4
IM3	0	Madagas	45.50		No. d. ale	1.0 3.4	0.7	55 60	28.9 28.3		8.0		14.6		87.7 82.6	82.6	6.2 5.8	6.0	8.4 8.8		6		86 88	8 8	318766	005005	<0.2	1.6	
IIVI3	Sunny	Moderate	15:50	6.8	Middle	3.4	0.7 0.2	69	28.3	28.3	8.0	8.0	18.7	18.7	82.6	82.6	5.8		8.8	9.1	6 5	6	89	8   8	318766	805605	<0.2	1.6	5 1.0
					Bottom	5.8 5.8	0.2	35 38	28.2 28.2	28.2	8.0	8.0	19.6 19.6	19.6	84.3 84.2	84.3	5.9 5.9	5.9	10.1	-	5		90 91				<0.2	1.6	
					Surface	1.0	1.1	48 49	29.3 29.3	29.3	8.1 8.1	8.1	12.1 12.5	12.3	91.1	91.0	6.5 6.5		9.2 9.2		5 6		86 86				<0.2 <0.2	1.6	
IM4	Sunny	Moderate	15:40	7.0	Middle	3.5	0.9	57	28.5	28.5	8.1	8.1	16.7	16.7	85.0	85.0	6.0	6.3	9.0	9.3	6	6	88	8 8	319743	804588	<0.2	.0.2 1.7	7 27
1141-4	Outliny	Woderate	13.40	7.0		3.5 6.0	1.0 0.3	61 50	28.5 28.3		8.1 8.0		16.7 18.5		85.0 84.5		6.0 5.9		9.0 9.6	3.5	7 5	Ü	88		713743	004300	<0.2	<0.2 1.7 4.8	/
					Bottom	6.0	0.3	49	28.3	28.3	8.0	8.0	18.5	18.5	84.6	84.6	5.9	5.9	9.6		5		90				<0.2	4.7	7
					Surface	1.0	1.0	43 45	29.1 29.0	29.1	8.1 8.1	8.1	12.3	12.3	89.3 89.1	89.2	6.4		8.8	ŀ	5 5		85 85				<0.2	5.2 5.1	<u>-</u>
IM5	Sunny	Moderate	15:31	6.5	Middle	3.3 3.3	1.0 1.0	52 53	28.6	28.5	8.1 8.1	8.1	16.7 16.6	16.6	85.1 85.1	85.1	6.0	6.2	8.7	8.7	3	4	88	8 8	320752	804880	<0.2	<0.2 5.3	3 50
					Bottom	5.5	0.5	65	28.5 28.3	28.3	8.0	8.0	18.5	18.5	85.1	85.1	6.0	6.0	8.6 8.5		3		88				<0.2	5.4	4
						5.5 1.0	0.6	69 41	28.3 29.5		8.0		18.5		85.1 98.4		6.0 7.1	0.0	8.5 10.1		4		90 84	_			<0.2	5.3 5.2	
					Surface	1.0	0.4	43	29.5	29.5	8.2	8.2	11.2	11.2	98.2	98.3	7.0	6.5	10.2	ļ	4		85				<0.2	5.4	4
IM6	Sunny	Moderate	15:24	6.2	Middle	3.1	0.7	41 44	28.5 28.5	28.5	8.1 8.1	8.1	16.9	16.9	85.4 85.3	85.4	6.0	-	9.0	9.6	4	4	88 89	8 8	321071	805843	<0.2	<0.2 5.1	3.9
					Bottom	5.2	0.4	58	28.4	28.4	8.1	8.1	17.8	17.8	84.1	84.1	5.9	5.9	9.7	Į	5		90				<0.2	1.4	4
						5.2 1.0	0.5	53 36	28.4		8.1 8.1		17.8 15.7		84.1 87.8		5.9 6.2		9.8 8.7		5 4		90 85				<0.2	1.4	
					Surface	1.0	0.4	38	28.7	28.7	8.1	8.1	15.7	15.7	87.7	87.8	6.2	6.1	8.7	ļ	4		84				<0.2	1.3	3
IM7	Sunny	Moderate	15:17	7.5	Middle	3.8	0.5 0.5	34 35	28.4 28.4	28.4	8.1 8.1	8.1	17.4	17.3	84.4 84.5	84.5	6.0	ŀ	9.1	9.1	4 5	4	88 88	8 8	321362	806811	<0.2	<0.2 4.9	
					Bottom	6.5	0.5	45 47	28.3	28.3	8.1 8.1	8.1	18.1	18.1	84.3 84.3	84.3	5.9 5.9	5.9	9.4 9.4	ļ	5		90				<0.2	5.1	1
					Surface	6.5 1.0	0.5 1.1	47 319	28.3	20.2	8.1	0.1	13.5	12.5	98.7	00.7	7.0		9.4 4.1		4		86				<0.2 <0.2	5.1 2.0	)
					Surface	1.0 4.0	1.1	342 356	29.2 28.2	29.2	8.1 8.0	8.1	13.5 20.9	13.5	98.6 79.1	98.7	7.0 5.5	6.3	4.1 3.1	ļ	5 4		85 89				<0.2 <0.2	2.0	
IM8	Fine	Moderate	15:26	7.9	Middle	4.0	1.0	348	28.3	28.3	8.0	8.0	20.7	20.8	79.2	79.2	5.5		3.1	3.8	4	4	90	9 8	321837	808155	<0.2	<0.2	7
					Bottom	6.9 6.9	0.5 0.5	317 308	27.5 27.5	27.5	8.0	8.0	25.1 25.1	25.1	68.0 68.4	68.2	4.7	4.7	4.4 4.1	F	5 4		93 93				<0.2	1.7	
DA: Denth-Aver			1		1	0.5	0.0	300	21.0		0.0	<u> </u>	ZU.		00.4		4.7		4.1		4		33				<u> </u> ~∪.∠		

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 10 August 19 during

10 August 19 during Mid-Flood Tide

Water Qua	ity Monit	oring Resu	ılts on		10 August 19	during Mid	-Flood Tid	de																			
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	th (m)	Current Speed	Current	Water Te	emperature (°C)		pН	Salir	nity (ppt)		aturation (%)	Dissolve Oxygen	Turb	dity(NTU	Suspende (mg	d Solids /L)	Total Alkalinit (ppm)	Coordinate HK Grid	Coordinate HK Grid	Chron (µg/		Nickel (µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)		Value	Average	Value	Averag		Average	Value	Average	Value D				DA	Value DA	(Northing)	(Easting)	Value		Value DA
					Surface	1.0	1.1	301 298	29.2 29.2	29.2	8.1	8.1	13.7	13.7	99.1 99.0	99.1	7.1	4.2		4		86 85			<0.2		1.8
IM9	Fine	Moderate	15:32	7.3	Middle	3.7 3.7	1.0	312 316	28.9 28.8	28.9	8.1 8.1	8.1	16.2 16.2	16.2	87.1 86.7	86.9	6.1	3.5		. 5 4	5	89 90 89	822086	808799	<0.2	.0.2	1.7 1.6
					Bottom	6.3	0.3	294	27.6	27.6	8.0	8.0	24.9	25.0	69.8	70.2	4.8 4	8 3.6		6		93			<0.2		1.8
					0	6.3 1.0	0.3	275 280	27.6 29.2	20.0	8.0 8.1	0.4	25.0 13.6	40.0	70.5 99.5	00.5	4.8 7.1	3.7		5		93 85			<0.2		1.8
					Surface	1.0	0.2	275 289	29.2 28.9	29.2	8.1 8.1	8.1	13.6 16.3	13.6	99.4 89.6	99.5	7.1 6.3	.7 4.2	_	6		85			<0.2		1.4
IM10	Fine	Moderate	15:39	7.5	Middle	3.8	0.5	276	29.0	29.0	8.1	8.1	16.1	16.2	89.9	89.8	6.3	3.6	3.6	3	4	89	822380	809774	<0.2	<0.2	1.7
					Bottom	6.5 6.5	0.2	263 271	27.9 27.8	27.9	8.0	8.0	20.9	21.1	71.5 71.6	71.6	5.0 4.9	.0 3.0		3 4		93 93			<0.2		1.7
					Surface	1.0	0.9	262 266	29.1 29.1	29.1	8.2 8.2	8.2	14.7	14.7	98.3 98.1	98.2	7.0	4.0		5 4		85 85			<0.2		1.7
IM11	Fine	Moderate	15:49	8.3	Middle	4.2	0.8	248	28.4	28.4	8.1	8.1	20.3	20.1	81.9	82.1	5.7	3.3		5	5	89 89	822076	811451	<0.2	-0.2	1.5
					Bottom	4.2 7.3	0.9	265 243	28.4 27.6	27.6	8.1 8.1	8.1	20.0	24.4	82.2 68.2	68.3	5.7 4.7 4	3.3		5 4		90			<0.2	L	1.6
					Bottom	7.3 1.0	0.4	249 222	27.6 29.2		8.1 8.2		24.4 15.6		68.4 100.7		4.7 <sup>4</sup> 7.1	3.7		3		93 85			<0.2		1.5
					Surface	1.0	0.9	246	29.2	29.2	8.2	8.2	15.6	15.6	100.5	100.6	7.1	5 3.7		4		86			<0.2		1.6
IM12	Fine	Moderate	15:55	7.8	Middle	3.9	0.5 0.5	236 238	28.5 28.5	28.5	8.1 8.1	8.1	19.1	19.0	84.0 84.1	84.1	5.9 5.9	5.6		4	4	90 90	821456	812049	<0.2		1.7
					Bottom	6.8 6.8	0.3	229 227	27.6 27.6	27.6	8.0	8.0	23.8	23.8	65.8 65.8	65.8	4.5 4.5	.5 13.		5		93 94			<0.2		1.4
					Surface	1.0	-	-	29.1	29.1	8.2	8.2	17.1	17.1	99.4	99.3	7.0	4.2		6		-			-	一	-
SR1A	Fine	Moderate	16:14	5.6	Middle	1.0 2.8	-		29.0	-	8.2		17.1		99.1		6.9	.0 4.1	4.1	- 6	6	-	819972	812662	-	H	-
SKIA	rine	Moderate	10.14	5.6	ivildale	2.8 4.6	-	-	28.2	-	8.1	-	20.9		79.7	-	- 5.5 <sub>-</sub>	- 4.2		5	6	- '	019972	012002	-	. F	
					Bottom	4.6	-	-	28.1	28.2	8.1	8.1	21.0	20.9	79.9	79.8	5.6	4.2		6							-
					Surface	1.0	0.4	278 280	29.1 29.1	29.1	8.2 8.2	8.2	17.0 16.9	17.0	102.3 102.5	102.4	7.2 7.2 7	4.2		5 6		86 85			<0.2		1.5
SR2	Fine	Moderate	16:26	5.0	Middle	-	-	-	-	-	-	-	-	-	-	-	- '	-	4.1	-	5	- 87	821482	814181	-	<0.2	1.6
					Bottom	4.0 4.0	0.2	260 241	28.2 28.2	28.2	8.1 8.1	8.1	20.7	20.7	80.7 80.9	80.8	5.6 5.6	6 4.0		4 5		89 89			<0.2		1.6
					Surface	1.0	0.2	22	29.2	29.2	8.2	8.2	13.5	13.5	99.4	99.4	7.1	4.1		4		-			-	-	-
SR3	Fig.	Madagas	45.04	0.0	Middle	1.0 4.4	0.2	21 18	29.2 28.7	28.7	8.2 8.1		13.5 18.7	18.7	99.4 84.0	84.0	7.1 5.9	.5 4.1		4	4	-	822155	807573	-	-	-
SKS	Fine	Moderate	15:21	8.8		4.4 7.8	0.5 0.2	19 25	28.6 27.5		8.1 8.0	8.1	18.7 25.4		83.9 67.3		5.9 4.6	3.2		3	4	- '	022155	00/5/3	-	· F	-
					Bottom	7.8	0.2	27	27.5	27.5	8.0	8.0	25.5	25.4	67.5	67.4	4.6	6.4		4		-			-		-
					Surface	1.0	0.7	262 285	29.6 29.6	29.6	8.3 8.3	8.3	18.4	18.4	113.3	113.1	7.8 7.8	8.1		4		-			-	E	-
SR4A	Fine	Moderate	16:48	8.0	Middle	4.0	0.8	268 274	28.1 28.1	28.1	8.1 8.1	8.1	21.2	21.2	83.2 83.2	83.2	5.8 5.8	9.6		5	5	-	817198	807828	-		- '
					Bottom	7.0	0.4	249	27.8	27.8	8.1	8.1	23.9	23.8	85.6	85.7	5.9	q 10.	3	6		-			-	F	-
					Surface	7.0 1.0	0.4	249 290	27.8 29.5	29.5	8.1 8.3	8.3	23.8 18.4	18.4	85.8 116.6	116.5	5.9 8.0	10.		5 4		-			-		-
	_					1.0	0.4	294	29.5	25.5	8.3	0.0	18.4	10.4	116.4	110.5	8.0	.0 7.9	$\neg$	5	_	-			-	-	-
SR5A	Fine	Calm	17:08	4.8	Middle	3.8	0.4	307	28.4	-	8.1	-	20.5	-	95.1	-	6.6	9.0	8.5	- 4	5		816582	810703	-	-	= ' '
					Bottom	3.8	0.4	316	28.4	28.4	8.1	8.1	20.5	20.5	95.5	95.3	6.6	9.0		6		-			-		-
					Surface	1.0	0.1	297 322	29.4 29.4	29.4	8.3	8.3	18.4	18.4	107.5	107.3	7.4 7	8.4		5 6		-			-	-	-
SR6A	Fine	Calm	17:51	3.9	Middle	-	-	-	-	-	-		-	-	-	-	- '	" 📑	8.8	-	5		817976	814732	-		
					Bottom	2.9	0.1	299	28.4	28.4	8.1	8.1	20.4	20.4	99.9	100.1	6.9 7	.0 9.2		4		-			-	F	
					Surface	2.9 1.0	0.1	303 268	28.4	28.9	8.1 8.3	8.3	20.4 18.5	18.5	100.3	107.4	7.0	9.2		5 6		-			-	-	-
						1.0 7.2	0.4	271 201	28.9 28.7		8.3 8.3		18.5 19.3		107.4 101.8		7.5 7.1	.3 3.0		5 6	_	-			-	F	-
SR7	Fine	Moderate	17:16	14.4	Middle	7.2	0.2	200	28.7	28.7	8.3	8.3	19.3	19.3	101.5	101.7	7.1	3.0	3.	7	6		823658	823742	-	·	-
					Bottom	13.4	0.2	234 225	28.5	28.6	8.3	8.3	20.0	20.1	98.5 98.1	98.3	6.8 6.8	.8		5				<u> </u>			-
					Surface	1.0	-	-	28.7 28.7	28.7	8.2	8.2	17.8 17.8	17.8	93.6 93.4	93.5	6.6	4.0		4		-			-	F	
SR8	Fine	Moderate	16:05	4.4	Middle	-	-	-	-	-	-	-	i -	-	-	-	- 6	٠.	4.1	-	4		820381	811621	-	-	⊒ . '
					Bottom	3.4	-	-	28.1	28.1	8.1	8.1	21.4	21.4	78.4	78.5	5.4	5 4.3		4					-	L	
					Dollom	3.4	-	-	28.1	20.1	8.1	0.1	21.4	21.7	78.5	70.0	5.5	4.2		2		-	1		1 - 7		-

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher

Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on

Station   Condition   Condition   Time   Depth (m)   Depth (m)   Speed   Current   C	Vater Temperature (°C)  Value Average 30.3 30.3 30.3 30.3 28.6 28.6 28.5 27.9 27.9 27.9 29.7 29.7 29.7 29.7 28.8 28.8 28.8 27.8 27.8 27.8 27.8	Value A 8.0 8.0 7.9 7.9 7.9 7.9 7.8 7.8 7.8 7.8 7.8		7 15.7 6 24.6 7 30.4 4 16.4	96.4 96.1 67.1 66.9 58.8 59.3	) (verage Val 96.3 6. 67.0 4. 59.1 3. 59.1 5.	5.6	Turbidity(I Value 3.7 3.6 9.3 9.3 10.8 10.9	VIO)	Suspended (mg/L) Value  3 4 4 5 5		Fotal Alkalinit (ppm)  Value DA  83  83  87  87  91	Coordinate HK Grid (Northing)	Coordinate HK Grid (Easting)	Chromiur (µg/L)  Value D  <0.2  <0.2  <0.2  <0.2  <0.2	Nickel (µg  Nickel (µg  Nickel (µg  Nickel (µg  Nickel (µg  Nickel (µg  Nickel (µg  Nickel (µg
Condition   Condition   Time   Depth (m)   Surface   1.0   0.2   236	30.3 30.3 30.3 30.3 28.6 28.5 27.9 27.9 29.7 29.7 29.7 29.7 29.7 29.7	8.0 8.0 7.9 7.9 7.9 7.9 7.8 7.8 7.8	8.0 15. 15. 7.9 24. 24. 7.9 30. 30. 7.8 16. 16.	7 15.7 6 24.6 7 30.4 4 16.4	96.4 96.1 67.1 66.9 58.8 59.3	96.3 6. 67.0 4. 59.1 3. 59.1 3.	5.6	3.7 3.6 9.3 9.3 10.8 10.9		3 4 4 4 5		83 83 87 87 87	(Northing)	(Easting)	<0.2 <0.2 <0.2	1.4
C1 Cloudy Rough 11:24 7.8 Middle 3.9 0.1 44 2  Middle 3.9 0.1 44 2  Bottom 6.8 0.1 65 2  Surface 1.0 0.4 160 2  Surface 1.0 0.4 170 2	30.3 30.3 28.6 28.6 28.6 27.9 27.9 27.9 29.7 29.7 29.7 29.7 28.8 28.7 27.8 27.8 27.8 27.8 27.8	8.0 7.9 7.9 7.9 7.9 7.8 7.8 7.8	8.0 15. 7.9 24. 7.9 30. 30. 7.8 16.	15.7 6 24.6 7 30.4 4 16.4	96.1 67.1 66.9 58.8 59.3 83.0	96.3 6.4 67.0 4.5 59.1 3.5	5.6	3.6 9.3 9.3 10.8 10.9	7.9	4 4 4 4 5	4	83 87 87 91	815613	804255	<0.2	1.4
C1 Cloudy Rough 11:24 7.8 Middle 3.9 0.1 44 2  Bottom 6.8 0.2 67 2  Surface 1.0 0.4 170 2	28.6 28.5 27.9 27.9 27.9 29.7 29.7 29.7 28.8 28.8 28.8 27.8 27.8 27.8 27.8	7.9 7.9 7.9 7.9 7.8 7.8 7.8 7.8	7.9 24. 7.9 30. 30. 30. 7.8 16. 16.	6 24.6 5 30.4 4 16.4	67.1 66.9 58.8 59.3 83.0	67.0 4.5 4.5 59.1 3.5 3.5	3.9	9.3 9.3 10.8 10.9	7.9	4 5	4	87 87 91	815613	804255	<0.2	1.1
Bottom 6.8 0.1 65 2 6.8 0.2 67 2 1.0 0.4 160 2 Surface 1.0 0.4 170 2	27.9 27.9 27.9 29.7 29.7 29.7 28.8 28.8 27.8 27.8 27.8 27.8 27.8 27	7.9 7.9 7.8 7.8 7.8 7.8	7.9 30. 30. 7.8 16. 16.	5 4 30.4	58.8 59.3 83.0	59.1 3.5	3.9	10.8 10.9		5		91			<0.2	1.0
Surface 1.0 0.4 160 2 1.0 0.4 170 2	29.7 29.7 28.8 28.7 27.8 27.8 27.8 27.8	7.8 7.8 7.8 7.8	7.8 16.	4 16.4	83.0	E .						92			<0.2	1.0
	28.8 28.7 27.8 27.8 27.8 27.8	7.8 7.8	20			82.9		5.1		4 3		85 85			<0.2	1.8
	27.8 27.8 27.8			9 20.9	82.8 71.0	70.8 4.5	5.4	6.4	6.7	4	4	87 88	825681	806951	<0.2	2.8
Daws 10.1 0.4 154 2	27.8		7.8 29	5 20.5	70.5 55.5	55.6		6.7 8.4		4		90			<0.2	2.7
Surface 1.0 0.3 257 2		7.8 7.9	7 9 19	6 19.6	93.6	3. 03.6 6.		8.4 2.7		4		90 85			<0.2 <0.2	2.3 1.0
1.0 0.3 269 2	29.8 29.4 29.4	7.9 7.9	7.8 21	ь	93.5	79.0		2.8 3.9	4.9	3	3	86 88 88	822101	817822	<0.2	0.9
6.0 0.3 250 2	29.4	7.8 7.8	21.	2	78.5	5.		4.1 8.1	4.9	3	° F	89 90	822101	01/022	<0.2	2.8 1.7
Bottom 10.9 0.3 144 2	28.0	7.8 8.0	7.8 28.	5 28.5	63.1	4.:	4.2	8.1 4.1		3		89 83	1		<0.2	2.0 0.6
Surface 1.0 0.6 250 3	30.3	8.0	8.0 15		95.5	95.7		4.1	F	4		84			<0.2	0.6
IM1 Cloudy Moderate 10:54 5.4 Middle	28.8	-	23.		68.1	- 4.0	1	7.2	5.6	3	3	92 88	817959	807154	<0.2	0.2
Bottom 4.4 0.3 247 2	28.9	7.9	7.9 23.	6 23.6	68.4	68.3	4.6	7.2		2		93			<0.2	1.1
Surrace 1.0 0.6 216 3	30.1 30.1	8.0	8.0 16.	16.4	91.9	92.0 6.	5.3	4.5 4.5		4		83 84			<0.2	1.0 0.8
INI2 Cloudy Moderate 10:49 7.3 Milddle 3.7 0.4 190 2	28.5 28.5 28.5	7.9 7.9	7.9 25	3 25.3	62.2	62.1 4.:		8.3 8.3	7.8	5	4	88 88	818163	806165	<0.2	0.2 1.0 1
Bottom 6.3 0.3 110 2	27.8 27.9	7.9 7.9	7.9 29		57.0 57.3	57.2		10.7 10.7		5	-	92 92			<0.2	1.4
	30.0 30.0	8.0	8.0		89.0 89.0	89.0 6.		4.8	-	3		83			<0.2	1.4
	28.3 28.3	7.9 7.9	7.9 26		63.4 63.6	63.5 4.3		8.3 8.3	7.9	2	4	88 88	818781	805595	<0.2	0.2 1.5 1.2
Bottom 6.2 0.2 106 2	28.2 28.1 28.2	7.9 7.9	7.9 24	7 24.0	50.0	59.9 4.	4.1	10.5 10.6		4 5		91 92			<0.2	1.5
Surface 1.0 0.2 211 3	30.2 30.2 30.2	8.0	8.0 15.	8 15.8	00.4	91.9 6.		3.7	L	3 <2		84 84			<0.2	1.6
IM Cloudy Moderate 10:37 7.7 Middle 3.9 0.1 184 2	29.4 29.4 29.4	7.9 7.9	7.9	3 10.2	78.7	78.8	5.9	5.0	6.3	2	3	88 88	819735	804616	<0.2	0.2 1.0 1
Bottom 6.7 0.3 115 2	28.7	7.9	7.0 22	6 22.6	67.8	67.0 4.1	16	10.3		3		91			<0.2	1.6
Surface 1.0 0.9 210 3	30.1	7.9 8.0	8.0 15.	1 15.1	92.5	92.5		10.3 3.8		<2 3		92 84	1		<0.2 <0.2	1.6
1.0 0.9 224 3 1.0 0.9 221 2	29.7	8.0	15. 0 16.	6 166	92.4 85.9	6.4 0E 0 6.4	6.2	3.8 4.2	7.4	4	3	84 87 88	820741	804864	<0.2	1.5
4.0 0.9 228 2	29.7 28.2 28.2	8.0 7.9	7.9	6	85.9	58.3		4.2 14.1	·	3	, F	92	020741	004004	<0.2	1.2
6.9 0.6 222 2	28.2	7.9 8.0	26	8	58.3	3.		14.0 4.5		3		92 83			<0.2	1.5
40 06 309 3	30.1 30.0 29.5 30.1	8.0 7.9	8.0 15.	Λ.	91.5	91.7		4.6 5.6	F	4 <2		83 88 oo			<0.2	1.7
IMB Cloudy Moderate 10:22 8.0 Middle 4.0 0.6 211 2	29.5	7.9	7.9 18.	0 16.0	78.6	76.9		5.7	6.9	3 <2	3	88 93	821041	805809	<0.2	1.5
Bollon 7.0 0.2 189 2	28.6 28.6 29.9	7.9	7.9 24	0 24.0	63.3	63.3	4.3	10.5		3		93			<0.2	1.5
Surface 1.0 0.5 236 2	29.9	8.0	8.0	1 16.1	91.5	91.6	5.0	4.4		2	-	84			<0.2	1.3
IM7 Cloudy Moderate 10:10 8.1 Middle 4.1 0.3 256 2	29.5 29.5	7.9 7.9	7.9	0 18.0	78.1	78.3 5.4		5.8 5.8	7.2	3	3	88 88	821335	806839	<0.2	1.4
Bottom 7.1 0.1 241 2	29.0 29.0	7.9 7.9	7.9 21	1 21.0	69.4	69.4 4.	4.8	11.3 11.3		3		92 93			<0.2	1.2
Surface 1.0 0.1 156 3	30.2 30.2	7.8	7.8	9 15.9	90.5	90.5	6.1	5.0 5.0	L	3		85 86			<0.2	1.4
	29.6 29.6	7.8 7.8	7.8		84.2 84.1	84.2 5.3	5	5.7 5.8	6.1	3	3	89 91	821815	808158	<0.2	0.2 1.5 1.4
	29.3 29.3	7.8 7.8	7.8 21.		72.6 72.7	72.7 4.5		7.5 7.5	F	2	F	90 90			<0.2	1.2

Water Qua	lity Monit	toring Resi	ults on		13 August 19	during Mid-	Ebb Tid	е																						
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	th (m)	Current Speed	Current	Water Te	mperature (°C)		pΗ	Salin	ity (ppt)		aturation (%)	Dissol Oxyg		Turbidity(N	NTU)	Suspende (mg/		Total A		Coordinate HK Grid	Coordinate HK Grid	Chrom (µg/		Nickel (µ	µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value		Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA		DA
					Surface	1.0	0.3	75 80	30.0	30.0	7.8	7.8	16.3 16.3	16.3	89.9 89.8	89.9	6.2		4.8	-	3		86 85				<0.2	-	1.3	
IM9	Cloudy	Moderate	10:58	6.6	Middle	3.3	0.3	70	29.6	29.6	7.8	7.8	16.5	16.5	85.3	85.3	5.9	6.1	6.3	6.4	4	4	87	88	822110	808797	<0.2	<0.2	1.4	1.5
					B. #	3.3 5.6	0.3	75 112	29.6 29.2	20.0	7.8 7.8		16.5 21.5		85.2 72.5		5.9 4.9		6.5 8.0	H	4		88 90	ł			<0.2	.	1.5 1.5	
					Bottom	5.6 1.0	0.3	120 94	29.2	29.2	7.8	7.8	21.4	21.4	72.7	72.6	5.0	5.0	8.0		4		90				<0.2		1.7	
					Surface	1.0	0.5 0.5	94	30.0 29.9	30.0	7.8	7.8	16.9 16.9	16.9	89.9 89.8	89.9	6.2		3.9	L	<2 3		86 85				<0.2	. t	2.3	
IM10	Cloudy	Moderate	11:05	7.7	Middle	3.9 3.9	0.5	96 99	29.7 29.6	29.7	7.8	7.8	17.2 17.2	17.2	84.6 84.4	84.5	5.9 5.8		4.1 4.2	5.5	3	3	89 88	88	822386	809795	<0.2	<0.2	2.0	2.2
					Bottom	6.7	0.4	109	29.1	29.1	7.8	7.8	22.6	22.6	70.3	70.4	4.8	18	8.6		2		90				<0.2		2.1	
					0	6.7 1.0	0.5	109 111	29.1 30.0		7.8		22.6 16.2		70.4 90.8		4.8 6.3		8.6 4.2	+	3		90 86				<0.2	_	2.2	-
					Surface	1.0 3.9	0.7 0.5	111 106	30.0 29.3	30.0	7.8 7.8	7.8	16.3 19.1	16.2	90.6 79.4	90.7	6.3 5.5		4.3 6.2	F	4		85 88				<0.2	. [	2.2	
IM11	Cloudy	Moderate	11:16	7.7	Middle	3.9	0.6	107	29.3	29.3	7.8	7.8	19.1	19.1	79.3	79.4	5.5		6.4	6.3	3	3	89	88	822047	811462	<0.2		2.0	2.0
					Bottom	6.7	0.3	135 142	28.7	28.7	7.8	7.8	25.1 25.1	25.1	68.1 68.4	68.3	4.6		8.4	-	3 <2		90	-			<0.2		1.6	
					Surface	1.0	0.6	108	29.9	29.9	7.8	7.8	16.6	16.6	91.1	91.0	6.3		5.2		5		86				<0.2	$\neg$	1.1	
IM12	Claudi	Moderate	11:22	8.8	Middle	1.0 4.4	0.6	110 96	29.9 29.4	29.4	7.8 7.8	7.8	16.6 19.3	19.3	90.9 78.6	78.7	6.3 5.4		5.3 8.0	7.7	5	_	86 89	88	821460	812058	<0.2	<0.2	1.6 1.6	1.7
IIVI12	Cloudy	woderate	11:22	0.0		4.4 7.8	0.4	104 120	29.4 29.2		7.8 7.8		19.3 23.1		78.7 70.3		5.4 4.7		8.0 9.8	" F	4 5	5	88 90	- 00	621400	612056	<0.2		1.6 2.1	1.7
					Bottom	7.8	0.1	120	29.2	29.2	7.8	7.8	23.1	23.1	70.5	70.4	4.8	4.8	9.7		4		90				<0.2		2.3	
					Surface	1.0	-		30.3	30.3	7.9	7.9	16.3 16.3	16.3	96.2 96.1	96.2	6.6		3.5	-	3		-	1			-	-	-	
SR1A	Cloudy	Moderate	11:35	5.0	Middle	2.5	-	-	-	-	-	-	-	-	-		-	6.6	-	4.4	-	3	-		819977	812658	-	[		-
					Bottom	2.5 4.0			29.6	29.6	7.9	7.9	19.4	19.4	83.5	83.6	5.7	5.7	5.3	L	- <2			i			-	ŀ	-	
						4.0 1.0	0.5	- 86	29.6 29.9		7.9 7.9		19.4 16.6		83.6 93.9		5.7 6.5		5.3 4.2		2		- 86				<0.2		1.5	_
					Surface	1.0	0.5	93	29.8	29.9	7.9	7.9	16.6	16.6	93.2	93.6	6.5		4.3	Ĺ	<2		87				<0.2	. [	1.6	
SR2	Cloudy	Moderate	11:44	4.5	Middle	-	-	-		-	-	-	-	-	-	-	-	-	-	4.3	-	2	-	88	821468	814152	-	<0.2	-	1.4
					Bottom	3.5 3.5	0.2	43 44	29.7 29.8	29.8	7.9 7.9	7.9	18.7 18.6	18.6	86.5 86.7	86.6	5.9 5.9	5.9	4.3	F	<2 <2		90 90				<0.2	Ī	1.1	
					Surface	1.0	0.1	196	29.9	29.9	7.8	7.8	15.8	15.8	89.0	89.0	6.2		4.6		2		-				-	二	-	
SR3	Claudi	Madazata	40:40	0.0	Middle	1.0 4.1	0.2	204 174	29.9 29.6		7.8 7.8		15.8 17.8	17.8	89.0 83.1	83.1	6.2 5.7	6.0	4.5 7.2	6.3	2	3	-		822135	807555	-	.	-	
SKS	Cloudy	Moderate	10:42	8.2	iviidale	4.1 7.2	0.2	184 187	29.5 29.1	29.6	7.8 7.8	7.8	17.8 22.3		83.0 71.0		5.7 4.8		7.2 7.2	6.3	3	3	-	-	022135	607555	-	[	-	-
					Bottom	7.2	0.2	190	29.1	29.1	7.8	7.8	22.3	22.3	71.0	71.0	4.8	4.0	7.2	-	4									
					Surface	1.0	0.1	340 357	30.1 30.1	30.1	8.1 8.1	8.1	15.9 15.9	15.9	97.9 97.7	97.8	6.8		5.1 5.1	F	5		-	+			-	}	-	
SR4A	Cloudy	Rough	11:57	9.8	Middle	4.9	0.2	241	28.5	28.5	7.9 7.9	7.9	25.0	24.9	58.0 58.2	58.1	3.9	5.4	13.9	12.3	5	5	-		817172	807786	-			-
					Bottom	4.9 8.8	0.2	250 244	28.5 28.0	28.0	7.9	7.9	24.9	29.2	54.6	54.9	3.6	3.7	14.0	L	4		÷					. [	-	
						8.8	0.2	246 337	28.0 30.8		7.9 8.1		29.2 16.4		55.2 104.3		3.7 7.1		17.9 3.3		6		-				-	$\rightarrow$	-	_
					Surface	1.0	0.1	310	30.8	30.8	8.1	8.1	16.4		104.6	104.5	7.1		3.4	Į	4		-	1			-	ļ		
SR5A	Cloudy	Moderate	12:13	5.2	Middle	-	-		-	-	-	-	-	-	-	-	-	-	-	4.5	-	3	-	-	816585	810709	-		-	-
					Bottom	4.2	0.2	98 104	30.9 30.9	30.9	8.1 8.1	8.1	16.6 16.6		105.3 105.2	105.3	7.2		5.7		2		-				-	. [	-	
					Surface	1.0	0.1	294	30.1	30.1	8.0	8.0	17.6	17.6	89.3	89.2	6.1		9.7		4		-				-		-	
0004	011		40.00		AP.18.	1.0	0.1	300	30.0		8.0		17.7		89.0		6.1	6.1	9.6	9.9	4		-	1	047040	04.4740	-	ŀ	-	
SR6A	Cloudy	Moderate	12:39	5.1	Middle	- 4.1	0.1	299	- 29.8	-	8.0		19.1	-	84.7		5.8		10.2	9.9	- 3	3	-		817942	814746	-		-	-
					Bottom	4.1	0.1	305	29.8	29.8	8.0	8.0	19.1	19.1	84.9	84.8	5.8	5.8	10.3		<2								$\equiv$	
					Surface	1.0	0.7	103 111	30.5 30.5	30.5	7.9	7.9	17.1 17.2	17.1	108.4 108.2	108.3	7.4		3.2	F	<2 2		-	1			-	F		1
SR7	Cloudy	Moderate	12:38	16.6	Middle	8.3	0.3	135	30.0	30.0	7.9	7.9	18.3	18.3	98.0	98.0	6.7		2.9	3.1	3	2	-	-	823625	823753	-		-	-
					Bottom	8.3 15.6	0.3 0.4	139 128	30.0 29.5	29.5	7.9 7.9	7.9	18.3 21.0	20.9	98.0 89.1	89.2	6.1		3.2	E	<2		-	1			-	[	-	
						15.6 1.0	0.4	134	29.5 29.9		7.9 7.8		20.9 16.6		89.3 91.5		6.1		3.3 4.9	<u> </u>	<2 <2		-					<del></del>	-	_
					Surface	1.0	-	-	29.9	29.9	7.8	7.8	16.6	16.6	91.4	91.5	6.3		5.1	ļ	2			1			-	,		
SR8	Cloudy	Moderate	11:29	5.2	Middle	-	-	-	-	-		-	-	-	-	-	-		-	5.6	-	2		-	820386	811605	-	-	-	-
					Bottom	4.2 4.2	-	-	29.6 29.6	29.6	7.8	7.8	19.5 19.5	19.5	79.1 79.2	79.2	5.4 5.4		6.4	F	3		-				-	, [		
L					1	4.2			23.0		1.0		13.5	<u> </u>	13.2		J.4		U.Z				_		1		لــــــــــــــــــــــــــــــــــــــ	_	لنــ	

### Expansion of Hong Kong International Airport into a Three-Runway System

Water Quality Monitoring

during Mid-Flood Tide Water Quality Monitoring Results on 13 August 19 Suspended Solids Weather Water Water Temperature (°C Salinity (ppt) Turbidity(NTU) Coordinate Nickel (µg/L) Sampling Coordinate Monitorina Current Oxygen (mg/L) Sampling Depth (m) HK Grid HK Grid Station Direction DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value DA Value DA Value DA Value DA (Easting) Value DA Value √alue Average 0.3 29.8 1.2 8.0 15.8 92.0 Surface 29.8 15.8 91.9 6.4 5.4 1.0 0.4 25 29.8 8.0 4 83 <0.2 1.4 8.7 1.5 3.8 0.3 69 29.8 8.0 16.1 89.2 6.2 4 88 <0.2 8.0 16.1 89.1 804243 C1 Cloudy Rough 04:41 7.5 Middle 29.8 88 815615 1.4 88.9 6.2 8.6 4 88 <0.2 3.8 71 29.8 8.0 16.1 0.3 6.5 0.2 72 27.8 7.9 10.4 4 91 <0.2 1.5 30.7 55.0 3.6 Bottom 27.8 7.9 30.7 55.2 3.7 55.3 3.7 7.9 30.7 10.4 3 1.4 6.5 0.2 27.8 92 < 0.2 0.4 5.4 2.4 Surface 29.9 7.9 16.3 85.5 1.0 29.9 85.4 5.9 84 <0.2 0.4 16.3 5.4 4 5.7 1.2 6.3 0.3 29.4 7.8 20.7 73.3 5.0 4 89 <0.2 C2 Cloudy Moderate 06:10 12.6 Middle 29.4 7.8 20.7 73.2 88 825689 806933 18 29.4 20.7 73.1 5.8 87 <0.2 1.6 6.3 0.3 3 8.7 5 4 1.7 11.6 0.4 27.9 7.8 29.3 3.8 90 <0.2 Bottom 28.0 7.8 29.3 57.2 3.8 11.6 0.4 28.0 7.8 57.3 8.7 2.0 1.0 0.2 30.0 7.9 16.6 95.4 3.1 85 <0.2 1.1 Surface 30.0 7.9 16.6 95.3 1.0 0.2 78 30.0 7.9 16.6 95.2 6.6 3.1 2 86 <0.2 1.2 2.7 1.1 252 275 <2 <2 88 89 6.2 0.5 28.1 7.8 27.0 65.0 4.4 <0.2 СЗ Cloudy Moderate 04:10 12.3 Middle 7.8 26.9 64.9 822113 817782 1.3 6.2 0.5 28.1 7.8 26.8 64.7 4.4 < 0.2 27.3 27.3 7.8 7.8 4.8 4.9 <2 2 11.3 0.1 275 30.4 51.2 51.4 3.4 91 90 <0.2 1.8 Rottom 7.8 30.4 51.3 3.4 11.3 0.1 276 < 0.2 0.3 211 30.1 5.4 5 84 <0.2 1.2 8.0 15.8 94.1 6.5 Surface 30.1 8.0 15.8 94.1 1.0 214 30.1 8.0 15.8 94.1 6.5 5.5 4 88 <0.2 1.2 0.3 6.5 . -807119 IM1 Cloudy Rough 05:10 5.2 Middle 817963 9.2 4.2 0.1 98 29.7 82.9 83.4 5.7 5.8 91 <0.2 1.3 Bottom 7.9 18.0 83.2 5.8 42 0.1 106 29.6 79 6 91 1.2 1.0 0.3 31 30.2 8.0 15.7 94.4 6.5 4.8 6 85 <0.2 1.1 Surface 15.7 94.4 1.0 0.3 32 30.2 8.0 15.7 94.3 6.5 4.8 5 86 <0.2 1.0 1.1 3.5 0.2 33 27.9 7.9 29.5 54.3 3.6 9.3 5 89 <0.2 IM2 Cloudy Rough 05:16 6.9 Middle 7.9 29.5 54.3 89 818147 806183 1.0 7.9 54.3 3.6 9.3 6 89 27.9 3.5 0.2 35 29.5 5.9 27.8 11.4 6 93 <0.2 1.0 0.3 65 7.9 29.9 54.2 3.6 7.9 54.2 Bottom 27.8 29.9 3.6 0.9 5.9 27.8 11.5 6 94 <0.2 0.3 68 0.3 30.0 8.0 6.4 3.5 6 85 <0.2 1.4 92.4 Surface 30.0 8.0 15.7 92.3 1.0 0.3 60 30.0 8.0 15.7 92.2 6.4 3.5 5 85 1.4 0.4 29.4 4.8 5 4 89 90 1.2 5.6 5.6 <0.2 <0.2 Middle 81.6 805612 IM3 Cloudy Rough 05:23 29.4 8.0 18.8 818767 1.3 3.4 0.4 52 29.4 8.0 18.8 81.6 4.9 5.8 0.2 55 28.7 7.9 22.9 71.0 4.8 5.7 4 93 < 0.2 Bottom 28.7 7.9 22.9 70.9 4.8 1.3 5.8 0.3 56 28.7 7.9 22.9 70.8 4.8 5.8 5 93 < 0.2 47 1.0 0.4 30.0 8.0 15.5 92.8 6.4 3.9 85 < 0.2 1.4 Surface 30.0 8.0 15.5 92.8 92.7 6.4 3.9 1.2 1.0 44 30.0 8.0 86 0.4 15.5 8 <0.2 1.3 5.6 5.7 3.8 29.1 29.1 7.9 7.9 4.7 5 6 88 88 <0.2 0.3 38 22.8 69.8 7.5 29 1 7.9 22.4 69.8 819740 804589 IM4 Cloudy Moderate 05:31 Middle 4.8 3.8 0.3 1.3 6.5 0.2 39 28.0 7.9 28.3 57.9 3.9 11.2 6 92 <0.2 Bottom 7.9 58.1 28.0 28.3 3.9 6.5 0.2 37 28.0 7.9 58.3 3.9 11.2 6 92 1.4 1.0 0.5 33 30.0 8.0 4.2 88 <0.2 1.3 6.5 Surface 30.0 8.0 15.4 92.9 1.0 0.5 33 29.9 8.0 15.3 92.6 6.5 4.2 5 89 <0.2 1.3 4.4 4.5 4.0 0.3 40 29.8 7.9 17.8 6 92 93 <0.2 1.2 85.2 85.4 Moderate 05:39 Middle 820736 804851 1.3 29.9 5.9 5 4.0 0.3 35 8.0 17.9 5 7.0 0.3 47 8.3 8.3 93 <0.2 13 28.8 7.9 18.6 74.9 5.2 Bottom 7.9 18.6 74.1 5.2 7.0 28.7 7.9 1.3 18.7 94 0.3 43 < 0.2 0.3 29.7 29.6 7.9 7.9 5.4 5.4 1.1 1.0 16.1 16.1 89.2 88.8 6.2 5 5 86 87 <0.2 Surface 29.7 7.9 16.1 89.0 1.0 7.4 4 1.1 3.9 0.2 24 29.2 7.9 19.3 75.5 5.2 88 <0.2 805817 05:47 7.9 19.3 75.5 821040 IM6 Cloudy Moderate 7.8 Middle 29.2 89 1.2 7.4 88 <0.2 1.2 0.2 29.2 5 0.2 28.6 7.9 24.6 65.4 65.6 4.4 10.6 93 <0.2 1.2 Bottom 28.6 7.9 24.6 65.5 4.4 6.8 0.2 51 28.6 7.9 24.6 4.4 10.6 6 0.4 < 0.2 1.3 0.4 30.0 1.3 Surface 8.0 15.9 92.9 1.0 0.4 13 30.0 8.0 15.9 92.8 6.4 4 89 <0.2 1.3 7.9 5.7 5.3 93 4.0 0.3 24 29.6 17.5 83.0 4 < 0.2 IM7 Cloudy Moderate 05:52 7.9 Middle 7.9 17.4 83.4 821338 806831

7.9

7.9

7.9

7.8

7.8

7.8

7.9

29.8

29.7

17.3

7.9

7.8

7.8

7.8

18.0

18.0

16.5

16.5

16.8

17.5

17.5

16.8

18.0

16.5

16.8

17.5

83.8

82.1

82.0

86.4

84.9

84.8

84.0

82.1

86.3

84.9

84.1

5.3

5.6

5.5

6.6

7.2

7.2

9.1

5.8

5.7

5.7

6.0

6.0

5.9

5.9

5.8

5.7

6.0

5.8

3 6

5

5

6

6

93

94

94

84

85

88

89

90

90

821829

1.2

1.0

1.6

1.7

1.3

14

1.4

<0.2

<0.2

< 0.2

<0.2

<0.2

<0.2

<0.2

≥0.2

808118

DA: Depth-Averaged

IM8

Cloudy

Moderate

Calm: Small or no wave: Moderate: Between calm and rough: Rough: White capped or rougher Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

05:43

7.4

4.0

6.9

6.9

3.7

3.7

6.4

6.4

Rottom

Surface

Middle

0.3

0.1

0.1

0.1

0.1

0.1

0.1

0.1

23

24

285

258

230

232

260

29.6

29.5

29.5

29.8

29.7

29.7

29.6

29.6

29.8

Water Qua	lity Monit	toring Resi	ults on		13 August 19	during Mid-	-Flood T	ide																						
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	oth (m)	Current Speed	Current	Water Te	mperature (°C)		pН	Salir	nity (ppt)		aturation (%)	Dissol Oxyg		Turbidity(I	NTU)	Suspende (mg/		Total A		Coordinate HK Grid	Coordinate HK Grid	Chron (µg		Nickel (µ	ıg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA ۱	Value	DA
					Surface	1.0	0.3	307 316	29.9 29.9	29.9	7.8	7.8	15.8 15.8	15.8	88.8 88.8	88.8	6.2	H	5.4 5.4	-	3		85 86	-			<0.2	-	1.9	
IM9	Cloudy	Moderate	05:37	7.6	Middle	3.8 3.8	0.3	295 304	29.7 29.7	29.7	7.8 7.8	7.8	16.5 16.6	16.5	83.6 83.6	83.6	5.8 5.8	6.0	7.1 7.1	6.6	6	5	89 88	88	822106	808788	<0.2		1.4	1.3
					Bottom	6.6	0.2	279	29.3	29.3	7.8	7.8	20.9	20.9	72.2	72.2	4.9	4.9	7.2		6		90				<0.2		1.2	
					Surface	6.6 1.0	0.2	280 285	29.3 29.8	29.8	7.8 7.9	7.9	21.0 16.5	16.5	72.2 89.5	89.5	4.9 6.2		7.2 4.8		5 7		90 86				<0.2		1.0	_
						1.0 3.9	0.5 0.5	289 304	29.8 29.7		7.9 7.8		16.5 17.9		89.4 83.7		6.2 5.8	6.0	4.9 5.0		7		86 87				<0.2	Г	1.4	
IM10	Cloudy	Moderate	05:28	7.8	Middle	3.9	0.5	291	29.7	29.7	7.8	7.8	17.9	17.9	83.7	83.7	5.8		5.2	6.3	6	7	88	88	822375	809805	<0.2	<0.2	1.3	1.3
					Bottom	6.8 6.8	0.3 0.4	283 275	29.3 29.4	29.4	7.8 7.8	7.8	20.9	20.9	73.6 73.7	73.7	5.0	5.0	9.0 8.9		7 8		89 90				<0.2		1.3	
					Surface	1.0	0.5	269 254	29.7 29.7	29.7	7.9	7.9	16.9 16.9	16.9	85.7 85.8	85.8	5.9 5.9		5.5	F	8		85 86				<0.2		1.4	
IM11	Cloudy	Moderate	05:15	8.0	Middle	4.0 4.0	0.3	271 263	29.6 29.6	29.6	7.9 7.9	7.9	18.8 18.8	18.8	85.0 84.9	85.0	5.8 5.8	5.9	4.2	4.8	8	7	89 90	88	822053	811480	<0.2	.02	1.4	1.3
					Bottom	7.0	0.2	240	29.0	29.0	7.8	7.8	23.2	23.3	71.9	71.8	4.9	4.9	4.8	þ	6		90				<0.2		1.2	
						7.0 1.0	0.2	242 237	29.0 29.9		7.8 7.9		23.3 17.1		71.7 91.2	91.2	4.9 6.3		4.9 4.7		5 6		90 85				<0.2		1.3	
					Surface	1.0 4.2	0.5	241 236	29.9 29.6	29.9	7.9 7.9	7.9	17.1 18.8		91.1 87.4		6.3	6.2	4.6 4.1	F	7		86 88				<0.2		1.2	
IM12	Cloudy	Moderate	05:07	8.3	Middle	4.2	0.3	242	29.6	29.6	7.9	7.9	18.8	18.8	87.3	87.4	6.0		4.2	5.1	7	7	89	88	821435	812061	<0.2	<0.2	1.5	1.3
					Bottom	7.3 7.3	0.2	258 262	28.9 28.9	28.9	7.9 7.9	7.9	23.6 23.6	23.6	73.1 73.3	73.2	5.0	5.0	6.6 6.7	-	6		90 90				<0.2		1.4	
					Surface	1.0	-	-	30.1 30.0	30.1	7.9	7.9	17.1 17.2	17.1	91.9 91.7	91.8	6.3		4.4	-	8		-					-	-	
SR1A	Cloudy	Moderate	04:49	4.9	Middle	2.5 2.5	-	-	-	-	-	-	-		-	-	-	6.3	-	4.7	-	8	-		819980	812658	-		-	-
					Bottom	3.9	-	-	29.6	29.6	7.9	7.9	19.5	19.5	78.8	78.7	5.4	5.4	5.0	þ	7		÷	1			-	Į.		
					Surface	3.9 1.0	0.3	252	29.6 29.8	29.8	7.9 7.9	7.9	19.5 18.2	18.2	78.5 92.5	92.5	5.4 6.4	-	5.0 4.2		7		86				<0.2	$\dashv$	1.7	-
						1.0	0.3	253	29.7	29.0	7.9	7.9	18.2	10.2	92.4	92.5	6.4	6.4	4.2	F	7		86				<0.2		1.4	
SR2	Cloudy	Moderate	04:36	4.3	Middle	-	-	-	-	-	-	-	-	-	-	-	-		-	4.3	-	6	-	87	821467	814172	-	<0.2	-	1.4
					Bottom	3.3	0.2	222 223	29.4 29.4	29.4	7.9	7.9	21.6	21.6	83.0 83.0	83.0	5.6 5.6	5.6	4.3 4.4	-	5 6		87 89				<0.2		1.0	
					Surface	1.0	0.2	15 15	29.9 29.9	29.9	7.8	7.8	15.8 15.9	15.9	87.3 87.2	87.3	6.1	F	5.5 5.5	-	8 7		-					F	-	
SR3	Cloudy	Moderate	05:49	8.5	Middle	4.3 4.3	0.1	14 15	29.4 29.4	29.4	7.8 7.8	7.8	17.0 17.0	17.0	80.6 80.3	80.5	5.6 5.6	5.9	6.8	6.6	6	7			822166	807570	-		_	-
					Bottom	7.5	0.1	16	29.2	29.2	7.8	7.8	21.6	21.6	69.0	69.0	4.7	4.7	7.5	þ	7		÷				-	þ	=	
					Surface	7.5 1.0	0.1	18 238	29.2 29.9	29.9	7.8 8.0	8.0	21.6 15.7	15.7	69.0 89.8	89.4	4.7 6.2		7.5 3.8		6 9		<del>-</del>				-	=t	-	-
						1.0 4.8	0.4	239 216	29.9 29.1		8.0 7.9		15.7 21.4		88.9 68.0		6.2 4.7	5.4	3.8 5.6		9		-				-	F	-	
SR4A	Cloudy	Moderate	04:09	9.6	Middle	4.8 8.6	0.3	226 260	29.1 28.3	29.1	7.9 7.9	7.9	21.4 26.5	21.4	67.6 54.9	67.8	4.6 3.7		5.7 10.9	6.8	8	9	-	-	817200	807817	-	. [	-	-
					Bottom	8.6	0.1	282	28.3	28.3	7.9	7.9	26.5	26.5	54.9	54.9	3.7	3.7	10.9	-	8						-			
					Surface	1.0	0.2	241 245	30.4 30.4	30.4	8.1 8.1	8.1	16.7	16.7	97.4 97.4	97.4	6.7		5.9 5.9	-	10 10		-				-	ŀ	-	
SR5A	Cloudy	Moderate	03:50	4.8	Middle	-	-	-	-	-	-	-	-		-	-	-	6.7	-	5.6		10	-	-	816594	810706	-	- F	-	-
					Bottom	3.8	0.4	248	30.4	30.4	8.1	8.1	16.8	16.8	99.6	99.6	6.8	6.8	5.3	Į	9		-				-	F		
					Surface	3.8 1.0	0.4	225 231	30.4 30.0	30.0	8.1 8.0	8.0	16.8 16.6	16.6	99.6 96.4	96.4	6.8		5.3 3.8		10 6						-	=t	-	=
						1.0	0.2	233	30.0	30.0	8.0	0.0	16.6	10.0	96.3	30.4	6.6	6.6	3.8	}	7	_	-				-	ŀ	-	
SR6A	Cloudy	Moderate	03:16	4.6	Middle	3.6	0.2	- 245	29.9	-	7.9	-	17.9		- 87.8	-	6.0		7.4	5.6	- 9	8	-	-	817957	814757	-		_	-
					Bottom	3.6	0.2	241	29.9	29.9	7.9	7.9	17.9	17.9	87.9	87.9	6.0	6.0	7.4	-	10								⇉	
					Surface	1.0	0.1	97 103	28.9 28.9	28.9	7.9 7.9	7.9	23.6	23.6	81.2 81.2	81.2	5.5 5.5	<u> </u>	2.7	F	6		-					F	-	
SR7	Cloudy	Moderate	03:38	16.4	Middle	8.2 8.2	0.1 0.1	242 246	28.0 28.0	28.0	7.9 7.9	7.9	27.5 27.5	27.5	73.2 73.2	73.2	4.9 4.9	5.2	3.6 3.6	3.6	6 5	6	-	-	823654	823736	-	- F	-	-
					Bottom	15.4	0.1	231	26.9	26.9	7.8	7.8	31.5	31.5	56.6	56.6	3.8	3.8	4.4	Ė	6		-	1			-	ļ	-	
					Surface	15.4	0.1	220	26.9 29.9	29.9	7.8 7.9	7.9	31.5 17.1	17.1	56.6 89.0	89.0	3.8 6.1		4.5 6.4		8		-				-	=	$\pm$	$\dashv$
						1.0	-	-	29.9	23.3	7.9	1.9	17.1	17.1	88.9	0.60	6.1	6.1	6.4	F	7		-	1			-	F	-	
SR8	Cloudy	Moderate	04:59	5.0	Middle	4.0	-	-	- 20.7	-	- 70	-	- 10.7	-	- 02.4	-	-		-	7.5	- 9	8	-	ļ ·	820395	811646	-	-	-	-
					Bottom	4.0	-	-	29.7 29.7	29.7	7.9 7.9	7.9	18.7	18.7	83.4 83.4	83.4	5.7 5.7	5.7	8.6 8.6		8		-				-			

Water Qua	lity Monit	toring Res	ults on		15 August 19	during Mid-	Ebb Tid	е																					
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	oth (m)	Current Speed	Current	Water To	emperature (°C)		рН	Salir	ity (ppt)		aturation %)	Disso Oxyg		Turbidity(	NTU)	Suspende (mg	ed Solids (L)	Total All (ppr		Coordinate HK Grid	Coordinate HK Grid	Chromiun (µg/L)	n Nickel	l (µg/L)
Station	Condition	Condition	Time	Depth (m)	Sampling De	an (m)	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value D	A Value	DA
					Surface	1.0	0.2	233 251	29.2	29.2	8.1	8.1	21.9	21.9	76.2 76.3	76.3	5.2		6.8		6		85 86				<0.2	1.3	-
C1	Cloudy	Moderate	12:12	8.1	Middle	4.1 4.1	0.1	54 59	29.1 29.1	29.1	8.1 8.1	8.1	22.2	22.2	75.4 75.2	75.3	5.1 5.1	5.2	8.6 8.9	8.6	7	6	88 89	88	815624	804248	-O 2	0.2 1.3	1.3
					Bottom	7.1	0.0	69	29.1	29.1	8.2	8.2	22.2	22.2	75.5 75.5	75.5	5.1	5.1	9.9		6	! '	90	í			<0.2	1.3	
					Surface	1.0	0.6	75 136	29.1 30.0	30.0	8.0	8.0	17.1	17.1	78.7	78.7	5.4		4.6		5		87				<0.2	1.1	
C2	Cloudy	Moderate	11:37	10.6	Middle	1.0 5.3	0.6	144 150	30.0 29.7	29.7	8.0	8.0	17.1 19.1	19.1	78.7 71.2	71.1	5.4 4.9	5.2	4.6 4.7	6.2	5 4	5	87 89	89	825665	806959	<0.2	1.1	1.1
	,				Bottom	5.3 9.6	0.5 0.5	164 146	29.7 29.1	29.1	8.0	8.0	19.1 22.4	22.4	71.0 61.2	61.1	4.9	4.2	4.7 8.9		4 6	1	89 91				<0.2	1.2	
						9.6	0.6	149 83	29.1		8.0	<u> </u>	22.4		60.9 76.3		4.1 5.2	4.2	9.7 4.1		6 7		91 86				<0.2	0.9	$\vdash$
					Surface	1.0 6.3	0.3	91 27	29.2	29.2	8.2 8.3	8.2	21.9 22.3	21.9	76.2 69.4	76.3	5.2 4.7	5.0	4.1 4.5		6	{ '	86 88				<0.2	1.2	
C3	Cloudy	Moderate	13:17	12.5	Middle	6.3 11.5	0.2	29	29.0 27.9	29.0	8.3	8.3	22.3	22.3	69.1	69.3	4.7		4.7 8.4	5.7	4	6	89 90	88	822121	817780	<0.2 <0.2	1.0	1.2
					Bottom	11.5	0.2	21 22	28.0	27.9	8.3	8.3	26.6 26.5	26.6	68.1 68.7	68.4	4.6	4.6	8.2		5		90				<0.2	1.2	
					Surface	1.0	0.5 0.6	221 238	30.1 30.1	30.1	8.0	8.0	18.1 18.1	18.1	88.8 89.1	89.0	6.1 6.1	6.1	4.2 4.2		4	1	85 85				<0.2	1.0	1
IM1	Cloudy	Moderate	12:06	5.6	Middle	-	-	-	-	-	-	-	-	-	-	-	-	•	-	5.3	-	3	-	87	817934	807147	-	0.2	1.1
					Bottom	4.6 4.6	0.3	230 248	30.0	30.0	8.0	8.0	18.2 18.2	18.2	89.0 88.9	89.0	6.1	6.1	6.4		2		88 89				<0.2	1.1	4
					Surface	1.0	0.5 0.6	210 226	29.8 29.8	29.8	8.0	8.0	17.9 17.9	17.9	82.3 81.7	82.0	5.7 5.6		4.4 4.7		3	,	85 85				<0.2	1.4	
IM2	Cloudy	Moderate	11:59	7.6	Middle	3.8 3.8	0.4	199 215	29.7 29.7	29.7	8.0	8.0	18.6 18.6	18.6	79.5 79.4	79.5	5.5 5.5	5.6	9.6 9.6	7.4	5 4	4	88 88	88	818153	806179	<0.2	0.2 1.3	1.3
					Bottom	6.6 6.6	0.3	101 110	29.6 29.6	29.6	8.0	8.0	19.1	19.1	79.6 79.9	79.8	5.5	5.5	8.1 8.1		5	[	89 90				<0.2	1.3	1
					Surface	1.0	0.3	200 214	29.8 29.8	29.8	8.1 8.1	8.1	17.4	17.4	84.3 83.4	83.9	5.8		3.2		6	$\Box$	85 86				<0.2	1.5	
IM3	Cloudy	Moderate	11:49	7.2	Middle	3.6	0.3	167	29.7	29.7	8.1	8.1	18.6	18.6	80.7	80.6	5.5	5.7	4.1	4.9	5	- 5	88	88	818779	805585	<0.2	1.3	
					Bottom	3.6 6.2	0.3	170 108	29.7 29.6	29.6	8.1	8.1	18.7	19.1	80.4 82.1	82.6	5.5	5.7	4.5 6.8		5 4	ļ '	89 90				<0.2	1.2	
					Surface	6.2 1.0	0.2	110 210	29.7 30.1	30.1	8.1		19.1 17.8	17.8	83.0 80.6	80.5	5.7		7.2 3.6		5 6	$\vdash$	90 85				<0.2 <0.2	1.4	$\vdash$
IM4	Cloudy	Moderate	11:48	7.4	Middle	1.0 3.7	0.2	219 188	30.1 29.5	29.5	8.0	8.0	17.8 19.8	19.8	80.4 74.6	74.6	5.5 5.1	5.3	3.7 6.2	6.4	7 6	6	86 88	88	819732	804616	<0.2	1.5	
livi	Cioudy	woderate	11.40	7.4	Bottom	3.7 6.4	0.1	205 111	29.5 29.5		8.0	<b>-</b>	19.8 20.0		74.6 77.3	77.4	5.1 5.3		6.2 9.3	0.4	7		89 90	. 00	019732	004010	<0.2	1.3	1.3
						6.4	0.3	120 217	29.5 29.8	29.5	8.0	8.0	20.0 19.3	20.0	77.5 77.0		5.3 5.3	5.3	9.2 4.3		5 3	<u> </u>	90 85				<0.2	1.2	
					Surface	1.0 3.4	1.0	236 225	29.8 29.7	29.8	8.0	8.0	19.3 19.4	19.3	77.0 75.5	77.0	5.3 5.2	5.2	4.3 8.5		4	{ '	86 88				<0.2	1.4	1
IM5	Cloudy	Moderate	11:39	6.7	Middle	3.4 5.7	0.9	237	29.6 29.5	29.7	8.0	8.0	19.4	19.4	75.1 75.4	75.3	5.1 5.2		8.5 11.7	8.2	5	5	88 89	88	820721	804845	<0.2 <0.2	1.4	1.4
					Bottom	5.7	0.6	201	29.5	29.5	8.0	8.0	19.9	19.9	75.7 79.5	75.6	5.2	5.2	11.9		6	<u> </u>	90				<0.2	1.3	
					Surface	1.0	0.5	200	29.8	29.8	8.0	8.0	18.7	18.7	79.5	79.5	5.4	5.4	4.2		6	ļ '	85				<0.2	1.5	1
IM6	Cloudy	Moderate	11:31	7.1	Middle	3.6 3.6	0.6 0.6	200 213	29.8 29.8	29.8	8.0	8.0	18.9 18.9	18.9	78.4 78.7	78.6	5.4 5.4		6.4 6.1	6.3	4 5	5	88 88	87	821036	805810	<0.2	0.2 1.6	1.5
					Bottom	6.1 6.1	0.2	177 187	29.7 29.7	29.7	8.0	0.0	19.0 19.0	19.0	79.2 79.2	79.2	5.4 5.4	5.4	8.4 8.4		4 5		89 90				<0.2	1.4	
					Surface	1.0	0.4 0.5	226 230	29.8 29.8	29.8	8.0	8.0	18.6 18.6	18.6	78.6 78.2	78.4	5.4 5.4	- 2	4.7 4.9		6 7	1 <sup>¬</sup>	85 85				<0.2	1.3	
IM7	Cloudy	Moderate	11:24	7.6	Middle	3.8	0.3 0.4	250 273	29.6 29.6	29.6	7.9 7.9	7.9	19.2 19.2	19.2	74.3 74.2	74.3	5.1 5.1	5.3	6.5 6.6	7.2	7	6	88 89	88	821346	806844	<0.2	0.2 1.3	1.3
					Bottom	6.6	0.1	239 246	29.4	29.4	7.9	7.9	20.8	20.8	74.8 75.0	74.9	5.1	5.1	10.3		5	<b>[</b>	89 90				<0.2	1.2	
					Surface	1.0	0.0	162 164	29.8 29.8	29.8	8.0 8.0	8.0	18.7 18.6	18.7	80.1 79.6	79.9	5.5 5.5		2.1		2		85 86				<0.2	1.0	
IM8	Cloudy	Moderate	11:59	8.3	Middle	4.2	0.1	171	29.7	29.7	8.0	8.0	18.9	18.9	78.2	78.1	5.4	5.4	4.4	5.5	3	3	88	88	821808	808160	<0.2	1.1	1.0
					Bottom	7.3	0.1	186 156	29.7 29.5	29.5	7.9	7.0	18.9 20.0	20.0	78.0 75.5	75.6	5.3	5.2	4.5 9.7		4	ļ '	88 89				<0.2	1.0	1
						7.3	0.1	167	29.5		7.9		20.0		75.7		5.2		9.9		5		90			1	<0.2	1.0	

15 August 19 during Mid-Fbb Tide

Water Qua	lity Monit	toring Resu	ults on		15 August 19	during Mid-Ebb	Tide																						
Monitoring	Weather	Sea	Sampling	Water	Sampling Dept	Curr Spe	ed Current	Water Te	mperature (°C)		рН	Salin	ity (ppt)		aturation (%)	Disso Oxy		Turbidity(I	NTU) Su	spended mg/l	d Solids L)		Jkalinity om)	Coordinate HK Grid	Coordinate HK Grid	Chron (µg		Nickel (	μg/L)
Station	Condition	Condition	Time	Depth (m)	Gampling Dept	(m/	·	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA \	alue	DA	Value	DA	(Northing)	(Easting)	Value	DA	Value	DA
					Surface	1.0 0. 1.0 0.		29.8 29.8	29.8	8.0	8.0	19.3 19.3	19.3	77.5 77.2	77.4	5.3		3.2		6	-	85 85				<0.2	-	1.1	
IM9	Cloudy	Moderate	12:05	8.2	Middle	4.1 0. 4.1 0.		29.5 29.5	29.5	8.0	8.0	19.9 19.9	19.9	74.9 75.0	75.0	5.1 5.1	5.2	5.2 5.2	4.9	7	7	88 88	87	822089	808827	<0.2		0.9 1.0	1.0
					Bottom	7.2 0 7.2 0		29.5 29.5	29.5	8.0	8.0	20.2	20.1	79.3 79.9	79.6	5.4	5.5	6.3 6.2		6 8	Ī	89 89				<0.2		1.0	
					Surface	1.0 0.1 1.0 0.1	123	30.1 30.1	30.1	8.0	8.0	17.8 17.8	17.8	83.4 83.5	83.5	5.7		3.8		5 4		86 87				<0.2		1.0	
IM10	Cloudy	Moderate	12:12	8.1	Middle	4.1 0. 4.1 0.	128	29.5	29.5	8.0	8.0	20.0	20.0	74.3 74.3	74.3	5.1	5.4	6.9 6.9	6.1	6	6	89 89	89	822388	809816	<0.2	-0.2	1.1	1.0
					Bottom	7.1 0.1 7.1 0.1	124	29.5 29.5	29.5	8.0	8.0	20.1	20.1	75.3 75.5	75.4	5.1	5.2	7.7		7	ļ	91				<0.2		1.0	
					Surface	1.0 0.	7 128	29.8	29.8	8.2	8.2	17.5	17.5	83.8	83.6	5.8		4.2		7		86				<0.2		0.9	=
IM11	Cloudy	Moderate	12:22	9.3	Middle	1.0 0. 4.7 0.	7 132	29.8 29.7	29.7	8.2 8.1	8.1	17.5 18.9	18.9	83.4 79.4	79.4	5.8 5.4	5.6	4.4 5.3	6.1	4	5	86 88	88	822070	811480	<0.2		1.0	1.0
	oloddy	Wodorato	12.22	0.0	Bottom	4.7 0.3 8.3 0.3	132	29.7 29.6	29.6	8.1 8.1	8.1	18.9 19.2	19.2	79.4 81.5	81.5	5.4 5.6	5.6	5.4 8.6		4	ľ	88 90	00	022070	011100	<0.2	L	1.0	
						8.3 0. 1.0 0.		29.6 29.8		8.1 8.0		19.2 18.0		81.5 81.6	81.4	5.6 5.6	3.0	8.6 5.4		4		90 85				<0.2		1.0	-
					Surface	1.0 0. 4.2 0.		29.8 29.6	29.8	8.0	8.0	18.0 18.9	18.0	81.2 76.5		5.6 5.3	5.4	5.3 17.6		4	_ [	85 89				<0.2		0.9	
IM12	Cloudy	Moderate	12:29	8.4	Middle	4.2 0. 7.4 0.	152	29.6 29.4	29.6	8.0	8.0	18.9 20.0		76.1 75.0	76.3	5.2 5.1		17.0 14.8	12.5	5	5	89 90	88	821478	812046	<0.2	<0.2	1.0	1.0
					Bottom	7.4 0.	132	29.4	29.4	8.0	8.0	20.1	20.0	75.1 89.5	75.1	5.1	5.1	14.7		5		90				<0.2		1.0	_
					Surface	1.0 -		30.2	30.2	8.1	8.1	18.2	18.2	89.3	89.4	6.1	6.1	4.7		6	ļ		İ			-	, [		
SR1A	Cloudy	Calm	12:48	4.9	Middle	2.5 -		-	-	-	-	-	-	-	-	-		-	5.5	-	6	÷	-	819982	812663	-		-	-
					Bottom	3.9 - 3.9 -	-	30.0 30.0	30.0	8.1 8.1	8.1	19.1 19.1	19.1	91.2 91.6	91.4	6.2	6.2	6.3 6.4		6		-				-			
					Surface	1.0 0.0 1.0 0.0		30.1 30.1	30.1	8.1 8.1	8.1	16.8 16.8	16.8	90.4 89.6	90.0	6.2	6.2	3.1		6		84 84				<0.2		1.0 0.9	
SR2	Cloudy	Moderate	12:58	4.6	Middle			-	-	-	-	-	-		-	-	0.2	-	5.1		6	-	87	821446	814171	-	<0.2	-	1.0
					Bottom	3.6 0.0 3.6 0.0		29.7 29.7	29.7	8.0	8.0	18.9 18.9	18.9	88.4 88.8	88.6	6.1 6.1	6.1	7.1 7.2		6 7	F	89 89	l			<0.2	. F	1.0	
					Surface	1.0 0. 1.0 0.	l 186	29.7 29.7	29.7	8.0	8.0	18.7 18.7	18.7	77.7 77.5	77.6	5.3 5.3		3.2 3.4		6 7		-				-	F	=	
SR3	Cloudy	Moderate	11:53	9.4	Middle	4.7 0 4.7 0	2 154	29.5 29.5	29.5	8.0	8.0	19.4	19.4	74.2 74.1	74.2	5.1 5.1	5.2	5.6 5.9	5.7	6	5	-		822162	807590	-			-
					Bottom	8.4 0 8.4 0	2 155	29.4	29.4	8.0	8.0	20.9	20.9	78.5 78.9	78.7	5.4	5.4	8.1 8.1		3	ļ	-				-	.		
					Surface	1.0 0. 1.0 0.	342	29.2	29.2	8.1 8.1	8.1	21.9	21.9	76.0 76.0	76.0	5.2		4.9		6		÷					二	Ħ	
SR4A	Cloudy	Calm	12:32	8.7	Middle	4.4 0.:	2 243	29.1	29.1	8.1 8.1	8.1	22.1	22.1	75.9 75.7	75.8	5.2 5.1	5.2	6.2	7.3	6	5	÷		817194	807833	-			-
					Bottom	4.4 0 7.7 0	2 249	29.1 29.1	29.1	8.1	8.1	22.1 22.2	22.2	75.5	75.5	5.1	5.1	6.1 10.1		4 5		÷	l			-	.	-	
					Surface	7.7 0. 1.0 0.	332	29.1 30.2	30.1	8.1 8.2	8.2	22.2 19.0	19.0	75.5 91.5	91.4	5.1 6.2		11.3 5.2		5 6		÷				-	一十	=	-
SR5A	Cloudy	Calm	12:55	5.4	Middle	1.0 0.	357	30.1		8.2		19.0		91.3	-	6.2	6.2	5.3	6.3	5	5	-		816591	810693	-		-	
SINON	Oloddy	Calli	12.55	5.4	Bottom	4.4 0	2 99	29.9	29.9	8.2	0.2	20.0	20.0	90.2	90.4	6.1	6.2	7.3	0.5	5	Ĭ	-		010331	010033	-		-	
						4.4 0 1.0 0.		29.9 29.9		8.2 8.2	8.2	20.0 19.8		90.6		6.2	6.2	7.4 3.0		5		-				-	_	-	-
					Surface	1.0 0.		29.9	29.9	8.2	8.2	19.8	19.8	90.3	90.3	6.1	6.1	3.2		4		-				-	. F	-	
SR6A	Cloudy	Calm	13:10	5.0	Middle	4.0 0.	- I 301	29.8	-	8.2	-	20.0	-	89.8	-	6.1		6.4	4.8	- 6	5	-		817951	814759	-		-	-
					Bottom	4.0 0.	I 319	29.8	29.8	8.2	8.2	20.0	20.0	89.6	89.7	6.1	6.1	6.4		6		-				-			_
					Surface	1.0 0. 1.0 0. 7.9 0.	7 63	30.2 30.2	30.2	8.2	8.2	18.9	18.9	93.0	93.0	6.3	6.2	3.1		4	ļ	-				-	,		
SR7	Cloudy	Moderate	13:44	15.8	Middle	7.9 0.	3 22	30.1 30.1	30.1	8.2 8.2	8.2	19.2 19.2	19.2	89.6 89.0	89.3	6.1		5.5 5.6	6.5	3	3	÷	-	823625	823741	-	-	-	-
					Bottom	14.8 0 14.8 0		29.7 29.7	29.7	8.3 8.3	8.3	20.5	20.5	89.4 89.8	89.6	6.1 6.1	6.1	10.8 10.8		<2 2		-				-		-	
					Surface	1.0 - 1.0 -		30.1 30.1	30.1	8.0	8.0	17.9 17.9	17.9	90.2	90.3	6.2	6.2	5.1 5.2	E	3	ŀ	Ė	l			-	, ŀ	-	
SR8	Cloudy	Moderate	12:39	5.2	Middle			-		-	-	-	-	-	-	-	0.2	-	6.3	-	4	-	-	820399	811604	-		-	-
			<u> </u>		Bottom	4.2 - 4.2 -		30.1 30.1	30.1	8.0	8.0	18.3 18.3	18.3	92.8 93.2	93.0	6.3	6.4	7.4 7.4		5 4	[	Ξ	L			-	_ F	-	

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on

Water Qua	lity Monit	toring Res	ults on		15 August 19	during Mid-	Flood T	ide																					
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	sth (m)	Current Speed	Current	Water Te	emperature (°C)		рН	Salir	ity (ppt)	DO S	aturation (%)	Disso Oxy		Turbidity(	NTU)	Suspende (mg		Total All (ppr		Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	(µg/L)
Station	Condition	Condition	Time	Depth (m)	Gampling Dep	ar (iii)	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value DA	A Value	DA
					Surface	1.0	0.3	69 0	29.3 29.3	29.3	8.0	8.0	21.1	21.1	78.7 77.9	78.3	5.4		5.4 5.4		5 4		86 86				<0.2	1.0	
C1	Rainy	Moderate	06:24	8.6	Middle	4.3 4.3	0.2	70 73	28.5 28.5	28.5	8.0	8.0	24.0	24.0	71.7 71.9	71.8	4.9 4.9	5.1	4.3 4.3	7.0	3	4	88 89	88	815626	804236	<0.2	1.2	1.2
					Bottom	7.6	0.2	77	28.4	28.4	8.0	8.0	24.4	24.4	73.9	74.0	5.0	5.0	11.2		3		90				<0.2	1.1	1
					Surface	7.6	0.3	80 54	28.5 30.0	30.0	8.0	8.0	24.4 17.1	17.1	74.1 83.8	83.8	5.0 5.8		11.3 6.3		3	l I	90 86				<0.2	1.4	$\vdash$
-00	011		07.00	40.0		1.0 5.2	0.2	55 66	30.0 29.6		8.0		17.1 19.6		83.7 65.6		5.8 4.5	5.2	6.4 7.5	8.7	3		86 88		005004		<0.2	0.9	
C2	Cloudy	Moderate	07:29	10.3	Middle	5.2 9.3	0.2 0.1	69 64	29.6 28.4	29.6	8.0	8.0	19.6 25.5	19.6	65.5 67.1	65.6	4.5 4.5		7.3 12.4	8.7	4	3	88 89	88	825661	806926	<0.2 <0.2	1.1	1.0
					Bottom	9.3	0.1	65 280	28.5	28.5	8.0	8.0	25.4	25.5	67.7	67.4	4.6	4.6	12.4		2 <2		89 85				<0.2	1.0	$\blacksquare$
					Surface	1.0	0.2	285	29.4	29.4	8.0	8.0	20.9	20.9	80.3	80.4	5.5	5.1	4.3		2	•	86 88				<0.2	1.2	
C3	Rainy	Moderate	05:16	12.7	Middle	6.4 6.4	0.0	250 259	28.5	28.5	8.0	8.0	24.1 24.1	24.1	69.5 69.1	69.3	4.7		6.1	5.3	3 <2	2	88	88	822099	817782	<0.2	1.0	1.1
					Bottom	11.7 11.7	0.1 0.1	277 284	27.0 27.0	27.0	8.0	8.0	28.7	28.7	59.4 60.8	60.1	4.0	4.1	5.6 5.5		<2 <2		90 90				<0.2	1.1	
					Surface	1.0	0.3	44 47	29.7 29.7	29.7	8.0	8.0	19.8 19.8	19.8	83.5 83.5	83.5	5.7 5.7	5.7	4.2 4.4		2 <2		85 85				<0.2	1.4	l l
IM1	Rainy	Moderate	06:43	5.4	Middle	-	-	-	-	-	-	-	-	-	-	-	-	3.7	-	5.8	-	3	-	87	817952	807150	- <0.2	.2 -	1.4
					Bottom	4.4 4.4	0.1 0.1	69 73	29.3 29.3	29.3	8.0	8.0	21.4	21.4	77.3 78.5	77.9	5.3 5.3	5.3	7.3 7.2		3	İ	88 88				<0.2	1.4	
					Surface	1.0	0.3	30 34	29.8 29.8	29.8	8.0	8.0	18.2 18.2	18.2	80.4 80.4	80.4	5.5 5.5		3.5 3.5		3		84 84				<0.2	1.4	
IM2	Cloudy	Moderate	06:51	7.9	Middle	4.0	0.2	39 40	29.6 29.6	29.6	8.0	8.0	19.5	19.5	74.9	74.9	5.1	5.3	4.1 4.1	5.1	3	3	88	87	818156	806157	<0.2	1.4	1.4
					Bottom	6.9	0.3	61 65	29.0	29.0	7.9	7.9	22.3	22.3	72.0	72.2	4.9	4.9	7.8		2		89 89				<0.2	1.2	
					Surface	1.0	0.3	58	29.7	29.7	8.0	8.0	18.1	18.1	81.9	82.0	5.6		8.5		2		84				<0.2	1.3	
IM3	Cloudy	Moderate	06:57	7.6	Middle	1.0 3.8	0.3 0.4	58 74	29.7 29.6	29.6	8.0 7.9	7.9	18.1 19.3	19.3	82.0 75.6	75.7	5.6 5.2	5.4	8.8 3.4	5.9	2	3	85 89	88	818784	805604	<0.2	1.2	1.2
	,				Bottom	3.8 6.6	0.4	76 52	29.6 29.3	29.3	7.9 7.9	7.9	19.3 20.8	20.9	75.7 76.2	76.7	5.2 5.2	5.3	3.5 5.3		4		89 90				<0.2	1.1	ı
					Surface	6.6 1.0	0.2	57 49	29.3 30.0	30.0	7.9 8.0	8.0	20.9 17.1	17.1	77.2 87.0	86.8	5.3 6.0	5.5	5.7 4.9		3 <2		91 84				<0.2	1.3	$\vdash$
	011		07.00	7.0		1.0 3.6	0.4	46 60	30.0 29.8		8.0		17.1 18.3		86.5 81.8		6.0 5.6	5.8	4.6 3.8		<2 3		84 88		040740	00.4000	<0.2	1.2	
IM4	Cloudy	Moderate	07:06	7.2	Middle	3.6 6.2	0.3	61 41	29.8 29.6	29.8	8.0	8.0	18.3 19.1	18.3	81.7 79.5	81.8	5.6 5.5		3.8 6.7	5.1	4 2	3	88 89	87	819746	804622	<0.2 <0.2 <0.2	1.0	1.2
					Bottom	6.2	0.2	42 42	29.6	29.6	8.0	8.0	19.2	19.1	80.3	79.9	5.5	5.5	6.8		4		90				<0.2	1.2	$\blacksquare$
					Surface	1.0	0.5	42 43	29.9 29.7	29.9	8.0	8.0	17.8	17.8	83.1 82.1	83.2	5.7	5.7	5.5 3.9		3	İ	85 88				<0.2	1.3	
IM5	Cloudy	Moderate	07:13	6.9	Middle	3.5	0.4	43	29.7	29.7	8.0	8.0	18.5	18.4	82.0	82.1	5.6		4.3	5.1	2	3	89	88	820727	804852	<0.2	1.2	1.2
					Bottom	5.9 5.9	0.3	49 47	29.7 29.7	29.7	8.0	8.0	18.6 18.6	18.6	83.3 83.4	83.4	5.7 5.7	5.7	5.7 5.8		2		89 89				<0.2 <0.2	1.3	П
					Surface	1.0	0.3 0.4	35 38	30.0 30.0	30.0	8.0	8.0	17.7 17.7	17.7	83.9 83.4	83.7	5.8 5.7	5.6	3.3 3.5		2		86 86				<0.2 <0.2	1.3	
IM6	Cloudy	Moderate	07:21	7.5	Middle	3.8	0.2	44 48	29.6 29.6	29.6	8.0	8.0	19.0 19.1	19.0	78.1 78.4	78.3	5.4 5.4	0.0	4.6 4.5	5.3	2	3	87 88	88	821075	805809	<0.2	1.3	1.3
					Bottom	6.5 6.5	0.2	59 58	29.5 29.5	29.5	8.0	8.0	19.2 19.3	19.2	79.3 79.9	79.6	5.4 5.5	5.5	7.9 7.9		3		90 90				<0.2	1.2	ł l
					Surface	1.0	0.4	31 33	29.9 29.9	29.9	8.0	8.0	18.0 18.0	18.0	79.7 79.5	79.6	5.5 5.5		3.7 3.7		<2 3		85 86				<0.2	1.1	
IM7	Cloudy	Moderate	07:29	7.8	Middle	3.9	0.3	41	29.8	29.8	8.0	8.0	19.1	19.1	77.2 77.1	77.2	5.3	5.4	5.4	5.4	3	3	89 89	88	821344	806818	<0.2	12	1.2
					Bottom	6.8	0.1	37 42	29.6	29.6	8.0	8.0	19.9	19.9	75.5 76.0	75.8	5.2	5.2	7.3		4 3		89 90				<0.2	1.1	
		1			Surface	1.0	0.3	355	30.0	30.0	8.0	8.0	17.5	17.5	85.0	85.0	5.8		4.1		<2		85				<0.2	1.1	
IM8	Cloudy	Moderate	07:07	8.2	Middle	1.0 4.1	0.3	1 2	30.0 29.6	29.6	8.0	8.0	17.5 19.0	19.0	85.0 79.8	79.8	5.8 5.5	5.7	4.1 4.7	5.8	<2 <2	<2	84 87	87	821823	808130	<0.2	1.0	1.1
	O.O.G.	·NOGOTORS	07.07	U.L	Bottom	4.1 7.2	0.3	2 351	29.6 29.5	29.5	8.0 8.0	8.0	19.0 19.5	19.5	79.8 84.9	85.1	5.5 5.8	5.8	4.7 8.5	0.0	<2 <2	1	88 89	٠.	32.020	000.00	<0.2	1.1	``
DA: Denth-Ave					DOLLOTTI	7.2	0.3	5	29.5	29.5	8.0	0.0	19.5	19.5	85.3	00.1	5.8	0.0	8.5		2	Ĭ	90				<0.2	1.1	

15 August 19 during Mid-Flood Tide

Water Qua	lity Monit	toring Resi	ults on		15 August 19	during Mid-Fl	lood Ti	de																						
Monitoring	Weather	Sea	Sampling	Water	Sampling Dept		Current Speed	Current	Water Ter	mperature (°C)		рH	Salin	ity (ppt)		aturation %)	Dissol Oxyg		Turbidity(N	ITU) S	uspende (mg/	d Solids /L)	Total A (pp		Coordinate HK Grid	Coordinate HK Grid	Chron (µg/		Nickel (µ	ıg/L)
Station	Condition	Condition	Time	Depth (m)	Sampling Dept	II (III)	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA	Value	DA
					Surface	1.0 1.0	0.7	341 331	30.0	30.0	8.0	8.0	17.3 17.3	17.3	88.3 88.3	88.3	6.1 6.1	L	3.2	-	<2 <2		85 85				<0.2	ŀ	1.2	7
IM9	Cloudy	Moderate	07:00	8.0	Middle	4.0	0.6	329	30.0	30.0	8.0	8.0	17.5	17.5	85.1	84.9	5.9	6.0	5.5	5.0	2	2	88	88	822117	808810	<0.2	-0.2	1.1	1.2
						4.0 7.0	0.6	339 318	29.9 29.6		8.0 8.0	8.0	17.5 18.7		84.6 83.6	83.6	5.8 5.7	5.7	5.8 6.0	-	<2 2	,	88 90				<0.2	F	1.0	
					Bottom	7.0 1.0	0.6	322 331	29.6 30.0	29.6	8.0	8.0	18.7 17.1	18.7	83.6 87.6		5.7 6.0	5.7	6.1 3.2		2	'	90 85				<0.2		1.3	_
					Surface	1.0	0.8	336	30.0	30.0	8.0	8.0	17.1	17.1	87.6	87.6	6.0	5.9	3.3		2		85	İ			< 0.2		1.4	
IM10	Cloudy	Moderate	06:51	8.5	Middle	4.3 4.3	0.7	327 317	29.8 29.8	29.8	8.0	8.0	18.3 18.3	18.3	83.3 83.4	83.4	5.7 5.7	-	6.2 6.4	6.8	<2 <2	2	88 88	88	822408	809778	<0.2	<0.2	1.3	1.3
					Bottom	7.5 7.5	0.5 0.5	306 308	29.5 29.5	29.5	8.0	8.0	19.5 19.5	19.5	79.4 79.4	79.4	5.4 5.4	5.4	10.6 11.2		<2 <2		89 90				<0.2		1.3	
					Surface	1.0	0.7	312	29.8	29.8	8.0	8.0	17.9	17.9	81.6	81.4	5.6		4.8		4		84				<0.2		1.2	
IM11	Cloudy	Moderate	06:36	8.8	Middle	1.0 4.4	0.7 0.5	309 310	29.8 29.5	29.5	8.0 7.9	7.9	17.9 19.8	19.8	81.2 73.8	73.4	5.6 5.1	5.3	4.9 4.7	6.5	5 3		85 88	88	822054	811463	<0.2		1.2	11
	Cioday	Woderate	00.50	0.0		4.4 7.8	0.5	311 297	29.5 29.1		7.9 7.9		19.8 22.1		72.9 74.5		5.0 5.1		5.4 9.5	0.5	4		89 90	- 00	022004	011403	<0.2	L	1.1	
					Bottom	7.8	0.2	281	29.1	29.1	7.9	7.9	22.1	22.1	74.8	74.7	5.1	5.1	9.6		3		90				<0.2		1.1	_
					Surface	1.0 1.0	0.3 0.3	289 274	29.8 29.8	29.8	8.0	8.0	18.2 18.2	18.2	80.0 79.8	79.9	5.5 5.5	4.9	4.7 4.8		3		85 85				<0.2		1.2	
IM12	Rainy	Moderate	06:27	9.1	Middle	4.6 4.6	0.2	273 278	29.1 29.1	29.1	7.9	7.9	21.3	21.3	62.8 61.7	62.3	4.3		6.3	9.9	<2 <2	3	88 88	87	821437	812056	<0.2		1.1	1.1
					Bottom	8.1 8.1	0.1	272 269	28.5 28.5	28.5	7.9 7.9	7.9	24.3 24.3	24.3	58.9 59.0	59.0	4.0	4.0	18.6 18.3		2		89 89				<0.2		1.1	
					Surface	1.0	-	-	29.6	29.6	8.0	8.0	20.0	20.0	82.4	82.5	5.6		5.4		4		-				-		-	_
0044	Better	0.1	05.55	4.0		1.0 2.5	-	-	29.6		8.0		20.0		82.5		5.6	5.6	5.5	-	2	. 3	-	ł	040075	812660	-	F	-	
SR1A	Rainy	Calm	05:55	4.9	Middle	2.5 3.9	-	-	29.5		8.0		20.5	-	77.9		5.3		4.7	5.0	3	. 3	-	· .	819975	812660	-	· [	-	-
					Bottom	3.9	-	-	29.5	29.5	8.0	8.0	20.5	20.5	77.9	77.9	5.3	5.3	4.5		2		-				-		-	
					Surface	1.0	0.1	289 295	29.8 29.7	29.7	8.0	8.0	19.5 19.4	19.5	84.1 83.7	83.9	5.7	5.7	3.4	H	2	,	85 84	ł			<0.2	F	1.2	
SR2	Rainy	Moderate	05:43	5.4	Middle		-	- :	-	-	-	-	-	-	-	-	-	5.7	-	3.8	-	2	-	86	821481	814178		<0.2	-	1.1
					Bottom	4.4	0.3	280	29.2	29.2	8.0	8.0	21.8	21.8	81.1 81.6	81.4	5.5 5.6	5.6	4.0		<2		87				<0.2		1.1	
					Surface	1.0	0.3	307 68	29.2 29.9	29.9	8.0	8.0	18.0		81.5	81.4	5.6		5.6		<2 <2		87				<0.2		1.0	$\dashv$
						1.0 4.8	0.3	84 65	29.9 29.8		8.0		18.0 19.1		81.3 77.8		5.6 5.3	5.5	5.7 6.7	F	<2 <2		-				-	ŀ	-	
SR3	Cloudy	Moderate	07:14	9.5	Middle	4.8 8.5	0.2	58 68	29.8 29.6	29.8	8.0 7.9	8.0	19.1 20.3	19.1	77.6 83.4	77.7	5.3 5.7		6.8 9.9	7.4	<2 <2	. 2	-	· ·	822167	807549	-	-	_	-
					Bottom	8.5	0.2	74	29.6	29.6	7.9	7.9	20.2	20.3	84.0	83.7	5.7	5.7	9.6		3	,	÷							
					Surface	1.0	0.3	236 255	29.3 29.3	29.3	8.0	8.0	20.8	20.9	78.5 77.8	78.2	5.4	5.1	3.6	H	3	,	-	-			-	F	-	
SR4A	Rainy	Calm	05:51	9.2	Middle	4.6 4.6	0.3	214 215	28.5 28.5	28.5	8.0	8.0	23.9	23.9	71.8 71.9	71.9	4.9 4.9	5.1	6.6	6.1	2	2	-	-	817168	807811	-	- F	-	-
					Bottom	8.2	0.1	265	28.4	28.4	8.0	8.0	24.6	24.5	74.4	74.6	5.0	5.1	8.1		3		-				-	F		
					Surface	8.2 1.0	0.1	280 288	28.5 28.6	28.6	8.0 7.9	7.9	24.5 24.0	24.0	74.7 71.9	72.0	5.1 4.9		8.1 6.7		2		-				-		-	-
						1.0	0.2	289	28.6		7.9	1.5	24.0	24.0	72.0	72.0	4.9	4.9	6.7	_	<2		-	1			-	F	-	
SR5A	Rainy	Calm	05:34	5.2	Middle	4.2	- 0.4	297	28.6	-	7.9	-	24.1	•	- 70.4	-	4.9		3.1	4.9	2	2		-	816616	810689	-	-	-	-
					Bottom	4.2	0.4	275	28.6	28.6	7.9	7.9	24.1	24.1	72.1 72.1	72.1	4.9	4.9	3.1		3						-		=	
					Surface	1.0	0.2	232 240	28.6 28.6	28.6	7.9	7.9	23.9	23.9	72.5 72.5	72.5	4.9		5.7 5.6	-	2		-	1			-	F	-	
SR6A	Rainy	Calm	05:07	5.0	Middle		-	-	-	-	-		-		-		-	4.9	-	4.7	-	3	-		817979	814758	-	. [	-	-
					Bottom	4.0	0.2	289	28.6	28.6	7.9	7.9	24.0	24.0	74.1	74.1	5.0	5.0	3.7		3		÷				-		-	
						4.0 1.0	0.2	290 235	28.6 28.6		7.9 7.9		24.0		74.1 77.4		5.0 5.3	0.0	3.7	+	4		-				-	<del></del>	-	_
					Surface	1.0 7.7	0.4	238 244	28.6 27.7	28.6	7.9 7.9	7.9	23.9 27.4	23.9	77.6 72.8	77.5	5.3 4.9	5.1	3.3 5.9		5 4		-	1			-	ļ	=	
SR7	Cloudy	Moderate	04:40	15.4	Middle	7.7	0.2	250	27.7	27.7	7.9	7.9	27.4	27.4	72.8	72.8	4.9		6.0	6.0	5	4	-	-	823619	823726		-	-	-
	<u> </u>		<u> </u>		Bottom	14.4 14.4	0.1	206 208	27.3 27.3	27.3	7.9	7.9	27.9 27.9	27.9	58.8 59.2	59.0	4.0	4.0	8.9 8.9	-	3						-		-	
					Surface	1.0	-	-	29.7 29.7	29.7	8.0	8.0	19.7 19.6	19.6	84.8 84.3	84.6	5.8 5.8	F	3.1		3		-					F	-	
SR8	Rainy	Moderate	06:12	4.8	Middle	-	-	-	-	-	-	-	-	-	-		-	5.8	-	5.0	-	3	-		820367	811607	-	.	-	-
					Bottom	3.8	-	-	29.4	29.4	8.0	8.0	21.2	21.2	83.8	84.0	5.7	5.7	6.8	H	2		-	ł			-		-	
					DOUGHI	3.8	-		29.4	23.4	8.0	0.0	21.2	21.2	84.2	04.0	5.7	3.1	6.8		3		-				-			

## Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 17 August 19 during

17 August 19 during Mid-Fbb Tide

Water Qual	ity Monit	oring Resu	ilts on		17 August 19	during Mid-	Ebb Tide	9																					
Monitoring	Weather	Sea	Sampling	Water	Sampling D	epth (m)	Current Speed	Current	Water Te	emperature (°C	)	рН	Salin	ity (ppt)		aturation (%)	Disso Oxyg		Turbidity(	NTU)	Suspende (mg		Total All (ppi		Coordinate HK Grid	Coordinate HK Grid	Chron (µg/		Nickel (µg/L)
Station	Condition	Condition	Time	Depth (m)	Gamping 5	Spu: ()	(m/s)	Direction	Value	Average	Value	Average	e Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA	Value DA
					Surface	1.0	0.5	206 220	29.2 29.2	29.2	7.9	7.9	21.7	21.8	76.1 76.0	76.1	5.2 5.2		2.5		5 4		83 83				<0.2	-	1.2
C1	Rainy	Rough	14:12	7.8	Middle	3.9 3.9	0.3	195 201	28.5 28.4	28.5	7.9 7.9	7.9	22.6 22.7	22.6	69.7 69.2	69.5	4.8 4.8	5.0	2.6 2.6	3.2	4	4	87 87	87	815598	804237	<0.2 <0.2	<0.2	1.2 1.2
					Bottom	6.8	0.3	194 204	28.4	28.5	7.9	7.9	25.9	25.8	61.4	61.6	4.1	4.2	4.4		3 4		91				<0.2	,	1.2
					Surface	1.0	0.6	117	29.6	29.6	7.9	7.9	18.7	18.7	80.5	80.3	5.5		3.0		3		85				<0.2		1.4
C2	Rainy	Moderate	12:37	7.9	Middle	1.0 4.0	0.6 0.4	125 119	29.5 29.1	29.1	7.9 7.9	7.9	18.7 20.4	20.4	80.1 76.8	76.7	5.5 5.3	5.4	3.0 5.2	47	4 3	4	86 89	89	825691	806933	<0.2 <0.2	<0.2	1.4 1.5 1.4
02	rtairy	modorato	12.07	7.0	Bottom	4.0 6.9	0.4	124 70	29.0 28.9	29.0	7.9 7.9	7.9	20.4	23.1	76.5 66.6	66.7	5.3 4.5	4.5	5.2 6.0		3		89 93		020001	000000	<0.2	-	1.4
						6.9 1.0	0.2	72 38	29.0 29.2		7.9		23.1		66.8 77.7		4.5 5.3	4.0	6.1 2.6		3		94 79				<0.2	_	1.5
					Surface	1.0 6.2	0.4	39 120	29.2 28.1	29.2	7.9 7.9	7.9	21.5 25.5	21.5	77.6 60.6	77.7	5.3 4.1	4.7	2.6 6.1		3		83 87				<0.2	: F	0.9
C3	Rainy	Moderate	14:17	12.4	Middle	6.2	0.1	131	28.1	28.1	7.9	7.9	25.6	25.5	60.4	60.5	4.1		6.2	5.3	2	3	87	85	822093	817816	<0.2	<0.2	0.9
					Bottom	11.4 11.4	0.1	8	28.0 28.0	28.0	7.9 7.9	7.9	25.9 25.9	25.9	61.5 62.0	61.8	4.2	4.2	7.1 7.1		3		88 88				<0.2		0.8
					Surface	1.0 1.0	0.1 0.1	260 281	28.8 28.6	28.7	7.9 7.9	7.9	21.1	21.1	76.0 75.2	75.6	5.2 5.2	5.2	2.7		3		79 83				<0.2 <0.2	.	0.9
IM1	Rainy	Moderate	13:45	4.7	Middle	-	-	-	-	-	-	-	-	-	-	-	-		-	3.5	-	3	-	85	817953	807147	-	<0.2	- 0.9
					Bottom	3.7	0.3	172 181	28.9 29.1	29.0	7.9	7.9	25.1 25.0	25.0	65.0 66.1	65.6	4.4	4.4	4.2 4.2		3		88 88				<0.2		0.9
					Surface	1.0	0.5 0.5	160 164	29.2 29.2	29.2	7.9 7.9	7.9	19.4 19.4	19.4	77.5 77.2	77.4	5.3		2.8		3		83 84				<0.2	F	0.9
IM2	Rainy	Moderate	13:38	7.5	Middle	3.8 3.8	0.4	159 170	28.6 28.5	28.6	7.9	7.9	21.6 21.9	21.7	73.0 70.5	71.8	5.0 4.9	5.1	4.3 4.4	3.7	3	3	88 88	88	818182	806186	<0.2	<0.2	1.1 1.0
					Bottom	6.5	0.4	154 162	28.7	28.8	7.9	7.9	24.8	24.8	63.0	63.4	4.2	4.3	4.0		3		92				<0.2	.	1.1
					Surface	1.0	0.2	230 240	29.4 29.4	29.4	7.9 7.9	7.9	17.3 17.3	17.3	81.8 81.3	81.6	5.7		3.4		2		83 83				<0.2	T	0.8
IM3	Rainy	Moderate	13:32	7.6	Middle	3.8	0.2	222	29.3	29.3	7.9	7.9	19.3	19.3	79.1	79.0	5.7 5.4 5.4	5.6	5.4	5.5	4	3	88	88	818792	805574	<0.2	<0.2	0.8
					Bottom	3.8 6.6	0.2	229 110	29.3 29.4	29.4	7.9 7.9	7.9	19.3 21.0	21.0	78.8 74.1	74.4	5.0	5.1	5.5 7.8		3		88 91				<0.2 <0.2	,	0.7
					Surface	6.6 1.0	1.0	120 187	29.4 29.4	29.4	7.9 7.9	7.9	21.0 17.5	17.5	74.7 87.2	87.1	5.1 6.0		7.8 3.2		2		92 84				<0.2 <0.2	_	0.8
IM4	Rainy	Moderate	13:22	8.0	Middle	1.0 4.0	1.0	199 174	29.4 29.2	29.2	7.9 7.9	7.9	17.5 20.5	20.6	86.9 74.8	74.8	6.0 5.1	5.6	3.2 5.9	5.8	2	3	84 88	88	819717	804605	<0.2 <0.2	<0.2	0.8
1101-4	Rainy	Woderate	13.22	0.0	Bottom	4.0 7.0	0.8	178 180	29.2 29.2	29.2	7.9 7.9		20.6	21.2	74.7 74.7	74.8	5.1 5.1	F 4	6.0 8.3	5.0	4		88 91	- 00	013717	004003	<0.2	-	0.8
						7.0 1.0	0.4	180 212	29.2 29.4		7.9 7.9	7.9	21.2 17.4		74.8 82.8		5.1 5.7	5.1	8.3 3.6		3		92 84				<0.2	=	0.8
					Surface	1.0	0.8	226 209	29.4 29.2	29.4	7.9 7.9	7.9	17.5 21.0	17.4	82.7 70.8	82.8	5.7 4.8	5.3	3.7 6.1		3		84 87				<0.2	: F	0.8
IM5	Rainy	Moderate	13:14	7.8	Middle	3.9 6.8	0.7	220 199	29.2	29.2	7.9	7.9	21.0	21.0	70.8	70.8	4.8		6.1	6.8	3	3	88 92	88	820734	804848	<0.2	<0.2	0.9 0.8
					Bottom	6.8	0.5	203	29.1	29.1	7.9	7.9	22.2	22.2	68.1	68.1	4.6	4.6	10.7		2		92				<0.2		0.8
					Surface	1.0	0.9	231 246	29.6 29.6	29.6	7.9	7.9	18.5 18.6	18.6	80.3 79.9	80.1	5.5 5.5	5.0	2.6		2		83				<0.2	,	0.9
IM6	Rainy	Moderate	12:57	8.1	Middle	4.1 4.1	0.6	246 262	28.8 28.9	28.9	7.9	7.9	21.8	21.8	67.9 64.2	66.1	4.7		6.0	5.4	3 2	3	88 88	88	821078	805819	<0.2	<0.2	0.8
					Bottom	7.1 7.1	0.4	240 252	29.2 29.3	29.3	7.9	7.9	23.5 23.4	23.4	64.8 65.6	65.2	4.4	4.4	7.5 7.6		3		93 93				<0.2		0.8
					Surface	1.0	0.4	204 218	29.1 29.0	29.1	7.9 7.9	7.9	21.6 21.7	21.7	77.1 77.1	77.1	5.3 5.3	4.9	2.2		3		83 84				<0.2	F	1.0
IM7	Rainy	Moderate	12:47	7.9	Middle	4.0 4.0	0.1 0.1	60 60	28.1 28.0	28.1	7.9 7.9	7.9	23.2 23.3	23.2	66.0 63.8	64.9	4.5 4.4	4.9	5.2 5.1	4.5	3	3	88 88	88	821330	806832	<0.2 <0.2	<0.2	0.8 0.9
					Bottom	6.9	0.2	96 105	27.9 27.9	27.9	7.9	7.9	26.4	26.4	59.1 59.2	59.2	4.0	4.0	6.2		3		92				<0.2	;	0.8
					Surface	1.0	0.6 0.6	108 112	29.2 29.2	29.2	7.9 7.9	7.9	18.6 18.5	18.5	82.3 82.2	82.3	5.7		5.2		3		85 85				<0.2		0.8
IM8	Rainy	Moderate	13:01	8.5	Middle	4.3	0.3	104	29.2	29.2	7.9	7.9	20.5	20.5	75.3	75.4	5.2	5.5	5.2 7.7	7.3	5	5	89	89	821824	808147	<0.2	<0.2	0.8 1.1 1.0
					Bottom	4.3 7.5	0.3	106 125	29.2 29.2	29.2	7.9 7.9	7.9	20.6	21.3	75.4 77.4	77.5	5.2 5.3	5.3	7.7 8.9		7		90 93				<0.2 <0.2	.	1.0
DA: Depth-Aver	nand					7.5	0.2	133	29.2	20.2	7.9	1	21.3	21.0	77.6	lo	5.3	0.0	8.9		7		93				<0.2		1.0

17 August 19

Bottom

Surface

Middle

Rottom

Surface

Middle

Bottom

Surface

Middle

Bottom

Surface

Middle

Bottom

Surface

Middle

Bottom

Water Quality Monitoring Results on

during Mid-Ebb Tide

0.7

0.4

0.5

0.3

0.3

0.1

0.1

0.1

0.1

0.1

0.2

0.1

0.7

0.7

0.3

0.4

0.4

0.4

250

273

267

242

258 342

359

322

351

336

318

342 56

56

357

328

45

48

29.3

29.3

29.0

28.9

28.6

28.7 28.4

28.3

28.3

28.4

27.8

27.7

28.5

28.5

28.3

28.3

28.4

28.5

28.6 28.5

27.9

27.9

1.0

1.0

4.2

4.2

7.4

7.4

1.0

1.0

2.8

2.8

2.9

2.9

1.0

7.8

7.8

14.6

14.6

1.0

3.2

Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Value Average 0.6 85.4 5.9 1.0 0.7 111 29.3 17.4 4.1 86 <0.2 0.8 5.5 3.8 0.3 109 115 29.2 7.9 7.9 74.9 75.0 5.1 5.1 5.7 5.7 88 <0.2 1.1 IM9 Moderate 13:08 7.6 Middle 7.9 20.6 5.7 89 822075 808790 <0.2 3.8 0.4 < 0.2 29.2 6.6 0.2 56 29.2 76.0 76.2 92 <0.2 1.1 7.9 21.1 5.2 7.4 6 Bottom 29.2 7.9 21.1 76.1 5.2 6.6 0.2 56 79 21 1 7.4 92 11 29.2 <0.2 0.5 29.2 1.0 18.6 5.6 Surface 29.2 7.9 18.6 80.1 7.9 18.6 79.6 5.5 89 1.2 1.0 0.5 88 29.2 5.0 < 0.2 29.2 29.2 74.7 74.7 1.1 4.1 0.4 74 5.1 6.4 92 93 <0.2 20.2 4 IM10 Rainv Moderate 13:13 8.2 Middle 29.2 7.9 20.2 74.7 92 822363 809801 <n 2 0.5 80 7.2 0.2 65 29.2 7.9 75.3 5.1 7.5 6 93 < 0.2 1.0 21.0 7.9 21.0 75.4 5.2 Bottom 29.2 7.2 0.2 70 29.2 7.9 75.4 5.2 7.5 94 < 0.2 1.1 1.0 0.2 214 4.0 86 1.0 29.4 7.9 16.8 83.8 5.8 83.7 <0.2 Surface 29.4 7.9 16.8 1.0 0.2 215 29.4 7.9 83.5 5.8 4.0 87 <0.2 0.9 3.9 0.1 189 29.3 7.9 19.0 77.6 5.4 88 <0.2 0.9 5.3 IM11 822060 811464 Rainv Moderate 13:24 7.8 Middle 29.3 7.9 19.0 77.5 89 <0.2 0.1 5.4 88 3.9 <0.2 204 104 29.3 6.8 29.3 7.9 20.5 78.7 5.4 6.8 93 <0.2 1.2 5.4 Rottom 29.3 7.9 20.5 78.8 6.8 0.1 107 29.3 7.9 20.5 78.9 5.4 6.8 <2 94 1.1 99 7.9 20.2 77.0 76.2 4.1 88 <0.2 1.2 Surface 28.9 7.9 20.2 76.6 1.0 0.2 107 28.9 7.9 5.3 4.0 4 89 <0.2 1.1 4.0 0.1 321 28.7 7.9 69.5 4.7 8.7 93 <0.2 1.1 13:29 Middle 69.7 92 821448 812069 IM12 Rainy Moderate 7.9 22.9 4.0 0.1 334 28.6 7.9 4.8 8.7 93 1.1 6.9 0.1 207 28.0 7.9 62.5 4.2 10.3 94 <0.2 1.2 Bottom 28.1 7.9 26.1 62.7 4.2 62.9 6.9 0.1 214 28.1 7.9 26.1 4.2 10.3 94 <0.2 1.2 1.0 28.0 7.9 26.0 61.5 4.2 5.4 <2 Surface 28.1 7.9 26.0 61.6 1.0 28.1 7.9 26.0 61.6 4.2 5.4 2 2.2 SR1A Rainy Moderate 13:47 Middle 819976 812662 2.2 3.3 29.3 7.9 80.0 5.5 2.4 4 5.5 Bottom 29.3 7.9 19.0 79.6 3.3 29.2 7.9 19.0 79.1 5.5 2.4 4 1.0 0.3 50 28.8 7.9 22.2 3.8 83 <0.2 0.8 Surface 28.8 7.9 22.2 71.4 1.0 0.3 54 28.7 7.9 22.3 71.1 4.9 3.8 2 84 <0.2 8.0 SR2 Rainy Moderate 13:57 3.9 Middle 821449 814186 <0.2 0.8 2.9 0.4 66.6 64.8 <0.2 0.8 Bottom 23.2 65.7 4.6 0.5 28.1 7.9 23.2 4.5 43 <2 88 <0.2 0.8 1.0 0.8 102 29.4 7.9 17.7 84.3 5.8 4.3 7.9 17.8 84.3 1.0 0.8 110 29.4 79 17.8 84.2 5.8 4.3 2 4.1 0.7 85 29.2 7.9 18.5 78.6 5.4 8.2 2 SR3 Rainy Moderate 12:55 8.1 78.4 822125 807577 4.1 0.8 85 29.2 7.9 18.5 78.2 5.4 8.3 29.2 29.3 5.3 10.4 10.5 7.1 0.7 87 88 7.9 77.6

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

21.7

21.7

22.3

22.4

25.2

22.0

22.1

25.7

22.1

24.7

24.7

22.3

26.3

21.7

22.3

25.2

22.0

25.6

26.5

25.5

26.3

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

7.9

79

7.9

79

7.9

7.9

7.9

79

7.9

29.0

28.7

28.4

28.4

27.8

27.9

77.8

76.7

71.4

63.5

81.6 5.7

55.4

71.9

55.6

62.9

62.0

78.0

76.7

76.6

71.5

63.3

63.6

81.8

81.3

55.4

81.3 81.3

74.4

74.4

62.6

63.1

70.5

61.7

5.3

4.3

3.8

2.3

2.3

3.1

3.1

3.7

3.8

4.5

4.5

4.3

6.9 5.0

8.1

4.2

4.3

47

47

5.0

5.0

4.1

4.1 4.9

8.1

6

6

4

8

8

6

5

5

-

-

-

807817

810713

814734

823750

811619

817187

816599

817985

823648

820375

5.2

5.2

4.9

4.9

4.3

4.3

5.7

3.8

4.9

3.8

5.1

4.9

49

4.2

4.9

4.8

4.2

4.2

4.2

DA: Depth-Averaged

SR4A

SR5A

SR6A

SR7

SR8

Rainy

Rainy

Rainy

Rainy

Rainy

Rough

Moderate

Moderate

Moderate

Moderate

14:43

14:58

15:39

14:40

8.4

3.8

3.9

4.2

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

13:38

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 17 August 19 during

17 August 19 during Mid-Flood Tide

Water Qua	ity Monit	oring Resu	lts on		17 August 19	during Mid-	Flood Ti	de																				
Monitoring	Weather	Sea	Sampling	Water	Sampling [	Depth (m)	Current Speed	Current	Water Te	mperature (°C)		pН	Salin	ity (ppt)		aturation %)	Dissolved Oxygen	Turbidity	(NTU)	Suspender (mg/		Total A (pp	lkalinity m)	Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	(µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average		Average		Average	Value DA		DA	Value	DA	Value	DA	(Northing)	(Easting)	Value DA		DA
					Surface	1.0	0.2	55 57	29.5 29.5	29.5	7.9	7.9	18.1 18.1	18.1	77.5 77.3	77.4	5.4 5.3 5.2	2.8	1	4 6	-	83				<0.2	1.1	i
C1	Fine	Moderate	07:11	8.2	Middle	4.1	0.3	60 59	29.4 29.4	29.4	7.9	7.9	19.7	19.7	74.4 73.8	74.1	5.1	3.2	3.8	7	7	88	87	815616	804234	<0.2	1.0	1.0
					Bottom	7.2 7.2	0.3	53 55	29.4 29.4	29.4	7.9 7.9	7.9	21.3	21.3	69.8 70.0	69.9	4.7	5.4 5.4	1	9	F	91 91				<0.2 <0.2	1.0	
					Surface	1.0	0.3	42 40	29.6 29.6	29.6	7.9	7.9	18.5	18.5	80.9 80.6	80.8	5.6	2.7	<del> </del>	3 4		89 90				<0.2 <0.2	1.2	
C2	Cloudy	Moderate	08:50	7.6	Middle	3.8	0.2	38 40	29.1 29.0	29.1	7.9 7.9	7.9	20.0		77.3 75.4	76.4	5.0 5.3 5.2	4.7	4.4	5 4	5	93	92	825675	806932	<0.2 <0.2 <0.2	1.4	1.3
					Bottom	6.6	0.2	62	28.8	28.8	7.9 7.9	7.9	22.8	22.8	66.5	66.5	4.5	E 7	1	7		94				<0.2	1.5	ŕ
					Surface	6.6 1.0	0.2	65 251	28.8 29.4	29.4	7.9	7.9	22.9 19.8	19.8	66.5 81.0	80.9	4.5 5.6	2.3		4		95 83				<0.2	1.3	
C3	Fine	Calm	06:11	11.8	Middle	1.0 5.9	0.6	254 280	29.4 28.7	28.7	7.9 7.9	7.9	19.8 23.5	23.5	80.8 70.1	70.1	5.5 4.8	2.0	2.6	3 5	5	83 88	87	822102	817784	<0.2	1.3	1.3
		-			Bottom	5.9 10.8	0.8	294 289	28.6 26.6	26.6	7.9 7.9	7.9	23.5 30.1	30.1	70.0 51.7	51.8	4.8 3.5 3.5	2.0 3.5	1	5 6		88 91				<0.2	1.2	
					Surface	10.8	0.4	308 39	26.6 29.4	29.4	7.9 7.9	7.9	30.1 19.1	10.2	51.9 82.7	82.7	5.7	3.6		6		91 87				<0.2	1.3	
IM1	F:	Madaga	07.00	5.2		1.0	0.1	35 -	29.4	29.4	7.9	7.9	19.2	19.2	82.6	02.1	5.7	3.5	3.8	5 -	7	87	89	817951	807113	<0.2 - <0.2	1.4	
IMT	Fine	Moderate	07:36	5.2	Middle	4.2	0.1	- 49	29.4	-	7.9		20.2		76.9	-	5.3	4.2	3.8	- 7	′ [	91	89	817951	807113	- <0.2	1.4	1.4
					Bottom	4.2	0.1	51 42	29.4 29.4	29.4	7.9 7.9	7.9	20.2	20.2	77.1 82.8	77.0	5.3 5.3 5.7	4.2 3.5		8		91 84				<0.2 <0.2	1.4	
					Surface	1.0	0.3	44 66	29.4 29.4	29.4	7.9 7.9	7.9	18.7	18.7	82.7 76.2	82.8	5.7 5.2 5.5	3.5	1	6 4	ļ	84				<0.2	1.4	i
IM2	Fine	Moderate	07:44	6.9	Middle	3.5 5.9	0.3	61 55	29.4 29.3	29.4	7.9	7.9	20.2	20.2	76.6 77.8	76.4	5.2	4.5	5.8	5	5	89 92	89	818163	806183	<0.2 <0.2 <0.2	1.5	1.5
					Bottom	5.9	0.2	59	29.3	29.3	7.9	7.9	20.3		77.8	77.8	5.3	9.5		4		93				<0.2	1.4	
					Surface	1.0	0.2	44 46	29.4 29.4	29.4	7.9	7.9	18.9	18.9	82.4 82.2	82.3	5.7 5.7 5.4	2.4		8		83 84				<0.2	1.4	
IM3	Fine	Moderate	07:49	6.8	Middle	3.4	0.2	59 56	29.4 29.4	29.4	7.9 7.9	7.9	20.0	20.0	75.2 75.0	75.1	5.2	3.3	3.9	6	6	88 88	88	818784	805591	<0.2	1.4	1.4
					Bottom	5.8 5.8	0.2	57 60	29.4 29.4	29.4	7.9 7.9	7.9	20.3		74.7 74.8	74.8	5.1 5.1	6.1		3	-	92 92				<0.2 <0.2	1.6	
					Surface	1.0	0.7	38 41	29.4 29.4	29.4	7.9 7.9	7.9	19.3 19.3	19.3	81.7 81.7	81.7	5.6 5.6 5.4	2.6	1	7		84 83				<0.2	1.4	ı
IM4	Fine	Moderate	07:57	7.5	Middle	3.8	0.4	51 48	29.4 29.4	29.4	7.9 7.9	7.9	20.1	20.1	75.2 75.3	75.3	5.1	3.4	3.3	6	6	88 88	88	819709	804586	<0.2 <0.2	1.4	1.4
					Bottom	6.5 6.5	0.4	45 50	29.3 29.3	29.3	7.9 7.9	7.9	20.5	20.5	77.1 77.1	77.1	5.3 5.3	4.0 3.9	1	5 5		91 91				<0.2 <0.2	1.5	
					Surface	1.0	0.7	32 36	29.4 29.4	29.4	7.9 7.9	7.9	16.6 16.6	16.6	85.8 85.7	85.8	6.0	4.7 4.8		4 5	-	84 83				<0.2 <0.2	1.4	
IM5	Fine	Moderate	08:13	7.4	Middle	3.7	0.5 0.5	38 39	29.3 29.3	29.3	7.9 7.9	7.9	18.0 18.0	18.0	80.0	80.0	5.5	5.8 5.8	7.2	7	6	88 88	88	820735	804847	<0.2 <0.2	14	1.4
					Bottom	6.4	0.3	46 43	29.2 29.2	29.2	7.9 7.9	7.9	20.4	20.4	75.4 75.7	75.6	5.2 5.2 5.2	11.0		8		91 92				<0.2 <0.2	1.4	·
					Surface	1.0	0.5	21	29.4 29.4	29.4	7.9	7.9	16.8	16.8	85.2 85.0	85.1	5.9	4.0		6 5		83 84				<0.2 <0.2	1.4	
IM6	Fine	Moderate	08:19	7.6	Middle	3.8	0.3	28	29.3	29.3	7.9 7.9	7.9	17.5	17.5	78.8 78.5	78.7	5.5 5.5 5.5	5.2	5.5	6	6	88	88	821064	805845	<0.2 <0.2 <0.2	14	1.4
					Bottom	6.6	0.2	36 38	29.4 29.4	29.4	7.9 7.9	7.9	19.7	19.7	78.7 79.1	78.9	5.4 5.4 5.4	7.3	1	7	ļ	92				<0.2	1.3	i
					Surface	1.0	0.3	12	29.7	29.7	7.9	7.9	18.7	10.7	81.7	81.5	5.6	2.3		6		83				<0.2	1.4	
IM7	Fine	Moderate	08:26	7.8	Middle	1.0 3.9	0.4	13 28	29.7 29.5	29.5	7.9 7.9	7.9	18.6 20.1		81.3 79.6	79.5	5.6 5.4	3.5	4.1	6	6	83 89	88	821329	806856	<0.2	1.3	1.4
					Bottom	3.9 6.8	0.1	29 15	29.4 29.1	29.2	7.9 7.9	7.9	20.1	23.0	79.3 67.3	67.6	5.4 4.6 4.6	3.5 6.3	1	7	-	89 91				<0.2	1.4	
					Surface	6.8 1.0	0.2	16 348	29.2 29.4	29.4	7.9 7.9	7.9	23.0 18.4	18.4	67.8 83.7	83.6	5.8	3.6		6		92 89				<0.2 <0.2	1.4	
IM8	Cloudy	Modorata	00:00	7.0		1.0 3.9	0.4	339 350	29.4 29.3		7.9 7.9		18.4 20.1		83.5 77.0		5.8 5.3	3.7		7 6	6	89 92	02	00100F	808116	<0.2	1.3	1.4
IIVIO	Cloudy	Moderate	08:09	7.8	Middle	3.9 6.8	0.3	334 308	29.3 29.2	29.3	7.9 7.9	7.9	20.1		77.1 79.4	77.1	5.3 5.4	3.2 4.5	3.8	6 7	°	93 95	92	821835	000110	<0.2 <0.2 <0.2	1.4 1.5	1.4
DA: Denth-Ave					Bottom	6.8	0.2	303	29.2	29.2	7.9	7.9	20.4	20.4	79.3	79.4	5.4 5.4	4.5		6		95				<0.2	1.5	

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 17 August 19 during

17 August 19 during Mid-Flood Tide

Water Qual	ity Monit	oring Resu	lts on		17 August 19	during Mid-	-Flood Ti	de																					
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	th (m)	Current Speed	Current	Water Ter	mperature (°C)		рН	Salir	nity (ppt)	DO Sati		Dissol Oxyg		Turbidity(	NTU)	Suspende (mg			Nkalinity om)	Coordinate HK Grid	Coordinate HK Grid	Chroi (µg		Nickel (µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average		Average		Average		DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value		Value DA
					Surface	1.0	0.4	299 285	29.4 29.4	29.4	7.9 7.9	7.9	18.0 18.0	18.0	79.5 79.3	79.4	5.5 5.5	5.1	3.6 3.7	E	4 5		89 90	1			<0.2	I 🗆	1.4
IM9	Cloudy	Moderate	08:01	7.5	Middle	3.8	0.3	265 271	29.3 29.3	29.3	7.8 7.8		21.0 21.1	21.1	68.7 68.5	68.6	4.7	5.1	6.1 6.1	5.9	6 4	- 5	93 93	92	822089	808793	<0.2	<0.2	1.4
					Bottom	6.5 6.5	0.1	277 284	29.2 29.2	29.2	7.9		21.6		69.0 69.2	69.1	4.7	4.7	7.9 7.8	-	7		94 94	+			<0.2		1.2
					Surface	1.0	0.2	298 317	29.3 29.3	29.3	7.9 7.9		20.7	20.7	78.4 78.4	78.4	5.4 5.4		3.0	-	5 4		88 88	-			<0.2		1.2
IM10	Cloudy	Moderate	07:52	7.1	Middle	3.6 3.6	0.2	341 359	29.0 29.1	29.1	7.9 7.9		21.8	21.8	73.5 73.6	73.6	5.0	5.2	3.8 3.8	3.7	4 6	6	92 93	92	822375	809805	<0.2	-0.2	1.3 1.4
					Bottom	6.1 6.1	0.2	356 358	29.0 28.9	29.0	7.9 7.9	7.0	22.0 22.1	22.1	74.4	71.3	4.9 4.9	4.9	4.3 4.4	Ī	9		94 94	1			<0.2	i E	1.2
					Surface	1.0	0.6	290 295	28.9	28.9	7.9	7.0	22.2	22.2	600	68.8	4.7		3.3 3.4	-	5		86 86	1			<0.2		1.4
IM11	Cloudy	Moderate	07:43	6.9	Middle	3.5	0.2	279 287	28.3	28.3	7.8	7.8	24.8	24.8	77.0	77.1	5.3	5.0	8.4 8.5	7.3	5	7	89 90	90	822038	811459	<0.2	-0.2	1.4 1.6
					Bottom	5.9 5.9	0.1	233 234	28.1	28.1	7.8	7.0	25.8	25.8	53.4 53.8	53.6	3.6	3.6	10.3	ļ	11		93	1			<0.2	T	1.0
					Surface	1.0	0.6	297 317	29.0	29.0	7.9 7.9	7.0	22.3 22.3	22.3	71.0	71.1	4.8		6.3		5		85 85				<0.2		1.6
IM12	Fine	Calm	07:38	6.8	Middle	3.4	0.5	312	28.4 28.4	28.4	7.9 7.9	7.0	24.2	24.2	63.3	63.3	4.3	4.6	7.6 7.6	7.9	8 7	7	88 89	89	821461	812026	<0.2	-0.2	1.5 1.5 1.5
					Bottom	3.4 5.8	0.5	341 358	28.3	28.3	7.9	7.0	24.6	24.6	62.2	62.2	4.2	4.2	9.7	ļ	9		92	1			<0.2	Ī	1.4
					Surface	5.8 1.0 1.0	0.1	329	28.3	29.6	7.9	7.0	18.9 18.9		78.7 78.7	78.7	5.4 5.4		3.0 3.0		7		92				<0.2		-
SR1A	Fine	Calm	06:43	5.1	Middle	2.6		-	29.6	-	7.9	-	- 18.9	-	-	-	5.4	5.4	-	5.3	8	7	-	1 .	819974	812656	-	í - 🖹	-
					Bottom	2.6 4.1	-	-	29.3	29.3	7.8		21.1	21.1	68.0	68.1	4.6	4.6	7.7	-	6						-	ı þ	
					Surface	1.0	0.6	279	29.3 29.5	29.5	7.8	7.0	21.1 19.4	19.4	68.1 80.1	80.1	4.6 5.5		7.7		5		83				<0.2	一	1.3
SR2	Fine	Calm	06:32	4.6	Middle	1.0	0.6	286	29.5	-	7.9	<b>.</b>	19.4	-	80.1	-	5.5	5.5	1.9	2.5	6	7	83	87	821465	814167	<0.2	<0.2	1.3
					Bottom	3.6	0.5	291	29.4	29.4	7.9		19.7	19.7	78.8	78.8	5.4	5.4	3.1		6		91				<0.2		1.4
					Surface	3.6 1.0	0.5	313 82	29.4 29.4	29.4	7.9	7.0	19.7	17.0	78.8 84.5	84.5	5.4 5.9		3.0 5.5		5		91				<0.2	一	1.3
SR3	Cloudy	Moderate	08:28	8.1	Middle	1.0 4.1	0.6	87 67	29.4 29.3	29.3	7.9 7.9	7.0	17.0 18.1	18.1	84.5 80.2	80.2	5.9 5.6	5.7	5.5 6.8	7.3	6	. 7	-	1 .	822140	807574	-	1 .	-
	,				Bottom	4.1 7.1	0.4	73 24	29.3	29.3	7.9	7.0	18.1	19.2	80.1 79.0	79.1	5.5 5.4	5.5	6.8 9.6	-	6 9						-	ı þ	-
					Surface	7.1	0.2	25 206	29.3	29.5	7.9	7.0	19.2	18.1	79.2 80.2	80.1	5.5 5.5		9.6		10 4						-	一	-
SR4A	Fine	Moderate	06:41	9.6	Middle	1.0 4.8	0.1	209 282	29.5 29.4	29.4	7.9 7.9	7.0	18.1 18.7	18.7	79.9 77.2	76.6	5.5 5.3	5.4	3.5 5.3	5.6	5 4	4	-	1 .	817206	807807	-	1 . F	≐ . '
					Bottom	4.8 8.6	0.2	288 240	29.4 29.4	29.4	7.9	7.0	18.7		75.9 72.6	72.7	5.2 4.9	5.0	5.2 8.2		4		-	1			-		- '
					Surface	8.6 1.0	0.0	248 243	29.4 29.5	29.5	7.9 7.9	7.0	20.8	18.2	81.1	81.1	5.0 5.6		8.2 3.2		5 5		-				-		-
SR5A	Fine	Moderate	06:25	4.9	Middle	1.0	0.1	243	29.5		7.9	1	18.2		81.0		5.6	5.6	3.2	4.6	6	. 6	-	.	816592	810682	-	1 . E	-
Sito.	1 110	moderate	00.20		Bottom	3.9	0.1	274	29.5	29.5	7.9		18.6	18.5	80.1	79.8	5.5	5.5	6.0		7		-		010002	010002	-	ıE	-
					Surface	3.9 1.0	0.1	255 249	29.5 29.5	29.5	7.9 7.9	7.0	18.5 18.3	40.2	79.5 77.8	77.6	5.5 5.4	0.0	6.0 3.5		6						-	H	-
SR6A	Fine	Moderate	05:51	5.2	Middle	1.0	0.1	244	29.5	-	7.9	1.0	18.3		77.4		5.3	5.4	3.5	5.9	-	. 7	-	1.	817978	814757	-	ı . E	-
GROA	1 110	Woderate	00.01	5.2	Bottom	4.2	0.0	277	29.5	29.5	7.9		20.2	20.2	75.7	76.0	5.2	5.2	8.3	5.5	7		-		017370	014757	-	ıĿ	-
					Surface	1.0	0.0	283 326	29.5 29.0	29.0	7.9 7.9	7.0	20.1		76.3 88.1	88.1	5.2	5.2	8.4 1.8		8		-				-		-
SR7	Fine	Calm	05:45	16.4	Middle	1.0 8.2	0.2	357 240	29.0 27.6	27.6	7.9 7.8		21.5 26.8	26.8	88.1 61.1	61.1	5.8 4.3	5.1	1.7 2.8	2.6	7 5		-		823651	823748	-		-
387	rifle	Galiii	05.45	10.4	Bottom	8.2 15.4	0.1	243 232	27.6 27.2	27.5	7.8 7.7	7.0	26.8 28.1	28.1	61.1 59.3	59.4	4.3 4.0	4.0	2.9 3.1	2.0	5 7	. "	-	1	023031	023/40	-	ı F	-
						15.4 1.0	0.0	239	27.2 29.2		7.7 7.9	1	28.1		59.4 69.5		4.0	4.0	3.0 5.7		7 10		-				-	$\vdash$	=
000	F	Madami	00.55	4.0	Surface	1.0	-	-	29.2	29.2	7.9		21.4	21.4	69.4	69.5	4.7	4.7	5.7	[	10		-	]	200.405	044005	-	ιF	-
SR8	Fine	Moderate	06:52	4.8	Middle	3.8	-	-	28.4	-	7.9	1	24.6	-	- 59.8	-	4.1		10.0	7.9	- 15	13	-	1	820406	811608	-	,	-
					Bottom	3.8	-	-	28.4	28.4	7.9		24.7		59.7		4.1	4.1	10.0		15		-				-	علسن	-

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 20 August 19 during

20 August 19 during Mid-Ebb Tide

Water Qual	lity Monite	oring Resu	lts on		20 August 19	during Mid-	Ebb Tid	е																			
Monitoring	Weather	Sea	Sampling	Water	Sampling D	enth (m)	Current Speed	Current	Water Te	emperature (°C	)	pН	Salinity (ppt)	DO S	Saturation (%)	Dissolved Oxygen	Turbidit	y(NTU)	Suspende (mg		Total All		Coordinate HK Grid	Coordinate HK Grid	Chrom (µg/l		Nickel (µg/L)
Station	Condition	Condition	Time	Depth (m)	Camping 2	opur (iii)	(m/s)	Direction	Value	Average	Value	Average	Value Average	Value	Average	Value D/	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA Va	/alue DA
					Surface	1.0	0.3	226 227	27.4 27.4	27.4	7.8	7.8	28.7 28.7	78.9 78.9	78.9	5.3 5.3	4.8		3		83 84				<0.2		1.3
C1	Sunny	Rough	15:09	7.5	Middle	3.8 3.8	0.3	208 219	28.1 28.1	28.1	7.8 7.8	7.8	25.5 25.5 25.5	60.5 60.5	60.5	4.1 4.1	5.9 5.9	7.2	4 5	5	87 88	87	815622	804255	<0.2		1.3 1.4
					Bottom	6.5 6.5	0.3	237 222	26.9 26.9	26.9	7.7	7.7	31.0 31.0 31.0	56.0 56.5	56.3	3.8 3.8	10.0		5	1	91 91				<0.2	1	1.3
					Surface	1.0	0.3	149	28.7	28.7	8.1	8.1	19.3	73.4	73.5	5.1	2.8		5		85				<0.2	_ 1	1.6
C2	Cloudy	Moderate	14:00	12.1	Middle	1.0 6.1	0.3	161 146	28.7 27.7	27.7	8.1 8.1	8.1	19.2 23.9 23.9	73.5 62.5	62.5	5.1 4.3	4.2	7.1	6	6	85 86	87	825661	806923	<0.2	-0.2	1.5 1.5 1.5
	,				Bottom	6.1 11.1	0.4	158 136	27.7 27.4	27.4	8.1 8.1	8.1	23.9 25.2	62.5 60.3	60.4	4.3 4.1 4.1	4.2		5 7	1	87 89				<0.2 <0.2	1	1.5
					Surface	11.1	0.3	138 111	27.4 27.6	27.6	8.1 8.3	8.3	25.2 25.2 25.4 25.4	60.5 77.0	77.0	4.2 <sup>4</sup> 5.3	14.1		- 8 - 5		90 85				<0.2		1.5
						1.0 5.5	0.1	121 137	27.6 26.5		8.3 8.4		25.4	76.9 65.3		5.3 4.5	1.7	7	5 6	Ī _	86 88				<0.2		1.0
C3	Cloudy	Moderate	16:30	11.0	Middle	5.5 10.0	0.3	152 111	26.5 25.2	26.5	8.4	8.4	28.3	65.1 59.1	65.2	4.5	2.4	2.4	7	7	88 89	88	822096	817791	<0.2	<0.2	1.0
					Bottom	10.0	0.2	113 214	25.2	25.2	8.4	8.4	31.7 31.7	59.5	59.3	4.1 4.1	3.1		9		89				<0.2	1	1.1
					Surface	1.0	0.2	211	29.0	29.1	7.8	7.8	21.1	74.7	74.7	5.1	2.6		3		83				<0.2	1	1.4
IM1	Sunny	Moderate	14:40	4.9	Middle	-	-	-	-	-	-	-		-		- "	-	4.1	-	5	-	87	817945	807142	-	<0.2	1.4
					Bottom	3.9	0.0	241 256	28.1 28.2	28.2	7.8	7.8	26.0 26.0 26.0	65.0 65.5	65.3	4.4 4.4	5.6		7 8		91 92				<0.2	1	1.4 1.5
					Surface	1.0	0.3	204 218	29.1 29.0	29.1	7.8	7.8	20.8 20.8	76.4 76.4	76.4	5.2 5.2 4.5	2.6		3		83 84				<0.2		1.4
IM2	Sunny	Moderate	14:35	7.0	Middle	3.5 3.5	0.5	130 131	28.4 28.3	28.4	7.8	7.7	24.0 24.0	66.1 66.1	66.1	4.5 4.5	2.7	3.7	4	4	88 88	88	818166	806162	<0.2		1.3 1.4
					Bottom	6.0	0.2	156 147	27.6 27.6	27.6	7.7	7.7	28.5 28.5	59.3 59.9	59.6	4.0 4.0	5.9	1	4	1	91 91				<0.2	_1	1.4
					Surface	1.0	0.4	147 155	29.0 29.0	29.0	7.8	7.8	21.2 21.2 21.2	75.4 75.3	75.4	5.2	2.5		12		80				<0.2	1	1.4
IM3	Fine	Moderate	14:29	7.1	Middle	3.6 3.6	0.4	130	27.9 27.9	27.9	7.7	7.7	27.2 27.2 27.2	61.8 62.0	61.9	4.2	3.4	4.1	10	9	88 88	86	818783	805598	<0.2	-0.2	1.5
					Bottom	6.1	0.4	143	27.5	27.5	7.7	7.7	29.1	53.6	53.8	3.6	6.3		9	1	91				<0.2	_1	1.4
					Surface	6.1 1.0	0.3	134 152	27.5 28.6	28.6	7.7	7.8	29.0 23.0	54.0 65.0	65.0	3.6	6.3		5 6		91 83				<0.2	1	1.3
IM4	Fine	Moderate	14:20	8.0	Middle	1.0 4.0	0.7	144 134	28.6 27.6	27.6	7.8 7.8	7.8	23.0	64.9 76.4	76.4	5.2 4.8	7.1	6.8	6 5	5	83 88	87	819714	804628	<0.2	-02 1	1.1
1101-4	T IIIC	Woderate	14.20	0.0	Bottom	4.0 7.0	0.6	131 122	27.6 27.3	27.3	7.8 7.8	7.8	27.7	76.4 53.5	53.8	5.2 3.6 3.0	7.2	0.0	5 3		88 91		013/14	004020	<0.2	1	1.2
					1	7.0 1.0	0.4	132 152	27.3 28.8		7.8		29.4	54.1 77.4		3.6 5.3	10.1		4		91 83				<0.2		1.2
					Surface	1.0	1.0	153 153	28.8 27.7	28.8	7.8 7.8	7.8	22.5	77.1 68.1	77.3	5.3 4.6	2.6	7	5 6		84 88				<0.2	1	1.1
IM5	Fine	Moderate	14:11	7.7	Middle	3.9	0.8	157 140	27.8	27.8	7.8	7.8	27.6	68.5 52.6	68.3	4.6	7.3	6.4	6	6	89 91	88	820746	804867	<0.2	<0.2	1.2 1.2 1.2
					Bottom	6.7	0.6	142	27.4	27.4	7.8	7.8	29.3	52.9 64.5	52.8	3.6 3.0	9.4	1	7		92				<0.2	1	1.1
					Surface	1.0	0.3	167	28.1	28.1	7.8	7.8	26.4 26.4	64.6	64.6	4.4	, 3.6		11		87				<0.2	1	1.7
IM6	Fine	Moderate	14:05	7.8	Middle	3.9 3.9	0.2	165 166	27.7 27.7	27.7	7.8 7.8	7.8	27.9 27.9 27.9	72.3 72.4	72.4	4.9 4.9	5.5 5.4	5.9	8	9	88 88	88	821083	805818	<0.2	1	1.7 1.7
					Bottom	6.8	0.1	140 147	27.5 27.5	27.5	7.8	7.8	28.8 28.8 28.8	68.9 68.9	68.9	4.6 4.6	8.6		8		92 92				<0.2	1	1.7 1.6
					Surface	1.0	0.0	177 180	29.1 29.0	29.1	7.8 7.8	7.8	20.2 20.3	70.6 70.6	70.6	4.9	3.9		5 6	1	83 84				<0.2		1.8
IM7	Fine	Moderate	13:58	7.2	Middle	3.6 3.6	0.5 0.5	165 168	28.6 28.5	28.6	7.8	7.8	23.1 23.1	65.3 65.2	65.3	4.5 4.5	6.0	7.0	5	5	87 87	87	821350	806851	<0.2	-02 1	1.6 1.7
					Bottom	6.2	0.4	170 175	27.9 27.9	27.9	7.8	7.8	27.3 27.3 27.3	55.1 55.2	55.2	3.7 3.7	11.1	1	4	1	91 92				<0.2	1	1.7
					Surface	1.0	0.2	184 188	28.7	28.7	8.2 8.2	8.2	19.7 19.8 19.7	74.9 74.8	74.9	5.2	2.9	1	3 4		85 86				<0.2	1	1.4
IM8	Cloudy	Moderate	14:31	7.6	Middle	3.8	0.2	175	28.7	27.9	8.2	8.2	23.1	64.5	64.5	5.2 4.5	4.7	4.9	5	6	88	88	821827	808144	<0.2	-0.2	1.4
					Bottom	3.8 6.6	0.4	179 155	27.9 27.6	27.6	8.2 8.2	8.2	27.0	64.5 62.2	62.5	4.5 4.2 4.3	4.7	1	9	1	89 89				<0.2	1	1.4
DA: Depth-Aver					Dottom	6.6	0.3	157	27.6	21.0	8.2	0.2	27.0	62.7	02.0	4.3	7.0	<u> </u>	10		90				<0.2		1.3

during Mid-Ebb Tide Water Quality Monitoring Results on 20 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Value Average Average 0.3 1.4 188 74.0 1.0 0.3 28.3 8.2 21.0 5.1 8.7 4 86 <0.2 1.4 3.9 0.4 179 27.7 8.2 62.0 62.2 4.3 7.0 11 88 89 <0.2 1.3 IM9 Cloudy Moderate 14:37 7.7 Middle 24.1 12 88 822109 808819 <0.2 3.9 182 27.8 6.7 0.4 6.7 0.3 169 27.4 4.1 22 89 <0.2 1.4 8.2 26.3 59.8 19.2 Bottom 27.4 8.2 26.3 59.9 4.1 4.1 26.3 6.7 0.3 174 27.4 82 60.0 19 1 21 14 89 <0.2 0.3 208 28.4 3.7 8.2 4.9 1.4 Surface 28.4 21.1 70.2 8.2 21.1 70.1 4.9 85 1.4 1.0 0.3 213 28.4 3.8 6 < 0.2 0.2 27.9 27.9 1.3 4.1 23.0 23.1 67.8 67.9 88 88 <0.2 214 8.2 4.7 4.3 IM10 Cloudy Moderate 14:45 8.1 Middle 27.9 8.2 23.0 67.9 88 822402 809774 <n 2 4.2 14 7.1 0.2 183 27.1 8.3 63.3 4.4 9.5 90 < 0.2 1.3 25.8 63.5 4.4 Bottom 27.1 8.2 25.8 7.1 0.2 199 27.1 8.2 25.9 63.6 4.4 9.8 15 90 < 0.2 1.3 1.0 0.2 205 27.5 7.0 86 1.4 8.2 72.6 5.0 24.5 6 <0.2 Surface 27.5 8.2 24.5 72.9 1.0 0.2 221 27.4 8.2 73.2 5.0 7.1 6 86 <0.2 1.4 1.3 4.3 0.1 238 27.3 8.3 25.2 25.1 62.9 63.7 4.3 4.9 88 <0.2 IM11 Cloudy 822039 811471 Moderate 14:58 8.6 Middle 27.4 8.3 25.2 63.3 88 <0.2 4.3 0.1 8.3 89 1.4 27.4 <0.2 243 7.6 26.8 8.3 26.9 61.5 10.2 <0.2 1.4 4.2 Rottom 26.8 8.3 26.9 61.6 7.6 0.1 186 26.8 8.3 26.9 61.7 4.2 10.1 11 90 1.4 256 27.5 8.2 24.9 24.9 69.0 69.2 3.7 85 <0.2 1.2 Surface 27.5 8.2 24.9 69.1 1.0 0.1 27.5 8.2 4.8 3.6 9 85 <0.2 1.1 4.7 0.1 246 27.1 64.2 4.4 11.7 10 88 <0.2 1.2 Middle 64.4 821471 812023 IM12 Cloudy Moderate 15:05 27.2 8.3 26.5 4.7 0.1 27.2 8.3 64.6 4.4 11.6 11 89 1.2 8.4 0.1 207 26.5 8.3 60.2 41 6.7 12 90 <0.2 1.2 Bottom 26.5 8.3 27.8 60.3 4.2 60.4 8.4 0.1 203 26.5 8.3 27.8 4.2 6.7 12 90 < 0.2 1.2 1.0 28.4 8.2 22.1 75.5 5.2 3.7 Surface 28.4 8.2 22.1 75.5 1.0 28.4 8.2 22.1 75.4 5.2 3.6 5 2.6 Cloudy Calm 15:40 Middle 819970 812656 2.6 4.1 26.4 8.2 59.0 4.1 9.1 14 4.1 Bottom 26.4 8.2 28.2 59.2 4.1 26.4 8.2 28.2 59.4 4.1 9.2 15 1.0 0.4 235 28.2 8.3 23.7 73.0 4.2 84 <0.2 1.2 Surface 28.2 8.3 23.8 73.0 1.0 0.4 224 28.2 8.3 23.8 72.9 5.0 4.3 8 85 <0.2 1.2 SR2 Cloudy Moderate 16:06 5.2 Middle 821480 814147 <0.2 1.2 258 28.1 62.1 62.4 1.3 Bottom 26.5 28.1 62.3 4.3 42 0.3 229 26.4 8.3 4.3 77 14 88 <0.2 1.2 1.0 0.1 169 28.5 8.2 20.6 72.0 5.0 7.3 6 8.2 20.6 72.2 1.0 0.1 150 28.5 8.2 20.6 72.3 5.0 7.3 6 4.5 0.3 158 27.8 8.2 23.0 64.7 4.5 6.3 6 SR3 Moderate 14:26 8.9 23.0 64.7 822160 807573 Cloudy 4.5 0.3 162 27.7 8.2 23.0 64.6 4.5 6.6 7 0.4 27.3 27.4 8.2 8.2 60.1 10.2 7.9 7.9 152 153 4.1 11 Bottom 8.2 60.3 4.1 4.1 1.0 0.7 73 28.8 7.8 22.6 73.2 73.0 5.0 4.9 14 Surface 28.8 7.8 22.6 73.1 1.0 0.7 77 7.8 22.6 5.0 4.9 13 28.8 -4.3 0.7 59 4.3 6.9 28.2 7.8 25.3 63.0 7.8 807830 SR4A Sunny Moderate 15:37 8.5 Middle 28.2 25.4 62.9 10 817207 4.3 0.7 60 7.8 25.5 4.3 6.9 28.2 62.8 0.2 27.9 65 27.1 57.9 58.5 3.9 8.5 Rottom 27.9 7.7 27.1 58.2 3.9 7.5 27.9 29.4 7.7 0.2 66 27.1 3.9 8.5 110 1.0 0.4 7.8 7.0 5.3 21.8 77.9 Surface 29.4 7.8 21.8 77.8 1.0 0.4 116 29.4 7.8 21.9 77.7 5.3 7.0 9 SR5A 15:50 4.7 Middle 816572 810713 Sunny Moderate 3.7 0.3 118 29.3 7.4 10 7.8 78.9 5.3 22.0 Bottom 29.3 7.8 22.0 79.1 5.4 3.7 0.3 129 29.3 10 7.8 3.0 79.6 Surface 29.4 7.8 21.8 79.5 29.4 3.1 SR6A Moderate 16:17 4.3 Middle 817971 814751 Sunny 0.1 74 28.5 4.8 Bottom 7.8 0.1 77 28.4 1.0 0.2 70 26.5 8.3 27.6 75.8 5.2 4.8 Surface 8.3 1.0 0.3 74 26.5 8.3 76.9 5.3 5.1 79 0.3 80 25.7 8.3 31.2 74.2 5.2 4.6 6 SR7 Cloudy Moderate 16:58 Middle 74.2 823654 823744 79 0.3 86 25.8 8.3 31.0 74 1 5.1 4.5 6 14.8 0.2 67 24.9 8.4 32.4 51.5 3.6 6.0 6 Bottom 51.6 14.8 0.2 69 24.9 8.4 51.7 3.6 5.9 27.5 27.5 1.0 24.9 24.9 66.7 66.6 3.6 3.7 Surface 27.5 8.2 46 --SR8 Cloudy Calm 15:15 5.6 Middle 820374 811628 4.6 26.8 62.3 4.7 10 8.2 26.7 4.3 Bottom 26.9 8.2 26.7 62.5 4.3 26.9

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 20 August 19 during

20 August 19 during Mid-Flood Tide

Martin	Water Qua	ity Monit	oring Resu	lts on		20 August 19	during Mid-	Flood Ti	de																					
March   Marc		Weather	Sea	Sampling	Water	Sampling Dep	th (m)			Water Ter	mperature (°C)		рН	Sal	nity (ppt)					Turbidity(	NTU)									el (µg/L)
Martin	Station	Condition	Condition	Time	Depth (m)			. ,			Average		Avera	_	Average		Average		DA		DA		DA		DA	(Northing)	(Easting)			
Marchan   Marc							1.0	0.4	40	28.9		7.8	1	22.1		69.9		4.8	4.6	3.0		5		85				<0.2	1.4	
Marie   Mari	C1	Cloudy	Rough	09:02	8.5		4.3	0.4	51	28.2		7.8		25.3		65.4		4.5		4.4	4.5	5	5	88	88	815613	804268	<0.2	<0.2	1.3
Martin   M						Bottom	7.5	0.2	58	27.7	27.7	7.8	7.8	28.1	28.1	54.6	54.5	3.7	3.7	6.2		6		92				<0.2	1.3	
Martin   M						Surface	1.0	0.4	322	28.8	28.8	8.1	8.1	19.1	19.1	75.3	75.5	5.2	4.8	2.8	þ	4		86				<0.2	1.8	
Couly   Modern   Mo	C2	Cloudy	Moderate	10:43	12.4	Middle	6.2	0.4	353	27.8	27.8	8.2	8.2	23.5		62.5	62.6	4.3		3.7	8.0	6	7	89	88	825689	806939	<0.2	1.6	I '''
Martin   M						Bottom	11.4	0.2	34	27.3	27.3	8.2		25.5	25.5	60.4	60.3	4.2	4.2	17.3		10		90				<0.2	1.7	
Martin   M						Surface	1.0	0.6	276	27.9	27.9	8.1	8.1	22.5	22.6	70.7	70.8	4.9	4.6	2.5	-	3		86				<0.2	1.4	
M. Croop Rough (1) (2) (3) (3) (3) (3) (4) (5) (4) (5) (4) (5) (5) (5) (5) (7) (7) (7) (7) (7) (7) (7) (7) (7) (7	С3	Cloudy	Moderate	08:26	11.2	Middle	5.6	0.7	262	26.5	26.5	8.1	8.1	27.8	27.8	60.7	60.7	4.2		2.3	4.3	6	5	89	88	822113	817813	<0.2	1.4	] '.4
Martin   M						Bottom	10.2	0.4	301	25.8	25.8	8.1		29.6		59.7	59.5	4.1	4.1	8.0		6		91				<0.2	1.3	
Miles   Marie   Mari						Surface	1.0	0.5	328	28.5	28.5						68.5	4.6	4.7	3.3		4						<0.2	1.5	
Moderate   Moderate	IM1	Cloudy	Rough	09:30	5.7	Middle	-	-	-	-	-	-	-	-	-	-	-	-		-	6.6	-	5		86	817945	807154		<0.2	
Moderate   Disable   Dis						Bottom	4.7	0.3	323	27.8	27.8	7.8		27.5	27.5	56.5	56.3	3.8	3.8	10.0	-	5		88				<0.2	1.4	
Moderate Posts Pos						Surface	1.0	0.4	20	28.4	28.4	7.8		24.6	24.5	64.9	65.1	4.4	4.9	2.7	-	2		86				<0.2	1.3	
May Couly Moderate 09.41 7.3   Sufface 1.0 0.4 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.0 0.5 1.3 1.3 1.3 1.3 1.3 1.3 1.3 1.3 1.3 1.3	IM2	Cloudy	Moderate	09:35	7.5	Middle	3.8	0.4	13	27.9	27.9	7.8		27.3	27.3	79.3	79.1	5.4		7.9	6.4	3	3	89	88	818156	806185	<0.2	1.4	1.3
Mage   Mage						Bottom	6.5	0.3	326	27.6	27.6	7.8	7.8	28.5		56.4	56.1	3.8	3.8	8.8	-	<2		89				<0.2	1.2	
Moderate   Moderate						Surface	1.0	0.5	330	28.5	28.6	7.8		23.7	23.6	71.7	71.7	4.9	4.8	2.7	-	2		85				<0.2	1.3	
M4 Cloudy Moderate 09.57 7.8   Sufface 1.0 0.6 3 507 26.7   7.8 7.8 7.8 7.8 7.8 7.8 7.8 7.8 7.8 7.8	IM3	Cloudy	Moderate	09:41	7.3	Middle	3.7	0.5	328	28.5	28.5	7.8		24.1	24.1	66.9	67.0	4.6		2.9	3.3	3	3	88	88	818768	805586	<0.2	1.3	1.3
Martin   M						Bottom	6.3	0.3	312	27.7	27.7	7.8	7.8	28.0		55.9	55.6	3.8	3.8	4.3		3		91				<0.2	1.4	
Middle 139 0.6 339 0.6 339 283 283 78 78 78 245 245 646 44 44 3.2 3.2 3.8 3.3 2 88 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8						Surface	1.0	0.8	328	28.7	28.7	7.8		23.2	23.1	72.5	72.5	4.9	4.7	2.7	E	2		85				< 0.2	1.4	
Surface   10.0   10.0   10.0   338   284   28.4   28.4   28.5	IM4	Cloudy	Moderate	09:57	7.8	Middle	3.9	0.7	312	28.2	28.3	7.8		24.6		64.4	64.5	4.4		3.2	3.3	3	2	87	87	819705	804602	<0.2	<0.2	1.3
Moderate   10.04   Noderate   10.04   Noderate   10.04   Noderate   10.04   Noderate   10.04   Noderate   10.04   Noderate   10.05   Noderate   10.07   Noderate						Bottom	6.8	0.6	356	27.6	27.6	7.8		28.6	28.4	56.1	56.2	3.8	3.8	3.8		2		90				<0.2	1.3	
Moderate   10:14   7.9   Middle   4.0   0.8   325   27.6   7.8   7.8   28.1   28.1   68.9   68.9   4.7   7.5   7.5   7.5   7.5   7.5   3   3   90   90   90   90   90   90						Surface	1.0	1.0	346	28.3	28.4	7.8	7.8	24.3	24.3	65.4	65.3	4.5	4.6	5.4	E	3		85				<0.2	1.1	
Surface   10   Surface   10   10   10   10   10   10   10   1	IM5	Cloudy	Moderate	10:04	7.9	Middle	4.0	0.8	325	27.6	27.6	7.8	7.8	28.1		68.8	68.9	4.7		7.6	7.7	3	3	90	89	820719	804868	<0.2	1.0	I '''
Magrate   Magr						Bottom	6.9	0.6	5	27.3	27.3	7.8		29.7	29.7	55.4	55.4	3.7	3.7	10.1		2		90				<0.2	1.2	
M6   Moderate   10:12   8.0   Middle   4.0   0.4   353   27.9   27.9   7.8   7.8   26.4   26.4   67.2   67.2   4.6   12.7   11.1   4   4   88   89   89   80   80823   40.2   4						Surface	1.0	0.4	356	28.7	28.8	7.8	7.8	22.4	22.4	68.8	68.9	4.7	4.7	5.7	E	4		85				<0.2	1.2	
Sufface   Figure	IM6	Cloudy	Moderate	10:12	8.0	Middle	4.0	0.5	325	27.9	27.9	7.8	7.8	26.4	26.4	67.2	67.2	4.6		12.7	11.1	3	4	89	88	821078	805823	<0.2	<0.2	1.2
Surface   1.0						Bottom	7.0	0.3	15	27.7	27.7	7.8		28.1		55.1	55.1	3.7	3.7	15.1		4		89				<0.2	1.2	
M7 Cloudy Moderate 10:17 7.5 Middle 3.8 0.3 94 28.4 7.8 7.8 7.8 24.2 24.3 64.8 64.8 4.4 65.5 6.5 6.6 3 3 88 82134 86833 0.2 0.2 0.2 1.1 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1.2 1						Surface	1.0	0.0	21	29.0	29.1	7.8	7.8	20.3	20.3	71.1	71.2	4.9	47	3.9	Ŀ	<2		85				<0.2	1.2	
Moderate   10:17   7.9   Middle   4.0   0.2   109   28.0	IM7	Cloudy	Moderate	10:17	7.5	Middle	3.8	0.3	98	28.4	28.4	7.8	7.8	24.3		64.7	64.8	4.4		6.5	6.6	2	3	90	88	821342	806833	<0.2	<0.2	1.2
Male Cloudy Moderate 10:17 7.9 Middle 10:10 0.1 42 28.5 28.5 8.1 8.1 19.5 19.5 74.9 74.9 5.2 4.7 4.8 6 7 88 82181 80:15 4.2 4.2 4.2 4.1 4.4 6.4 8 8 90 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.9 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 7 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 4.4 6.3 8 80:15 4.2 4.2 4.4 8.4 6.3 8 80:15 4.2 4.2 4.4 8.4 6.3 8 80:15 4.2 4.2 4.4 8.4 8.4 8.4 8.4 8.4 8.4 8.4 8.4 8.4						Bottom	6.5	0.3	79	28.0	28.0	7.8	7.8	25.0	24.9	62.2	62.3	4.2	4.3	9.3		4		90				<0.2	1.2	
M8 Cloudy Moderate 10:17 7.9 Middle 4.0 0.2 100 28.0 28.0 8.1 8.1 22.5 2.5 65.6 65.6 4.5 4.7 4.8 6 7 88 821813 808155 <0.2 <0.2 1.3 1.3 1.3 1.3 1.3 1.3 1.3 1.3 1.3 1.3						Surface	1.0	0.1	42	28.5	28.5	8.1	8.1	19.5		74.9	74.9	5.2	49	3.2		6		85				<0.2	1.2	I
6.9 0.3 94 27.8 8.1 8.1 24.1 24.1 64.2 64.4 4.4 6.3 7 90 <a href="#">&lt;<a href="#">&lt;<a href="#"></a></a></a> <td>IM8</td> <td>Cloudy</td> <td>Moderate</td> <td>10:17</td> <td>7.9</td> <td>Middle</td> <td>4.0</td> <td>0.2</td> <td>109</td> <td>28.0</td> <td>28.0</td> <td>8.1</td> <td>8.1</td> <td>22.5</td> <td></td> <td>65.5</td> <td>65.6</td> <td>4.5</td> <td>4.3</td> <td>4.8</td> <td>4.8</td> <td>6</td> <td>7</td> <td>88</td> <td>88</td> <td>821813</td> <td>808155</td> <td>&lt;0.2</td> <td>&lt;0.2</td> <td>1.3</td>	IM8	Cloudy	Moderate	10:17	7.9	Middle	4.0	0.2	109	28.0	28.0	8.1	8.1	22.5		65.5	65.6	4.5	4.3	4.8	4.8	6	7	88	88	821813	808155	<0.2	<0.2	1.3
A · Denth-Averaged						Bottom					27.8		8.1		24.1		64.2		4.4			8								

during Mid-Flood Tide Water Quality Monitoring Results on 20 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Average 0.3 1.0 0.4 56 28.6 8.1 19.3 75.7 5.3 3.0 85 <0.2 1.2 4.9 3.7 0.2 18 27.9 8.2 65.3 65.3 4.5 4.5 7.0 6 87 87 <0.2 1.3 IM9 Cloudy Moderate 10:10 7.4 Middle 7.9 87 822101 808791 <0.2 0.2 27.9 6.9 18 6.4 0.2 292 27.6 64.2 64.4 13.7 22 89 < 0.2 1.3 8.2 24.2 4.4 Bottom 27.6 8.2 24.2 64.3 4.4 8.2 4.4 0.2 27.6 24.2 13.7 24 89 1 4 6.4 298 <0.2 306 28.3 1.3 8.2 5.2 Surface 28.3 21.3 75.8 8.2 21.3 75.7 5.2 85 1.3 1.0 0.8 311 28.3 2.7 4 < 0.2 0.6 27.8 27.8 1.2 4.1 300 305 69.9 69.8 3.9 88 88 <0.2 8.2 4.8 4 IM10 Cloudy Moderate 10:02 8.2 Middle 27.8 8.2 22.9 69.9 88 822385 809814 <0.2 7.2 0.4 307 27.2 8.2 63.4 4.4 9.4 8 89 <0.2 1.3 25.5 27.2 8.2 25.5 63.5 4.4 Bottom 7.2 0.4 316 27.2 8.2 63.6 4.4 9.3 8 90 < 0.2 1.4 1.0 0.6 278 27.7 2.9 86 1.3 8.1 72.2 5.0 4 23.5 <0.2 Surface 27.7 8.1 23.4 72.4 1.0 0.6 304 27.7 8.1 23.4 72.5 5.0 3.0 4 86 <0.2 1.2 1.2 4.6 0.4 282 27.1 8.2 26.0 25.9 4.3 7.2 88 <0.2 62.1 IM11 Cloudy 822078 811458 Moderate 09:52 9.1 Middle 27.1 8.2 25.9 62.2 88 <0.2 4.6 0.4 89 1.2 27.1 <0.2 8.1 26.8 8.2 27.2 59.9 60.0 15 <0.2 1.2 Rottom 26.8 8.2 27.2 60.0 41 8.1 0.2 312 26.8 8.2 4.1 11.1 16 91 1.2 27.7 8.1 69.8 69.8 87 <0.2 1.3 23.5 Surface 27.7 8.1 23.5 69.8 1.0 0.5 263 27.7 8.1 23.5 4.8 2.7 6 87 <0.2 1.4 4.5 0.3 278 26.8 4.4 14.8 12 88 <0.2 1.2 63.3 Middle 63.3 821444 812059 IM12 Cloudy Moderate 09:45 26.9 8.1 26.5 4.5 0.4 26.9 8.1 4.4 14.5 12 21 88 1.3 79 0.3 287 26.6 8.2 56.2 3.9 15.2 90 <0.2 1.2 Bottom 26.6 8.2 27.3 56.3 3.9 27.3 56.3 3.9 7.9 0.3 288 26.6 8.2 15.3 18 90 <0.2 1.3 1.0 28.3 8.1 21.2 73.2 5.1 5.6 <2 Surface 28.3 8.1 21.1 73.3 1.0 28.3 8.1 21.1 73.4 5.1 5.6 3 2.7 SR1A Cloudy Calm 09:07 5.4 Middle 819978 812654 2.7 28.0 28.0 65.1 65.2 4.5 4.5 9.7 10.0 11 10 4.4 22.8 Bottom 28.0 8.1 22.8 65.2 4.5 44 8.1 1.0 0.1 138 28 1 8 1 21.8 75.0 5.2 5.1 84 <0.2 13 Surface 28.1 8.1 21.8 75.1 1.0 0.1 5.2 12 143 8.1 75.2 5.1 3 85 28.0 21.8 < 0.2 -SR2 Cloudy Calm 08:46 4.4 Middle 821455 814176 3.4 0.3 198 8.1 27.8 27.8 63.7 64.2 4.4 6.5 88 <0.2 1.3 Bottom 26.5 8.1 27.8 64.0 4.4 0.3 212 8.1 4.4 6.1 1.3 26.5 88 < 0.2 1.0 0.1 209 28.6 4.5 8.1 19.0 75.3 5.3 4 Surface 28.6 8.1 19.0 75.3 1.0 0.1 8.1 75.2 4.8 228 28.5 19.1 5.3 4.6 5.2 27.9 8.2 23.4 62.5 4.3 SR3 10:23 Middle 27.9 62.5 822151 807549 Cloudy Moderate 9.2 8.2 23.4 4.6 0.2 100 27.9 8.2 23.3 62.5 4.3 5.1 . 17 8.2 0.4 27.4 8.2 25.9 25.9 57.7 57.8 4.0 16.7 53 57.8 4 0 Rottom 27 4 8.2 25.9 16 0.2 262 29.0 7.8 4.7 5.6 22.0 69.0 Surface 29.0 7.8 22.0 68.9 1.0 28.9 4.7 5.9 0.2 280 4.9 0.1 4.6 8.3 65 28.2 7.8 26.2 67.1 SR4A Cloudy Moderate 08:28 9.8 Middle 28.2 7.8 26.1 67.0 817212 807806 4.9 0.1 66 28.2 7.8 4.6 8.3 8.8 0.2 7.8 28.2 52.4 3.5 8.0 Bottom 27.7 7.8 28.2 52.4 3.5 8.8 27.7 0.2 1.0 0.2 267 29.0 7.8 4.8 5.0 22.5 70.1 Surface 29.0 7.8 70.1 22.5

7.8

7.8

7.8

7.8

7.8 7.8

8.0

8.0

8.0

8.0

8.0

8.1

8.1

8.0

8.0

8.0

8.1

8.1

27.9

27.1

26.1

27.6

27.1

24.0

21.2

21 2

22.8

25.5 25.5

29.0 29.0

24.7 24.6

26.0

70.1

65.3

74.1

74 1

73.8 74.0

72.5 72.5

75.1 75.2

58.1 58.3

66.5 66.3

60.0

22.8

25.5

29.0

24.7

25.9

73.9

72.5

75.2

58.2

66.4

60.3

4.8

4.4

11

5.1

5.1

5.1 5.1

5.0

5.2 5.2

4.0

4.6

4.6 46

4.4

4.0 4.0

4.2

5.0

5.7

5.7

3.2

3.2

4.8

4.8

2.4

2.4

2.4

2.4

2.9

2.9

5.5 5.4

9.4

4

4

3

4

3

2

<2

5 4

810714

814752

823738

811638

817971

823628

820406

-

-

-

-

-

-

DA: Depth-Averaged

SR6A

SR7

SR8

Cloudy

Cloudy

Cloudy

Cloudy

Moderate

Moderate

Moderate

Calm

08:13

07:45

07:57

09:36

5.2

15.4

5.6

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined 1.0

4.3

4.3

1.0

1.0

4.2

4.2

1.0

1.0

7.7

7.7

14.4

14.4

1.0

Middle

Bottom

Middle

Bottom

Surface

Middle

Bottom

Surface

Middle

Bottom

0.3

0.1

0.2

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.3

0.3

274

295

314

186

199

194

212

212

212

291

312

33

33

29.0

28.7

28.7

29.0

29.0

28.9

28.9

27.9

27.9

27.1

27.1

26.1

26.1

27.6 27.6

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 22 August 19 during

22 August 19 during Mid-Ebb Tide

Water Qual	ity Monit	oring Resu	lts on		22 August 19	during Mid-	Ebb Tide	)																			
Monitoring Station	Weather	Sea	Sampling	Water	Sampling I	Depth (m)	Current Speed	Current	Water Te	mperature (°C)		pН	Salin	ity (ppt)	DO Satu (%		Dissolved Oxygen	Turbidity	(NTU)	Suspended ( (mg/L)	Solids To	al Alkalini (ppm)	Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	(µg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value			Average	Value DA	Value	DA			lue DA	(Northing)	(Easting)			DA
					Surface	1.0	0.1	128 130	29.4 29.4	29.4	8.0	8.0	16.5 16.5		89.9 89.4	89.7	6.3	2.8		<2 <2		7			<0.2	2.1	ł
C1	Cloudy	Moderate	16:11	8.2	Middle	4.1 4.1	0.3	147	27.4	27.4	7.9 7.9	7.9	28.6		62.1	62.3	4.2 5.2 4.2	14.1	10.1	2	3 [	8 88	815633	804245	<0.2	2.2	2.1
					Bottom	7.2	0.3	149 134	27.4 27.3	27.3	7.9	7.9	29.0	20.0	62.4 60.2	60.3	4.1	14.2 13.4		4	9	9			<0.2	2.0	İ
						7.2 1.0	0.2	135 120	27.3 28.8		7.9 7.8		29.0		50.3		4.1	13.2		3 5		5	1	1	<0.2	2.2	Ļ_
					Surface	1.0	0.3	133	28.7	28.8	7.9	7.8	20.4	20.4	67.1	67.2	4.6	3.3		4	8	5			<0.2	2.2	1
C2	Cloudy	Moderate	15:15	11.6	Middle	5.8 5.8	0.4	135 134	27.9 27.9	27.9	7.9	7.9	26.0 26.1		61.3 61.2	61.3	4.2	5.8 5.8	6.7	5		8 7 88	825679	806949	<0.2	2.1	2.1
					Bottom	10.6 10.6	0.4	130 113	27.7 27.7	27.7	7.8 7.8	7.8	26.6 26.6		59.7 59.7	59.7	4.1 4.1	11.2 11.2		4 5	9	0			<0.2 <0.2	2.1	
					Surface	1.0	0.2	95	29.3	29.3	7.9	7.9	23.9	23.0	91.9	91.9	6.2	1.3		3	8	6			<0.2	1.4	H
						1.0 6.3	0.2	96 60	29.3 26.5		7.9 7.9		23.9 30.0		91.8		6.2 4.6 5.4	1.3 2.8		4		7 00			<0.2	1.5	+
C3	Cloudy	Moderate	17:23	12.5	Middle	6.3	0.3	67	26.4	26.5	7.9	7.9	30.1	30.1	67.5	67.7	4.6	3.0	2.7	5	4 8	8 00	822130	817785	<0.2	1.5	1.5
					Bottom	11.5 11.5	0.1	99 102	26.2 26.2	26.2	7.9 7.9	7.9	30.7		62.4 62.7	62.6	4.2 4.3	3.8		7 5		9			<0.2 <0.2	1.5 1.5	t
					Surface	1.0	0.1	285 295	29.7 29.8	29.8	8.0	8.0	17.2 17.1		93.1 93.3	93.2	6.4	1.9		<2 2		5 6			<0.2	2.0	-
IM1	Cloudy	Calm	15:58	5.4	Middle	-	-	-	-	-	-	-	- 17.1		-	-	6.4	-	8.8	-	<sub>2</sub> $\square$	. 88	817941	807118	- <0.2	, 🗀	2.1
	,	-				4.4	0.1	99	29.1		7.9		20.8		87.2		6.0	15.5		<2		9			<0.2	2.2	}
					Bottom	4.4	0.1	106	29.1	29.1	7.9	7.9	20.8	20.8	87.6	87.4	6.0	15.7		<2	9	0			<0.2	2.2	
					Surface	1.0	0.2	146 150	29.5 29.4	29.5	7.9 7.9	7.9	16.5 16.5		86.9 86.3	86.6	6.0 5.3	2.0		2	8	5 6			<0.2	2.1	1
IM2	Cloudy	Calm	15:51	7.6	Middle	3.8	0.2	131 133	28.0 28.0	28.0	7.9 7.9	7.9	26.1 26.3		67.7 67.6	67.7	4.6 4.6	9.7 10.0	8.9	<2 <2		9 88	818176	806142	<0.2	2.5	2.4
					Bottom	6.6	0.0	141	28.1	28.2	7.9	7.9	27.1	27.1	68.7	69.0	4.6	14.8		3	9	0			<0.2	2.6	1
						6.6	0.0	143 158	28.2 30.0		7.9 7.9		27.0 15.3		69.3		4.7 6.2	14.8		2		6	1	1	<0.2 <0.2	2.4	$\vdash$
					Surface	1.0	0.5	155 161	30.0	30.0	7.9	7.9	15.3	15.3	88.7	88.8	6.2	1.9		3	8	6 8 00			<0.2	2.5	
IM3	Cloudy	Moderate	15:46	7.5	Middle	3.8	0.3	150	28.3 28.2	28.3	7.9 7.9	7.9	24.2 24.2	24.2	71.2	71.3	4.9	3.5	7.1	2 <2	2 8	9 89	818779	805607	<0.2 <0.2	2.4	
					Bottom	6.5 6.5	0.2	129 130	27.8 27.8	27.8	7.9	7.9	27.3	27.3	70.9 71.6	71.3	4.8 4.8	16.1 16.1		3	9	1			<0.2	2.4	+
					Surface	1.0	0.6	150	29.2	29.2	7.9	7.9	18.0	18.0	33.9	83.9	5.8	1.7		3	8	5			<0.2	2.5	Π
IM4	Cloudy	Moderate	15:37	7.9	Middle	1.0 4.0	0.6	151 144	29.2 28.2	28.2	7.9 7.9	7.9	18.0 25.0		72.1	72.1	5.8 4.9 5.4	1.7 4.5	6.1	3		5 8 88	819724	804613	<0.2 <0.2 <0.2	2.6	2.6
1101-4	Cioday	Woderate	13.37	7.5		4.0 6.9	0.4	160 134	28.2 28.0		7.9 7.9		25.0 26.8		72.1		4.9	4.3 12.1	0.1	3 <2		8 00	013724	004015	<0.2	2.6	2.0
					Bottom	6.9	0.4	133	28.0	28.0	7.9	7.9	26.8	20.0	72.3	72.2	4.9	12.2		2	9	0			<0.2	2.5	
					Surface	1.0	0.8	166 162	29.9 29.9	29.9	8.0	8.0	16.5 16.5		91.5 91.5	91.5	6.3	1.6		<2 <2		6			<0.2	2.6	t
IM5	Cloudy	Moderate	15:25	7.2	Middle	3.6 3.6	0.8	158 155	28.6 28.5	28.6	7.9 7.9	7.9	21.9		81.8 81.6	81.7	5.6 5.6	4.6 4.4	5.4	4 2		8 9 88	820724	804890	<0.2	2.5	2.5
					Bottom	6.2	0.4	148	28.0	28.1	7.9	7.9	26.8	26.8	0.86	68.3	4.6	10.2		5	9	0			<0.2	2.5	1
						6.2 1.0	0.4	144 164	28.1 29.4		7.9 7.9		26.8		68.5		4.6 <sup>4.0</sup>	10.0		5	9	5			<0.2	2.5	$\vdash$
					Surface	1.0 3.5	0.1	168 169	29.4	29.4	7.9	7.9	20.3	20.3	32.9	83.0	5.7	2.6 8.7		4 2	8	5			<0.2	2.8	1
IM6	Cloudy	Moderate	15:18	6.9	Middle	3.5	0.1	179	28.1 28.1	28.1	7.9 7.9	7.9	24.9 24.8		70.4 70.5	70.5	4.8	9.8	9.1	2	3 8	8 8	821041	805823	<0.2 <0.2	2.7	2.7
					Bottom	5.9 5.9	0.1	159 166	28.3 28.4	28.4	7.9 7.9	7.9	27.0 27.0		65.7 69.5	67.6	4.4 4.6	15.7 15.4		3		9			<0.2	2.6	1
					Surface	1.0	0.1	183	29.4	29.4	7.9	7.9	16.8	16.8	83.4	83.2	5.8	3.6		4	8	5			<0.2	2.5	Τ
0.47	Olevert.	Madania	45.40			1.0 3.9	0.1	182 175	29.3 28.8		7.9 7.9		16.8 22.6		83.0		5.8 5.5	3.8 6.8	0.7	5 4		8	004070	200044	<0.2	2.6	
IM7	Cloudy	Moderate	15:10	7.7	Middle	3.9 6.7	0.3	177 171	28.7 28.4	28.8	7.9 7.9	7.9	22.6 25.5	22.0	80.6	80.6	5.5	7.3 10.0	6.7	5 4	4 8	88	821370	806844	<0.2 <0.2 <0.2	2.6 2.5	2.6
					Bottom	6.7	0.4	176	28.6	28.5	7.9	7.9	25.4	25.5	71.3	71.1	4.8	9.0		4	ç	0			<0.2	2.5	
-		-		-	Surface	1.0	0.1	81 82	29.2 29.1	29.2	7.9 7.9	7.9	18.6 16.9		B0.9 B3.2	82.1	5.6	3.9		5 4		6 5			<0.2 <0.2	2.2	ł _
IM8	Cloudy	Moderate	15:44	7.6	Middle	3.8	0.2	107	28.6	28.6	7.8	7.8	23.2	23.2	64.9	65.0	4.4	4.6	4.9	6	6 8	8	821844	808131	<0.2	2.2	2.2
					Bottom	3.8 6.6	0.2	107 89	28.6 28.5		7.8 7.8		23.3 24.0	- '	65.0	66.5	4.4	4.8 6.1		7 5		8 0			<0.2 <0.2	2.2	t
A: Denth-Aver					DULUIII	6.6	0.2	94	28.5	28.5	7.8	7.8	24.0	24.0	66.6	00.5	4.5	6.1		6	9	0			<0.2	2.1	<u> </u>

during Mid-Ebb Tide Water Quality Monitoring Results on 22 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water рΗ Coordinate Sampling Water Temperature (°C) Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Average 0.2 81.7 5.6 1.0 0.2 60 30.8 14.1 5.8 86 <0.2 2.2 3.7 0.2 28.4 7.9 7.9 24.4 67.1 67.0 4.6 4.5 9.6 10 12 87 89 <0.2 2.2 Cloudy IM9 Moderate 15:51 7.4 Middle 7.9 67.1 9.2 10 88 822084 808806 <0.2 0.2 9.9 28.4 6.4 0.1 68 28.3 25.0 25.0 12.1 13 90 < 0.2 2.3 7.9 67.1 4.6 Bottom 28.3 7.9 25.0 67.3 4.6 67.4 4.6 0.1 79 12 1 14 90 23 6.4 70 28.3 <0.2 0.2 29.8 2.2 6.3 Surface 29.8 7.9 15.5 90.0 7.9 15.4 90.0 6.3 87 2.2 1.0 0.2 59 29.7 3.4 < 0.2 6.0 0.2 29.0 29.0 81.7 81.4 5.6 5.6 2.9 87 88 <0.2 2.0 3.6 45 7.9 7.9 IM10 Cloudy Moderate 15:59 7.1 Middle 29.0 7.9 22.2 81.6 88 822374 809798 <0.2 6.1 0.3 102 28.0 7.9 67.6 4.6 6.0 6 89 <0.2 2.3 25.8 7.9 67.7 4.6 Bottom 28.0 25.8 6.1 0.3 107 28.0 7.9 25.8 67.7 4.6 6.0 90 < 0.2 2.1 1.0 0.1 97 3.3 86 2.0 29.1 7.9 5.5 23.0 80.6 <0.2 Surface 29.1 7.9 23.0 80.4 1.0 0.1 104 29.1 7.9 80.2 5.4 3.5 86 <0.2 1.8 5.0 3.8 0.0 141 27.8 7.9 26.3 26.4 66.7 66.4 4.5 5.3 88 <0.2 1.7 IM11 Cloudy 822047 811438 Moderate 16:09 7.6 Middle 27.8 7.9 26.3 66.6 88 <0.2 0.0 87 <0.2 1.8 3.8 6.6 142 7.9 66.4 66.6 4.5 7.3 90 <0.2 1.7 Rottom 27.7 7.9 26.9 66.5 45 6.6 0.1 144 27.7 7.9 26.9 4.5 7.4 90 1.8 82 29.3 7.9 23.1 23.1 83.2 83.2 86 <0.2 1.8 Surface 29.3 7.9 23.1 83.2 1.0 0.0 69 29.3 7.9 5.6 2.3 85 <0.2 1.8 4.2 0.1 103 27.7 7.9 4.4 7.4 6 88 <0.2 1.9 Middle 65.5 821480 812046 IM12 Cloudy Moderate 16:15 7.9 26.8 0.1 27.6 7.9 65.4 4.4 7.6 89 1.8 7.3 0.1 83 27.6 7.9 66.5 4.5 8.0 90 <0.2 1.9 Bottom 27.6 7.9 27.0 66.7 4.5 27.0 66.8 7.3 0.1 89 27.6 7.9 4.5 7.9 7 90 < 0.2 1.8 1.0 28.2 7.9 23.6 78.9 5.4 8.4 Surface 28.2 7.9 23.6 78.6 1.0 28.1 7.9 23.7 78.3 5.4 8.9 6 2.6 Cloudy Moderate 16:43 5.2 Middle 819972 812663 2.6 4.2 27.8 7.9 67.0 4.5 11.1 4.6 Bottom 27.8 7.9 26.5 67.1 4.2 27.8 7.9 26.5 67.2 4.6 11.0 9 1.0 0.3 107 28.5 7.9 82.2 3.7 86 <0.2 1.8 Surface 28.5 7.9 24.4 82.1 1.0 0.3 114 28.4 7.9 24.5 82.0 5.6 3.8 6 87 <0.2 1.8 SR2 Cloudy Moderate 17:01 4.8 Middle 821451 814144 <0.2 117 26.3 26.3 73.3 73.4 5.0 <0.2 1.8 Bottom 73.4 3.8 0.2 125 28.0 7.9 5.5 11 90 <0.2 1.8 1.0 0.1 131 29.2 7.9 17.8 80.8 5.6 3.9 6 7.9 17.8 80.5 1.0 0.1 133 29.1 79 17.8 80.1 5.6 3.9 4 4.3 0.1 183 28.8 7.9 21.8 71.3 4.9 7.2 5 -SR3 Moderate 15:38 8.6 21.8 71.5 822159 807578 Cloudy 4.3 0.1 190 28.7 7.9 21.8 71.7 4.9 7.9 5 0.2 28.7 28.7 7.9 7.9 24.0 73.8 73.9 5.0 9.9 7.6 7.6 153 155 Bottom 7.9 73.9 5.0 1.0 0.4 74 29.1 8.0 19.1 90.9 6.3 2.4 Surface 29.2 8.0 19.1 91.0 1.0 0.4 78 8.0 19.0 91.0 6.3 2.5 7.7 29.2 3 -4.6 0.4 7.9 4.9 4 68 28.5 23.9 72.5 7.9 817172 807814 SR4A Cloudy Calm 16:32 9.2 Middle 28.5 24.0 72.5 4.6 0.4 71 7.9 24.0 72.4 4.9 7.8 28.5 4 0.3 28.1 7.9 14.3 8.2 26.1 65.7 4.4 Rottom 7.9 26.1 65.8 4.5 77 4.5 8.2 0.3 28.1 7.9 26.0 65.9 13.9 1.0 0.2 110 29.3 8.0 6.0 4.1 6 22.0 88.1 Surface 29.4 8.0 22.0 88.1 1.0 0.2 112 29.4 8.0 22.0 88.0 6.0 4.1 5 SR5A 16:47 Middle 816608 810706 Cloudy Calm 5.6 4.6 0.1 120 28.8 7.9 6.7 24.0 73.4 5.0 Bottom 28.8 7.9 24.0 73.6 5.0 4.6 0.1 121 28.8 0.0 8.0 96.2 Surface 30.0 8.0 22.3 96.1 357 30.0 2.5 SR6A Cloudy 17:16 4.6 Middle 817952 814754 Calm 3.6 0.0 94 28.6 8.1 Bottom 1.0 0.4 70 28.5 7.9 26.4 83.1 5.6 1.9 Surface 7.9 1.0 0.4 73 28.5 79 82.6 5.5 1.9 8.2 0.1 344 26.5 7.9 30.4 66.1 4.5 2.6 7 SR7 Cloudy Moderate 17:51 Middle 66.2 823618 823731 8.2 0.1 316 26.5 79 30.4 66.2 45 27 8 15.4 0.1 47 25.9 7.9 31.4 59.4 4.1 3.8 Bottom 25.9 7.9 59.6 15.4 0.1 47 25.9 7.9 59.7 4.1 3.8 1.0 29.0 7.9 22.9 87.1 86.8 5.9 5.9 Surface 28.9 79 3.6 6 --SR8 Cloudy Moderate 16:22 5.0 Middle 4.3 820397 811641 4.0 25.9 4.7 28.1 7.9 69.1 5.1 8 Bottom 28.1 7.9 25.9 69.1 4.7

28.1

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 22 August 19 during

22 August 19 during Mid-Flood Tide

Water Qua	lity Monite	oring Resu	lts on		22 August 19	during Mid-	Flood Ti	de																				
Monitoring	Weather	Sea	Sampling	Water	Sampling D	Depth (m)	Current Speed	Current	Water Te	emperature (°C)		pH	Sali	nity (ppt)		aturation (%)	Disso Oxyg		Turbidity(	NTU)	Suspende (mg		Total A (pp		Coordinate HK Grid	Coordinate HK Grid	Chron (µg/	
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average		Average		Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA Value DA
					Surface	1.0	0.2	18 18	29.2 29.1	29.2	7.9	7.9	15.8 15.9	15.9	84.7 84.4	84.6	6.0 5.9		2.4	ŀ	4	ſ	87 88				<0.2	2.3
C1	Fine	Moderate	11:08	7.6	Middle	3.8	0.3	49	27.7	27.7	7.9	7.9	27.4	27.4	63.4	63.5	4.3	5.1	9.0	8.4	3	4	89	89	815643	804258	<0.2	2.4
					Bottom	3.8 6.6	0.3	51 47	27.7 27.7	27.8	7.9 7.9	7.9	27.4 27.4	27.4	63.6 66.9	67.1	4.3 4.5	4.5	9.4 13.4	ŀ	3	í ,	89 91				<0.2	2.2
						6.6 1.0	0.3	50 18	27.8 29.1		7.9	1	27.4		67.3 66.4		4.5 4.5	4.5	13.7 3.7		4 5	==	91 85				<0.2	2.3
					Surface	1.0	0.3	18	29.1	29.1	7.8	7.8	20.9	21.1	66.3	66.4	4.5	4.3	3.7	İ	5	i '	86				<0.2	2.1
C2	Cloudy	Moderate	12:04	12.0	Middle	6.0	0.4	317 326	27.8 27.8	27.8	7.9	7.9	26.4	26.4	60.4	60.3	4.1		2.9	5.4	6	6	89 90	88	825668	806957	<0.2	<0.2 2.0 2.0
					Bottom	11.0 11.0	0.4	341 351	27.6 27.6	27.6	7.9	7.9	27.1 27.1	27.1	59.8 60.2	60.0	4.1	4.1	9.7 9.7	Ī	6 7	}	90 90				<0.2 <0.2	1.9
					Surface	1.0	0.4	264	28.6	28.6	7.9	7.9	23.0	23.0	76.8	76.7	5.2		1.9		2		86				<0.2	1.4
						1.0 6.0	0.5 0.5	279 253	28.5 27.6		7.9 7.9		23.0 27.0		76.6 63.8		5.2 4.3	4.8	2.0		3	1	85 88				<0.2 <0.2	1.4
C3	Cloudy	Moderate	09:56	12.0	Middle	6.0	0.5	272	27.6	27.6	7.9	7.9	27.0	27.0	63.9	63.9	4.3		2.9	5.2	5	4	87	88	822122	817802	< 0.2	1.6
					Bottom	11.0 11.0	0.3	278 299	26.7 26.7	26.7	7.9	7.9	29.6 29.6	29.6	63.2	63.3	4.3	4.3	10.9 10.9	ŀ	4 5	ĺ	90 90				<0.2	1.6 1.5
					Surface	1.0	0.3	9	29.1 29.1	29.1	8.0	8.0	16.8 16.8	16.8	89.1 89.0	89.1	6.2		3.2		2	1	89 89				<0.2	2.0
IM1	Fine	Calm	11:20	5.6	Middle	-	-	-	-		-		-		-		-	6.2	-	5.6	-	3	-	90	817931	807111	-	<0.2 - 2.0
						4.6	0.1	263	28.9	00.0	8.0	0.0	21.6	04.0	86.4	00.4	5.9	5.9	7.8	-	4	1	90				<0.2	2.0
					Bottom	4.6 1.0	0.1	273 26	28.9	28.9	8.0 7.9	8.0	22.0 17.4	21.8	85.8 85.6	86.1	5.9 6.0	5.9	7.9 1.8		3	==	90 87				<0.2	2.1
					Surface	1.0	0.4	26	29.3	29.4	7.9	7.9	17.4	17.4	85.5	85.6	5.9	5.4	1.8	l	3	i '	87				<0.2	2.1
IM2	Fine	Calm	11:26	7.2	Middle	3.6	0.4	21	28.3 28.2	28.3	7.9	7.9	24.9	25.0	72.9 72.8	72.9	4.9 4.9	0	6.2 6.1	6.5	2	3	89 90	89	818152	806170	<0.2	<0.2 2.1 2.1
					Bottom	6.2	0.3	348 320	28.1 28.1	28.1	7.9	7.9	26.2 26.2	26.2	73.3 73.8	73.6	5.0	5.0	11.4 11.3		3	}	91 91				<0.2	2.0
					Surface	1.0	0.5	10	29.1	29.1	8.0	8.0	18.9	18.9	86.7	86.7	6.0		1.5		3		88				<0.2	2.1
						1.0 3.8	0.5	10 337	29.1 28.4		8.0 7.9	-	18.9 24.8		86.7 78.2		6.0 5.3	5.7	1.5 2.6		3	۱. ۱	88 89				<0.2	2.1
IM3	Fine	Calm	11:32	7.6	Middle	3.8	0.3	355	28.3	28.4	7.9	7.9	24.8	24.8	78.0	78.1	5.3		2.6	5.4	2	3	89	90	818773	805572	< 0.2	<0.2 2.0 2.0 2.0 2.0
					Bottom	6.6	0.2	312 335	27.7 27.7	27.7	7.9	7.9	27.6 27.6	27.6	65.4 65.7	65.6	4.4	4.4	12.0 12.0		3 <2	Ĺ	91 92				<0.2 <0.2	2.0
					Surface	1.0	0.7	2	28.9 28.8	28.9	7.9	7.9	18.3 18.4	18.3	85.7 85.3	85.5	6.0		1.6 1.6		3		88 89				<0.2	2.1
IM4	Fine	Calm	11:39	8.1	Middle	4.1	0.6	344	28.1	28.1	7.9	7.9	25.3	25.3	73.1	73.2	5.0	5.5	7.1	6.9	2	3	90	90	819740	804597	< 0.2	2.1
					Bottom	4.1 7.1	0.6	346 329	28.1 27.8	27.8	7.9 7.9	7.9	25.3 27.5	27.5	73.3 65.3	65.6	5.0 4.4	4.4	7.1 12.0	ŀ	3	í l	90 91				<0.2	2.1
						7.1 1.0	0.5	337 4	27.8 29.7		7.9 8.0	<u> </u>	27.5 18.7		65.8 94.7		4.4 6.5	4.4	11.7 1.3		4 <2	—— <sup>]</sup>	91 86				<0.2 <0.2	2.1
					Surface	1.0	0.9	4	29.7	29.7	8.0	8.0	18.7	18.7	94.2	94.5	6.5	5.7	1.4		<2	i <sup> </sup>	86				< 0.2	2.1
IM5	Fine	Moderate	11:45	7.5	Middle	3.8	0.8	350 322	28.0 28.0	28.0	7.9	7.9	26.5 26.5	26.5	71.1	71.4	4.8	1	4.7 4.7	5.4	<2 <2	<2	87 88	88	820728	804852	<0.2	<0.2 2.0 2.0
					Bottom	6.5 6.5	0.5 0.5	15 15	27.8 27.8	27.8	7.9 7.9	7.9	27.4 27.4	27.4	66.1 66.8	66.5	4.5 4.5	4.5	10.1 10.0		<2 <2	}	89 89				<0.2	1.9
					Surface	1.0	0.2	92	29.3	29.3	7.9	7.9	20.4	20.4	81.4	81.0	5.6		2.5		3		86				<0.2	2.0
	_					1.0 3.5	0.2	94 49	29.3 27.8		7.9 7.9		20.3		80.6 63.7		5.5 4.3	4.9	2.6 11.6		3 <2	ا _ ا	86 87				<0.2	2.0
IM6	Fine	Moderate	11:51	7.0	Middle	3.5 6.0	0.3	49 73	27.8 28.0	27.8	7.9 7.9	7.9	27.1 27.3	27.1	64.0	63.9	4.3		11.9 15.1	9.9	<2 <2	2	87 89	87	821057	805835	<0.2 <0.2	<0.2 2.0 2.0 2.0 2.0
					Bottom	6.0	0.2	79	28.0	28.0	7.9	7.9	27.2	27.3	65.6 66.1	65.9	4.4	4.4	15.5		<2		89				<0.2	2.0
					Surface	1.0	0.1	8	29.2 29.2	29.2	7.9 7.9	7.9	18.5 18.5	18.5	84.6 84.6	84.6	5.9 5.9		3.9 4.3		3		86 86				<0.2	2.1
IM7	Fine	Moderate	11:56	8.0	Middle	4.0	0.3	29	28.7	28.7	7.9	7.9	22.0	22.0	83.0	82.9	5.7	5.8	9.7	9.0	3	3	88	88	821368	806830	<0.2	.0.2 2.1 2.0
					Bottom	4.0 7.0	0.4	31 76	28.6 28.4	28.5	7.9 7.9	7.9	22.0 25.3	25.3	82.8 74.1	74.3	5.7 5.0	5.0	9.5 13.5		3	í l	88 90				<0.2	2.0
					DOLLOTTI	7.0 1.0	0.5	82 22	28.6 29.5	20.0	7.9 7.9		25.2 16.9	25.3	74.5 81.8		5.0 5.7	5.0	13.0 4.0		3		91 86				<0.2	2.0
					Surface	1.0	0.2	23	29.4	29.5	7.9	7.9	17.0	16.9	81.6	81.7	5.7	5.2	3.9		3	į l	85				<0.2	1.9
IM8	Cloudy	Moderate	11:38	7.9	Middle	4.0	0.0	210 221	28.6 28.6	28.6	7.8	7.8	22.4	22.4	66.4 66.7	66.6	4.6		4.1 4.2	4.2	4 5	4	88 87	88	821816	808156	<0.2	<0.2 2.0 2.0
					Bottom	6.9	0.2	71 72	28.3	28.4	7.8	7.8	24.5	24.5	65.9	66.1	4.5	4.5	4.5		4	ļ	90				<0.2	1.9
DA: Depth-Ave	<u> </u>		L		<u> </u>	6.9	0.2	/2	28.4		7.8	<u> </u>	24.5	l	66.2	L	4.5		4.4		4		90			I	<0.2	2.0

during Mid-Flood Tide Water Quality Monitoring Results on 22 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Average 0.3 84.4 5.9 1.0 0.3 54 29.6 15.6 3.6 85 <0.2 1.9 3.8 0.0 29.1 7.9 7.9 19.0 19.1 82.9 83.0 5.7 5.7 6.1 88 87 <0.2 1.9 Cloudy IM9 Moderate 11:31 7.5 Middle 7.9 19.1 6.0 88 822097 808824 <0.2 3.8 0.0 6.1 29.1 6.5 0.1 254 28.9 22.7 22.7 5.4 5.4 10 11 90 <0.2 1.9 7.9 79.8 8.4 Bottom 28.9 7.9 22.7 79.9 5.4 7.9 6.5 0.1 278 80.0 8.3 90 1.8 28.9 <0.2 0.4 333 28.9 3.6 1.6 7.9 5.4 Surface 28.9 7.9 21.1 78.8 7.9 21.1 78.5 5.4 86 1.7 1.0 0.4 306 28.8 3.7 4 < 0.2 28.4 28.3 1.6 3.8 0.4 306 322 23.8 23.8 70.0 69.8 7.5 7.5 88 87 <0.2 7.9 7.9 4.8 IM10 Cloudy Moderate 11:23 7.6 Middle 28.4 7.9 23.8 69.9 88 822403 809797 <0.2 0.4 4.8 12 6.6 0.2 291 28.0 7.9 64.2 4.4 9.9 90 < 0.2 1.6 25.8 7.9 64.3 4.4 Bottom 28.0 25.8 6.6 0.2 301 28.0 7.9 25.8 64.4 4.4 9.9 13 90 < 0.2 1.6 1.0 0.5 304 77.9 3.0 85 1.6 28.9 7.9 5.4 21.0 77.7 <0.2 Surface 28.8 7.9 21.0 1.0 0.5 327 28.7 7.9 77.5 5.3 3.2 86 <0.2 1.5 1.6 3.9 0.6 298 28.2 7.9 70.7 4.8 6.2 88 <0.2 24.3 IM11 Cloudy 11:12 822067 811465 Moderate 7.8 Middle 28.2 7.9 24.3 70.6 88 <0.2 0.6 70.4 87 3.9 <0.2 28.2 6.2 6.8 7.9 62.7 63.0 4.3 15.4 90 <0.2 1.6 4.3 Rottom 27.5 79 27.3 62.9 6.8 0.3 318 27.5 7.9 4.3 15.4 90 1.6 283 29.3 7.9 82.0 82.0 86 <0.2 1.5 20.6 Surface 29.3 7.9 20.6 82.0 1.0 0.6 300 29.3 7.9 20.6 5.6 2.3 3 86 <0.2 1.6 4.2 0.6 284 28.0 4.8 6.9 87 <0.2 1.5 70.0 Middle 821481 812050 IM12 Cloudy Moderate 11:06 28.0 7.9 25.1 70.0 0.6 28.0 7.9 69.9 4.8 6.9 88 1.4 4.2 7.4 0.1 282 27.5 7.9 60.6 4.1 13.7 91 <0.2 1.4 Bottom 27.5 7.9 27.4 60.7 4.1 60.8 7.4 0.1 286 27.5 7.9 27.4 41 13.2 6 90 <0.2 1.5 1.0 29.0 7.9 85.9 5.9 2.4 <2 Surface 29.0 7.9 21.2 85.9 1.0 29.0 7.9 21.2 85.9 5.9 2.5 <2 2.6 SR1A Cloudy Moderate 10:40 5.1 Middle 819980 812657 2.6 28.7 28.8 77.2 77.1 3.7 4.1 7.9 23.2 5.2 Bottom 7.9 23.2 77.2 5.2 41 79 1.0 0.2 302 28.3 79 22.8 74 9 5.2 7.5 87 <0.2 15 Surface 7.9 22.8 74.8 1.0 0.2 5.1 7.5 15 309 79 74.6 3 86 28.2 22 9 < 0.2 -SR2 Cloudy Moderate 10:17 4.8 Middle 821486 814157 0.2 1.5 3.8 311 26.0 26.0 67.1 67.2 4.6 90 <0.2 Bottom 27.9 7.9 26.0 67.2 4.6 27.9 7.9 4.6 1.5 10.0 90 < 0.2 1.0 0.1 29.1 35 7.8 17.4 79.2 5.5 3.6 Surface 29.1 7.8 17.4 78.8 1.0 0.1 5.5 37 29.0 7.8 17.4 78.4 3.5 4 4.2 3.7 28.6 7.8 22.3 65.3 4.5 SR3 11:43 Middle 7.8 822161 807575 Cloudy Moderate 8.4 28.6 22.3 65.4 4.2 0.1 91 28.6 7.8 22.3 65.4 4.5 3.9 4 . 7.4 4.5 4.5 0.2 61 28.4 7.8 24.3 24.4 65.8 66.0 5.3 5.4 4 45 Rottom 28.4 7.8 24.3 65.9 7.4 28.4 1.0 0.2 256 29.5 7.9 5.8 3.5 <2 21.2 85.3 Surface 29.5 7.9 21.2 85.2 1.0 29.5 21.2 85.1 5.8 3.6 0.2 275 5.2 4.4 0.3 28.5 4.6 5.9 7.9 24.5 67.4 SR4A Fine Calm 10:50 8.8 Middle 28.5 7.9 24.5 67.4 817199 807798 4.4 0.3 261 28.5 7.9 4.6 6.0 0.0 286 27.8 7.9 27.3 63.5 4.3 9.0 Bottom 27.8 7.9 27.3 63.7 4.3 7.8 27.8 295 1.0 0.2 29.1 7.9 5.2 22.9 81.6 5.5 Surface 29.1 7.9 81.3 22.9 1.0 0.2 304 29.1 7.9 81.0 5.5 4.9 3 Fine Calm 10:35 Middle 810693 4.7 0.1 301 28.9 7.9 81.4 5.5 8.3 Bottom 7.9 4.7 0.2 311 28.9 7 0 83 162 1.0 0.1 28.8 7.8 23.0 78.3 5.3 42 23.1 0.1 171 1.0 28.7 7.8 23.1 78.2 5.3 4.0 5.3 -SR6A Fine Calm 10:11 5.3 Middle 817939 814723 4.3 0.1 137 28.6 7.8 7.8 73.7 73.6 5.0 5.0 3.9 4 -23.5 73.7 Bottom 4.3 0.1 139 28.6 1.0 0.1 239 28.2 8.0 24.5 24.6 85.5 85.3 5.8 5.8 1.7 Surface 28.2 8.0 24.5 85.4 1.0 0.1 244 28.1 8.4 0.1 158 27.5 8.0 27.3 27.3 66.3 66.3 4.5 1.9 <2 -27.3 66.3 8.0 823655 823740 SR7 Cloudy Moderate 09:26 16.8 Middle 27.5 8.0 4.5 8.4 0.1 166 27.5 1.9 -15.8 0.1 11 26.7 8.0 4.1 2.7 3 -30.2 60.5 Bottom 26.8 8.0 30.1 60.7 4.1 4.1 8.0 60.8 15.8 0.2 11 26.8 2.6 29.0 29.0 7.9 20.5 86.2 85.8 5.9 5.9 2.6 2.6 1.0 Surface 29.0 7.9 20.5 86.0 7.9 59 SR8 Cloudy 10:59 5.2 Middle 820386 811600 Moderate 5.0 28.6 7.9 24.2 28.6 7.9 24.2 74.1 5.0 Bottom

28.6

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

Water Quality Monitoring Results on 24 August 19 during Mid-Ebb Tide

Nater Qual	ity Monite	oring Resu	lts on		24 August 19	during Mid-	-Ebb Tide	9																				
Monitoring Station	Weather	Sea	Sampling	Water	Sampling [	Depth (m)	Current Speed	Current Direction	Water Te	mperature (°C)		рН	Salin	ity (ppt)		aturation %)	Dissolved Oxygen	Turbidity	(NTU)	Suspender (mg/l		Total All (ppr		Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	el (µg/L
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value DA		
					Surface	1.0	0.4	138 141	28.6 28.6	28.6	8.5 8.5	8.5	21.4	21.4	88.6 88.3	88.5	6.1	2.5		6 7	-	83	1			<0.2	2.5	
C1	Cloudy	Rough	06:31	8.6	Middle	4.3	0.2	147	26.8	26.8	8.5	8.5	29.4	29.4	63.7	63.5	4.3	3.7	3.3	6	, [	87	87	815629	804269	<0.2	1.4	Ι.,
١ ١	Cioudy	rtougn	00.51	0.0	Wildle	4.3 7.6	0.2	147 123	26.8 26.5		8.5 8.4		29.4 30.6		63.3 63.7		4.3	3.7	5.5	6 7	, F	87 92	ı "	013023	004203	<0.2	1.4	
					Bottom	7.6	0.1	123	26.5	26.5	8.4	8.4	30.6	30.6	64.1	63.9	4.3 4.3	3.7		8	-	92	i			<0.2	1.6	1
					Surface	1.0	0.3	144 150	29.9 29.9	29.9	7.7	7.7	14.8	14.9	80.2 80.2	80.2	5.6	6.5		7 8	-	86 85	i I			<0.2	2.5	
C2	Cloudy	Moderate	08:35	11.2	Middle	5.6	0.2	149	27.3	27.3	7.7	7.7	28.1	28.1	55.6	55.6	3.8	2.9	5.0	6	,	89	88	825700	806945	<0.2	2.5	٦,,
02	Cloudy	Moderate	00.00			5.6 10.2	0.2	155 160	27.3 27.1		7.7		28.1 28.7		55.6 56.3		3.8	2.9 5.7	0.0	8	·	87 90	1 00	020.00	000010	<0.2	2.4	
					Bottom	10.2	0.2	164	27.1	27.1	7.7	7.7	28.7	28.7	56.4	56.4	3.8	5.6		6		90				<0.2	2.4	
ļ					Surface	1.0	0.4	33 34	28.6 28.6	28.6	7.8	7.8	22.6	22.6	77.7 77.5	77.6	5.3	2.3	-	11 9	H	86 86	1	į ,	ł	<0.2	1.7	
C3	Cloudy	Moderate	06:05	11.4	Middle	5.7	0.4	76	27.3	27.3	7.8	7.8	27.4	27.4	69.1	69.1	4.7	2.2	3.4	10	9	87	88	822099	817793	<0.2	1.9	Ι.,
	,					5.7 10.4	0.4	79 87	27.2 26.4		7.8 7.8		27.4 29.8		69.0 58.6		4.7	2.4 5.5		8 10	· -	88 90	1	' ' '		<0.2	1.8	
					Bottom	10.4	0.1	88	26.3	26.4	7.8	7.8	29.8	29.8	58.8	58.7	4.0	5.7		8		90			<u> </u>	<0.2	1.7	1
ļ					Surface	1.0	0.3	229 229	28.5 28.6	28.6	8.5 8.5	8.5	22.1	22.0	85.3 85.0	85.2	5.9	3.0	1	4 5	ŀ	83	ı	į ,	ł	<0.2	2.6	
IM1	Cloudy	Rough	06:57	5.2	Middle	-	-	-	-	-	-	-	-		-	-	5.9	-	6.2	-	5	-	84	817969	807123	02	, -	2.5
ļ		-			Bottom	4.2	0.1	247	26.4	26.4	8.5	8.5	30.8	30.8	59.1	59.3	4.0 4.0	9.3	1	- 6	ŀ	84	1	į ,	ł	<0.2	2.4	ł
					BOILOITI	4.2 1.0	0.2	257 186	26.4 27.8	20.4	8.5 8.5	0.0	30.8	30.6	59.4 73.9		4.0	9.3		6 7		84 85	Щ		<u> </u>	<0.2 <0.2	2.4 1.3	
ļ					Surface	1.0	0.2	189	27.8	27.8	8.5	8.5	24.3	24.3	73.8	73.9	5.1 5.1 5.0	3.7		8	t	85	1	, ,		<0.2	1.3	
IM2	Cloudy	Rough	07:03	7.1	Middle	3.6	0.0	170 174	27.4 27.5	27.5	8.5 8.5	8.5	26.1 26.1	26.1	70.0 69.9	70.0	4.8	4.0	4.9	10 9	10	88 89	88	818182	806183	<0.2	2 1.4	
ļ					Bottom	6.1	0.2	200	26.9	26.9	8.5	8.5	27.5	27.5	64.6	64.4	4.4	6.9	1	13	Ė	90	i l	, ,		<0.2	1.4	1
						6.1 1.0	0.2	221 279	26.8 27.9		8.5 8.5		27.6 23.5		64.1 76.7		5.3	6.9 2.9		13 7		89 86	$\vdash \vdash$	$\vdash$	<del>                                     </del>	<0.2	1.4	
ļ					Surface	1.0	0.1	299	27.9	27.9	8.5	8.5	23.7	23.6	76.5	76.6	5.3	3.0	1	6	Ė	85	i l	, ,		<0.2	1.6	1
IM3	Cloudy	Rough	07:10	7.3	Middle	3.7	0.1	236 209	26.8 26.8	26.8	8.5 8.5	8.5	29.1	29.1	63.3 63.3	63.3	4.3	3.5	3.8	6 7	8	89 88	88	818782	805590	<0.2	2 1.2	
ļ					Bottom	6.3	0.1	235	26.3	26.3	8.5	8.5	31.2	31.2	53.7	53.9	3.6	5.0	1	9	Į	90	i l	, ,		<0.2	1.1	1
						6.3 1.0	0.1	233 196	26.3 28.6		8.5 8.4		31.2 20.1		54.1 75.4		3.7 5.7 5.2	5.0 4.0		10 8		90 86	$\vdash$	$\vdash$	<del></del>	<0.2	1.1	
ļ					Surface	1.0	0.1	209	28.7	28.7	8.4	8.4	20.1	20.1	76.1	75.8	5.3	4.1	1	8		87	i l	, ,		<0.2	1.4	Ι
IM4	Cloudy	Rough	07:24	7.6	Middle	3.8	0.3	234 244	27.5 27.6	27.6	8.4	8.4	25.2 25.2	25.2	69.7 69.9	69.8	4.8	5.1 5.2	4.6	9	8	87 89	88	819725	804618	<0.2	2 1.4	1.4
ļ					Bottom	6.6	0.2	254	26.8	26.8	8.5	8.5	29.0	29.1	54.4	54.2	3.7 3.7	4.5	1	7		90	i l	į ,	ł	<0.2	1.3	
					Surface	6.6 1.0	0.2	225 220	26.7 29.4	29.4	8.5 8.4	8.4	29.2 13.7	13.7	54.0 82.1	82.1	5.8	4.5 3.2		5		90 85	$\vdash$			<0.2	1.3	
ļ					Surface	1.0 3.9	0.4	232 260	29.3 28.5		8.4 8.5	0.4	13.7 20.5		82.1 78.8		5.8 5.7	3.3 4.2		6 7		86 89	ŧ	į ,	ł	<0.2	2.5	7
IM5	Cloudy	Rough	07:36	7.7	Middle	3.9	0.2	272	28.6	28.6	8.5	8.5	19.7	20.1	78.8	78.8	5.5	4.2	4.8	6	6	88	88	820733	804885	<0.2	2.1	2.4
ļ					Bottom	6.7	0.2	247 259	26.9 26.9	26.9	8.4	8.4	26.1 27.9	27.0	58.8 58.4	58.6	4.0 4.0	6.9 6.9		6		90 90	ı l	į ,	ł	<0.2	2.5	
					Surface	1.0	0.3	242	29.2	29.2	8.5	8.5	15.4	15.4	86.7	86.7	6.1	3.1		5		86	Πİ			<0.2	2.4	
ļ						1.0 4.0	0.3	266 234	29.2 29.1		8.5 8.5		15.4 15.5		86.6 83.9		6.1 5.9	3.1		6	F	85 89	t l	į ,	ł	<0.2	2.3	7
IM6	Cloudy	Rough	07:44	8.0	Middle	4.0	0.3	255	29.1	29.1	8.5	8.5	15.5	15.5	80.1	82.0	5.7	3.8	4.3	5	5	88	88	821082	805810	<0.2	2.4	]
ļ					Bottom	7.0	0.2	239 258	27.2 27.2	27.2	8.5 8.5	8.5	27.0 27.0	27.0	61.3 61.7	61.5	4.2 4.2	6.1		4 5	-	90	i l	į ,	ł	<0.2	2.6	
					Surface	1.0	0.4	229	29.1	29.1	8.5	8.5	15.2	15.2	84.9	84.8	6.0	2.0		6	Ī	87				<0.2	2.3	Ī
						1.0 4.0	0.4	245 260	29.0 28.9		8.5 8.5		15.3 15.7		84.7 82.9		6.0 5.9	2.0	_	6 7	_ }	85 87	1	l		<0.2	2.5	7
IM7	Cloudy	Rough	07:51	7.9	Middle	4.0	0.4	279	28.9	28.9	8.5	8.5	15.7	15.7	82.7	82.8	5.9	2.7	2.7	6	6	89	88	821329	806813	<0.2	2.2	]
ļ					Bottom	6.9	0.0	14 14	27.8 28.0	27.9	8.5 8.5	8.5	24.0	23.9	68.0 68.8	68.4	4.7 4.7	3.5		6	-	90 89	1	, ,	l	<0.2	2.0	
					Surface	1.0	0.2	245	30.0	30.0	7.8	7.8	13.8	13.8	84.9	84.9	6.0	3.6		5		85	П			<0.2	2.4	
IM8	Claveter	Maderite	00.05	7.0		1.0 3.9	0.2	259 268	30.0 29.6		7.8 7.8		13.8 16.2		84.9 83.2		6.0 5.8 5.9	3.5 3.8		4	<u>,</u>	86 88	00	024040	000107	<0.2	2.4	7
	Cloudy	Moderate	08:05	7.8	Middle	3.9	0.3	283	29.5	29.6	7.8	7.8	16.2	16.2	82.7	83.0	5.8	3.9	4.5	6	6	87	88	821812	808137	<0.2 <0.2	2.5	] 2.4
IIVIO	1					6.8	0.1	279	27.8		7.7		27.1	27.2	59.5	59.5	4.0	5.9	1 !	9	г	90	, ,	1 1	1	<0.2	2.4	

during Mid-Ebb Tide Water Quality Monitoring Results on 24 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water рΗ Coordinate Sampling Water Temperature (°C) Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Value Average 0.1 84.6 5.9 1.0 0.1 212 30.0 13.8 3.6 87 <0.2 2.2 3.6 0.1 265 279 29.9 7.8 15.3 15.3 81.9 81.6 5.7 5.7 4.2 87 88 <0.2 2.3 Cloudy IM9 Moderate 07:56 7.1 Middle 4.3 88 822110 808825 <0.2 3.6 0.1 29.9 6.1 0.3 224 90 < 0.2 2.3 28.4 7.7 24.8 67.9 4.6 4.9 Bottom 28.4 7.7 24.8 68.0 4.6 7.7 68.1 4.6 6.1 0.3 24 9 5.0 90 23 244 28.4 <0.2 0.1 29.8 3.3 83.8 5.8 2.0 Surface 29.8 7.8 16.2 83.8 117 7.8 16.2 83.7 5.8 85 2.0 1.0 0.2 29.8 3.3 < 0.2 29.5 29.5 2.7 87 89 2.2 0.1 16.9 16.9 82.7 82.6 5.7 5.7 <0.2 3.4 81 7.8 IM10 Cloudy Moderate 07:48 6.8 Middle 29.5 7.8 16.9 82.7 88 822362 809782 <0.2 0.1 7.8 5.8 0.1 232 28.3 7.7 65.1 4.4 4.8 90 <0.2 2.1 25.0 7.7 25.0 65.2 4.4 Bottom 28.3 5.8 0.1 245 28.3 7.7 25.0 65.3 4.4 4.8 91 < 0.2 2.2 1.0 0.3 80 5.7 3.5 86 2.0 29.9 7.8 81.3 15.8 <0.2 Surface 29.9 7.8 15.8 81.2 1.0 0.3 29.9 7.8 81.0 5.6 3.5 87 <0.2 2.0 5.2 3.9 0.2 24 28.2 22.4 22.5 68.4 4.7 5.2 87 <0.2 2.0 IM11 Cloudy 822036 811470 Moderate 07:35 7.8 Middle 28.2 7.7 22.5 68.3 88 <0.2 5.4 87 3.9 <0.2 0.2 28.1 6.8 7.7 57.5 57.6 3.9 8.6 90 <0.2 2.1 3.9 Rottom 27.6 7.7 27.1 57.6 6.8 0.1 339 27.6 7.7 3.9 8.7 90 2.0 82 7.8 17.2 85.6 85.6 4.1 86 <0.2 2.0 Surface 29.7 7.8 17.2 85.6 1.0 0.2 87 29.7 7.8 17.2 5.9 4.1 6 86 <0.2 2.0 4.3 0.1 343 28.4 7.7 64.4 4.4 3.2 88 <0.2 2.0 Middle 24.3 64.5 821473 IM12 Cloudy Moderate 07:26 28.4 7.7 4.3 0.1 28.4 7.7 64.6 4.4 3.3 89 7.5 0.2 260 27.1 77 28.3 51.7 6.8 90 <0.2 2.1 Bottom 27.1 7.7 28.3 51.8 3.5 51.8 7.5 0.2 269 27.1 77 28.3 3.5 6.8 9 90 < 0.2 2.0 1.0 29.1 7.8 19.8 86.5 6.0 2.4 Surface 29.1 7.8 19.8 86.4 1.0 29.1 7.8 19.8 86.3 6.0 2.4 7 2.6 Cloudy Moderate 06:47 5.2 Middle 819970 812656 2.6 4.2 28.6 7.8 75.3 5.1 3.0 5.1 Bottom 28.6 7.8 23.2 75.3 4.2 28.6 7.8 23.2 75.3 5.1 3.0 1.0 0.1 116 29.3 7.8 19.6 86.9 2.2 86 <0.2 1.6 Surface 29.3 7.8 19.6 86.9 1.0 0.1 116 29.3 7.8 19.6 86.8 6.0 2.2 8 86 <0.2 1.7 SR2 Cloudy Moderate 06:30 4.1 Middle 87 821479 814146 <0.2 137 87.7 87.8 1.6 Bottom 19.8 87.8 3.1 0.1 138 29.2 7.9 19.8 6.0 3.0 10 88 <0.2 1.6 1.0 0.3 135 29.8 7.8 14.4 82.6 5.8 3.7 7.8 13.8 82.7 1.0 0.3 148 29.8 7.8 13.2 82.7 5.8 3.7 7 4.0 0.2 143 29.6 7.8 17.5 77.0 5.3 2.8 7 -SR3 Moderate 08:09 8.0 7.7 76.7 822128 807559 Cloudy 4.0 0.2 152 29.6 7.7 17.4 76.4 5.3 2.8 5 27.6 27.6 3.9 9.6 9.9 7.0 0.1 176 192 7.7 57.7 57.8 Bottom 7.7 27.7 57.8 3.9 0.1 7.7 1.0 0.5 66 28.6 8.4 21.2 83.7 5.8 4.0 6 Surface 28.6 8.4 21.2 83.6 1.0 0.5 8.4 21.1 83.5 5.8 4.0 66 28.6 8 -5.0 4.9 0.2 134 4.1 8.0 16 27.0 8.4 28.2 59.8 807804 SR4A Fine Moderate 06:02 9.7 Middle 8.4 28.2 59.9 13 817178 137 4.9 0.3 27.1 28.1 4.1 8.0 14 8.4 60.0 0.1 182 26.7 8.4 18 8.7 29.8 61.1 4.1 9.2 Rottom 26.7 8.4 29.8 61.5 4.2 8.7 183 26.7 28.8 9.2 0.1 8.4 29.8 61.8 4.2 16 1.0 0.2 133 8.4 3.3 6.3 19.6 91.0 Surface 28.8 8.4 19.6 90.9 1.0 0.2 135 28.8 8.4 19.6 90.8 6.3 3.3 8 SR5A 05:47 4.7 Middle 816592 810673 Fine Moderate 3.7 0.2 27.1 8.4 4.2 10 28.1 61.4 8.5 Bottom 27.1 8.4 28.1 61.7 4.2 3.7 0.2 27.1 10 318 8.5 Surface 28.4 8.5 21.4 88.5 330 28.4 8.5 1.9 10 SR6A Fine Moderate 05:20 4.4 Middle 10 817960 814724 3.4 0.0 27.8 68.8 Bottom 3.4 1.0 0.4 60 29.0 7.9 89.9 6.2 1.5 Surface 7.9 89.8 1.0 0.4 63 29.0 79 21 1 6.2 1.5 8 1 0.2 19 28.8 7.9 22.0 83.2 5.7 1.2 6 SR7 Cloudy Moderate 05:26 Middle 22.0 83.2 823622 823748 8.1 0.2 20 28.8 79 22.0 83.1 5.7 12 6 15.2 0.0 119 25.8 7.9 60.7 4.2 2.1 2 Bottom 7.9 60.9 15.2 0.0 130 25.8 7.9 61.0 4.2 29.5 29.5 91.5 91.6 1.0 7.8 2.4 Surface 91.6 7.8 6.3 2.4 192 4 6.3 --SR8 Cloudy Moderate 07:17 5.0 Middle 820394 811626 4.0 29.5 7.9 7.9 19.3 92.5 6.3 2.4 4 Bottom 29.5 7.9 19.3 92.6

29.5

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 24 August 19 during

during Mid-Flood Tide

Water Qual	iity wonit	oring Resu	its on		24 August 19	during Mid	-F100a 1	iae																		
Monitoring	Weather	Sea	Sampling	Water	Sampling De	pth (m)	Current Speed	Current	Water Te	emperature (°C)		рН	Salinity (ppt)	DO:	Saturation (%)	Dissolve Oxygen	Turbid	y(NTU)	Suspende (mg		Total Alka (ppm	. 1 000	rdinate Grid	Coordinate HK Grid	Chrom (µg/l	
Station	Condition	Condition	Time	Depth (m)		. ,	(m/s)	Direction	Value	Average	Value	Average	Value Average	Value	Average	Value D	Value	DA	Value	DA	Value	DA (No	rthing)	(Easting)	Value	DA Value DA
					Surface	1.0	0.3	48 49	28.8 28.8	28.8	8.7	8.7	18.8	89.7 89.9	89.8	6.2	3.0		5 4		83 84				<0.2	1.8
C1	Cloudy	Rough	13:26	7.4	Middle	3.7	0.3	50	28.4	28.4	8.7	8.7	20.0	83.8	83.7	5.8	3.1	5.0	4	4	88	88 81	5637	804248	<0.2	-0.2 1.7 1.
	,					3.7 6.4	0.3	54 44	28.4 27.1		8.7 8.6		19.9	83.5 71.0		5.8 4.8	3.1		5 4		88 91				<0.2	1.7
					Bottom	6.4	0.3	45	27.2	27.2	8.6	8.6	27.5	71.3	71.2	4.9	8.9		4		91				<0.2	1.4
					Surface	1.0	0.4	153 167	29.8 29.7	29.8	7.7	7.7	13.4	78.3 78.1	78.2	5.5 5.5 4	4.0		6 5		86 85				<0.2	2.4
C2	Cloudy	Moderate	12:06	11.4	Middle	5.7 5.7	0.2	334 307	27.2 27.2	27.2	7.7	7.7	28.4 28.4	54.1 54.2	54.2	3.7	6.3	8.1	5 4	5	88 87	88 82	5694	806921	<0.2	<0.2 2.2 2.3
					Bottom	10.4	0.2	324	27.2	27.2	7.7	7.7	28.5	55.0	55.1	3.7	, 13.5		4		90				<0.2	2.2
						10.4	0.2	328 302	27.2 29.6		7.7		28.5	55.2 106.1		7.2	14.0		6 4		90 86	+		$\vdash$	<0.2	2.2 1.5
					Surface	1.0 6.3	0.0	312 239	29.6 26.1	29.6	7.9 7.8	7.9	21.7 21.7	106.0 55.5	106.1	7.2 3.8	3.3	1	4		87 87				<0.2 <0.2	1.5
C3	Cloudy	Moderate	14:12	12.6	Middle	6.3	0.1	245	26.1	26.1	7.8	7.8	30.1 30.2	55.2	55.4	3.8	3.5	4.2	4	4	88	88 82	2105	817788	<0.2	<0.2
					Bottom	11.6 11.6	0.3	301 323	25.3 25.3	25.3	7.8	7.8	32.4 32.4	54.6 54.8	54.7	3.7	8.0	-	3	İ	90				<0.2	1.6
					Surface	1.0	0.4	350	29.1	29.1	8.6	8.6	18.2	96.0	96.0	6.7	3.1		6		83				<0.2	1.6
IM1	Cloudy	Rough	12:59	5.2	Middle	1.0	0.5	322	29.0		8.6		18.3	95.9		6.7	3.1	3.5	7	8	- 83	84 81	7933	807113	<0.2	<0.2
IIVI	Cioudy	Kougii	12.59	5.2		4.2	0.4	346	28.4		8.6		21.2	91.4		6.3	3.9	3.5	- 10	°	- 84	04   01	1900	00/113	<0.2	1.6
					Bottom	4.2	0.4	350	28.4	28.4	8.6	8.6	21.2	91.6	91.5	6.3	3.8		8		84				<0.2	1.5
					Surface	1.0	0.2	41 42	29.3 29.3	29.3	8.6	8.6	20.4 20.4	94.1	94.1	6.4	2.6	+	5 3		86 85				<0.2	1.4
IM2	Cloudy	Rough	12:53	7.5	Middle	3.8	0.1	351 355	27.5 27.5	27.5	8.6 8.6	8.6	25.7 25.7 25.7	71.2 71.2	71.2	4.9 4.9	4.1	5.0	3	5	88 90	88 81	8178	806142	<0.2	<0.2 1.4 1.5
					Bottom	6.5	0.1	311	26.5	26.5	8.6	8.6	30.6	61.4	61.6	4.2	8.2		6		89				<0.2	1.2
						6.5 1.0	0.1	322 306	26.5 28.6		8.6 8.6		30.7	61.7 84.9	84.8	4.2 <sup>4</sup>	8.3 2.7		6		90 84			$\vdash \vdash$	<0.2	1.3
					Surface	1.0 3.7	0.3	314 328	28.6 27.0	28.6	8.6 8.6	8.6	22.2	84.6 64.5		5.8 4.4	2.7 4.2	1	7 8	Į	85 88				<0.2	1.3
IM3	Cloudy	Rough	12:46	7.4	Middle	3.7	0.2	345	27.0	27.0	8.6	8.6	28.0	64.8	64.7	4.4	4.2	5.0	9	8	89	88 81	8773	805609	<0.2	1.2
					Bottom	6.4	0.1	353 357	26.3 26.4	26.4	8.6 8.5	8.5	31.1 31.1	57.0 57.8	57.4	3.9 3.9	8.3	+	7		90				<0.2	1.0
					Surface	1.0	0.1	235 246	28.4 28.5	28.5	8.6 8.6	8.6	21.0 21.1	76.4 76.2	76.3	5.3	2.6		6		86 85				<0.2	2.2
IM4	Cloudy	Rough	12:33	8.0	Middle	4.0	0.4	358	27.0	27.0	8.6	8.6	27.8	64.3	64.2	4.4	3.4	4.1	6	6	89	89 81	9742	804625	<0.2	-0.2 1.4
	O.Outu,	rtougn	12.00	0.0		7.0	0.4	329 349	27.0 26.5		8.6 8.6		27.8	64.0 55.2		3.7	3.6	+	5 4	Ĭ	90		v	00.020	<0.2	1.4
					Bottom	7.0 1.0	0.3	321	26.5	26.5	8.6	8.6	30.2	55.4	55.3	3.8	6.3		6		90			<b></b>	<0.2	1.2
					Surface	1.0	0.3	277 289	29.6 29.6	29.6	8.5 8.5	8.5	14.2 14.2	82.4 82.0	82.2	5.8 5.8	3.8	_	5	İ	85 85				<0.2	1.7
IM5	Cloudy	Rough	12:24	7.9	Middle	4.0	0.3	354 326	27.1 27.0	27.1	8.6	8.6	27.2 27.0	62.3 62.8	62.6	4.3	5.4 5.5	5.1	3	4	88 87	87 82	0718	804871	<0.2	<0.2 1.7 1.6
					Bottom	6.9	0.4	23 24	26.7	26.7	8.6	8.6	29.3 29.4	58.2 58.1	58.2	4.0 4	6.1		4	İ	89				<0.2	1.7
					Surface	1.0	0.2	296	29.2	29.1	8.5	8.5	15.2	84.4	84.3	6.0	3.5		3		86				<0.2	2.2
						1.0 4.1	0.3	321 279	29.0 28.2		8.5 8.6		15.2	84.1 71.3		6.0 4.9	3.6		4 5	1	85 90				<0.2	2.2
IM6	Cloudy	Rough	12:17	8.1	Middle	4.1	0.2	303	28.2	28.2	8.6	8.6	21.7	71.3	71.3	4.9	5.0	5.5	5	5	88	88 82	1074	805836	<0.2	<0.2
					Bottom	7.1 7.1	0.1	60 60	27.4 27.4	27.4	8.6 8.6	8.6	25.5 25.4 25.5	62.4	62.6	4.3 4.3	8.0	-	5 6		90				<0.2	1.6
					Surface	1.0	0.4	253 261	29.2 29.2	29.2	8.4	8.4	14.5	84.5 84.5	84.5	6.0	2.5		3		87 86				<0.2	2.4
IM7	Cloudy	Rough	12:02	7.8	Middle	3.9	0.3	249	28.8	28.8	8.5	8.5	16.2	80.1	80.0	5.7	3.6	3.9	2	3	88	88 82	1369	806821	<0.2	2.3
		-5		-=		3.9 6.8	0.4	257 16	28.8 27.0		8.5 8.5	-	16.2 10.2 27.8 27.8	79.8 54.3	54.4	5.6 3.7	3.6	+	3	_	89 90				<0.2	2.3
					Bottom	6.8	0.0	16 244	27.0 29.9	27.0	8.5 7.8	8.5	27.8	54.4 87.9		3.7 3.7 6.2	5.6 3.9		4		89 85			<b>  </b>	<0.2	2.6
					Surface	1.0	0.2	245	29.9	29.9	7.8	7.8	14.1	87.8	87.9	6.2	4.0	1	5		87				<0.2	2.3
IM8	Cloudy	Moderate	12:34	7.6	Middle	3.8	0.2	273 281	29.5 29.5	29.5	7.8	7.8	18.7	78.0 78.0	78.0	5.4 5.4	4.5	6.7	6	5	87 89	88 82	1838	808117	<0.2	<0.2 2.4 2.4
					Bottom	6.6	0.1	183	27.9	27.9	7.7	7.7	27.3	58.2	58.3	3.9	11.2	1	6	•	90				<0.2	2.3
L					1	6.6	0.1	190	27.9		7.7		27.3	58.3		3.9	11.6		6	L	90				<0.2	2.3

24 August 19

Bottom

Surface

Middle

Bottom

Surface

Middle

Rottom

Surface

Middle

Bottom

Surface

Middle

Bottom

Middle

Bottom

Surface

Middle

Bottom

Surface

Middle

Bottom

Water Quality Monitoring Results on

SR2

SR3

SR4A

SR6A

SR7

SR8

Cloudy

Cloudy

Cloudy

Cloudy

Cloudy

Cloudy

Cloudy

Moderate

Moderate

Moderate

Moderate

Moderate

Moderate

Moderate

13:50

12:25

13:55

14:11

14:43

14:45

4.0

8.3

8.6

3.8

16.4

5.2

Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value Value DA (Northing) (Easting) Value DA Value Average 0.1 277 89.8 1.0 0.1 30.4 14.4 6.2 3.8 4 85 <0.2 2.2 3.6 0.1 239 30.2 7.8 7.8 14.9 86.2 85.8 6.0 3.8 4 88 <0.2 2.2 IM9 Cloudy Moderate 12:41 7.2 Middle 7.8 88 822079 808827 <0.2 3.6 0.1 248 30.2 14.9 6.2 0.2 267 28.4 90 < 0.2 2.2 7.7 24.6 63.6 4.3 4.4 Bottom 28.4 7.7 24.6 63.9 4.4 7.7 64.2 4.4 0.2 290 24.6 43 90 24 6.2 28.4 <0.2 0.0 29.9 4.3 88.7 2.3 6.2 <0.2 Surface 29.9 7.8 15.3 88.6 7.8 15.3 88.5 6.2 86 2.4 1.0 0.0 12 29.9 4.3 4 < 0.2 0.3 29.5 29.4 77.3 76.9 6.5 6.7 87 88 314 18.0 18.0 <0.2 2.3 3.4 7.8 5.3 IM10 Cloudy Moderate 12:49 6.7 Middle 29.5 7.8 18.0 77.1 88 822376 809815 <0.2 5.7 0.3 298 27.9 7.7 58.9 4.0 9.6 6 90 <0.2 2.2 26.5 7.7 26.5 59.0 4.0 Bottom 27.9 5.7 0.3 310 27.9 7.7 59.0 4.0 9.6 90 < 0.2 2.4 1.0 0.2 325 29.7 6.1 2.9 86 7.8 89.1 4 2.0 17.9 <0.2 Surface 29.7 7.8 18.0 89.0 1.0 0.2 333 29.6 7.8 88.8 6.1 2.9 5 87 <0.2 2.1 4.0 0.4 295 27.9 68.1 67.8 4.7 5.9 88 <0.2 2.1 24.8 IM11 Cloudy 822068 811452 Moderate 13:01 7.9 Middle 27.9 7.7 24.9 68.0 88 <0.2 4.0 0.4 4.6 89 6.1 <0.2 6.9 7.7 57.5 57.8 3.9 8.3 <0.2 2.1 Rottom 27.4 7.7 27.5 57.7 39 6.9 0.2 324 27.4 7.7 3.9 8.3 90 2.2 288 29.8 7.9 18.3 91.3 6.3 3.8 86 <0.2 2.1 Surface 29.8 7.9 18.3 91.1 1.0 0.3 29.8 7.9 18.3 6.2 3.9 3 87 <0.2 2.1 4.2 0.4 267 28.1 4.8 5.8 4 87 <0.2 2.2 13:07 Middle 821446 IM12 Cloudy Moderate 7.8 25.5 70.1 0.4 28.1 7.8 4.8 5.8 87 7.3 0.1 318 27.0 7.7 28.2 61.4 4.2 7.2 90 <0.2 2.2 Bottom 27.0 7.7 28.3 61.5 4.2 61.5 7.3 0.1 347 27.0 77 28.3 4.2 7.3 90 < 0.2 2.1 1.0 30.2 7.9 19.6 100.2 6.8 2.4 Surface 30.2 7.9 19.7 100.2 30.2 7.9 19.7 100.2 6.8 2.4 3 2.6 SR1A Cloudy Moderate 13:33 5.1 Middle 819983 812660

82.7 83.0

102.0

102 1

98.2 98.2

88.4

88.4

73.8

73.5

60.8

99.6

99.3

85.6 85.5

67.6

108.6

87.3

110 9

84.8 84.4

114.6 115.0

70.6 70.5

56.5 56.7

92.9 92.6

72.3

23.1

18.5

22.4

14.0

20.7

27.6

20.2

22.2

25.7

21.3

23.5

21.9

28.4

32.3

16.4

24.8

23.1

18.5

18.5

22.4 22.4

14.1

14.0

20.7

20.8

27.6 27.6

20.2

20.3

22.2

25.6

21.3

21.7

21.7

23.6

21.9

28.4

32.3 32.2

16.4 16.4

24.8

7.8

7.9

7.9

7.8

7.8

7.7

8.7

8.7

8.7

8.7

7.9

7.8

7.8

7.9

7.8

7.8

79

79

7.9

7.8

7.8

7.8

7.8

7.7

7.7 8.7

8.7

8.7

8.7

8.7

8.7

8.7

8.7

8.6

8.6

8.9

8.9

8.8

8.8

7.9 7.9

7.8

7.8

7.8

7.8

7.9

7.9

7.8

30.0

29.3

30.3

29.2

27.6

29.4

28.6

27.4

29.3

29.6

26.8

25.2

30.5

28.3

5.6 5.6

7.0

7.0

6.6

6.2

6.2

5.1

5.0

4.1

6.8

6.8

5.9

4.6

7.4

7.4

6.0

7.6

7.6

5.8 5.8

7.7 7.8

4.8

4.8

3.9

3.9

6.4

5.8

3.9

64

4.9

6.6

41

4.5

82.9

102.1

98.2

88.4

73.7

60.9

99.5

85.6

65.6

108.8

84.6

114.8

70.6

56.6

92.8

72.4

7.1

2.8

2.8

3.8

4.0

4.0

2.7

2.8

3.6 3.6

4.6

4.7

5.4

5.4

6.8

4.5

4.5

10.1

10.1

2.3

2.4

4.4

4.4

1.3

1.4

1.9

1.9

3.7

3.7

3.2

3.4

3.3

5

6

6

6

4

6

11

12

6

6

9

4

<2

4

4

3

29.1 29.1

30.0

29 9

29.3

30.3

30.3

29.2

29.2

27.6

29.4

28.6

28.6

27.4

27.3

29.3

29.3

28.4

28.4

28.7

28.7

28.2

28.1

29.6

29.6

26.8

26.8

25.2

25.2

30.5 30.5

28.3

29.4

Suspended Solids

86

87

90

90

821450

822152

817202

817951

823626

820411

<0.2

< 0.2

<0.2

< 0.2

814145

807556

807806

810677

814720

823753

811610

19

2.0

-

1.9

2.1

.

-

-

-

-

-

-

during Mid-Flood Tide

2.6

4.1

41

1.0

1.0

3.0

1.0

1.0

4.2

4.2

7.3

1.0

1.0

4.3

4.3

7.6

1.0

1.0

3.1

3.1

1.0

1.0

2.8

2.8

1.0

1.0

8.2

8.2

15.4

15.4

1.0

0.1

0.1

0.2

0.3

0.3

0.3

0.0

0.1

0.0

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.1

0.2

0.0

0.0

0.1

0.1

345

349

340

313

267

277

230

246

235

253

232

255

231

244

309

329

333

78

81

109

115

45

48

65

67

165

167

DA: Depth-Averaged Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

13:14

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 27 August 19 during N

27 August 19 during Mid-Ebb Tide

Water Qua	lity Monit	toring Res	ults on		27 August 19	during Mid-E	Ebb Tid	e																		
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	th (m)	Current Speed	Current	Water Te	emperature (°C)		pН	Salin	ity (ppt)	DO S	aturation (%)	Dissolved Oxygen	Turbi	dity(NTU)	Suspende (mg		Total Alkalii (ppm)	Coordinate	Coordinate HK Grid	Chromiun (µg/L)	M Nickel (μg/L)
Station	Condition	Condition	Time	Depth (m)	, , ,	` '	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value D	A Valu	e DA	Value	DA	Value D	(Northing)	(Easting)	Value D	DA Value DA
					Surface	1.0	0.5 0.5	186 197	28.1	28.1	8.5 8.5	8.5	19.3 19.3	19.3	81.8 81.6	81.7	5.8	2.4	_	4		83 84			<0.2	1.0
C1	Fine	Rough	10:00	8.6	Middle	4.3 4.3	0.4	204 215	27.4 27.4	27.4	8.5 8.5	8.5	22.1 22.2	22.2	68.0 67.8	67.9	4.8 4.7	2.9		4	4	88 89	815632	804237	<0.2	0.2 0.7 1.0
					Bottom	7.6 7.6	0.3	222 242	26.4 26.4	26.4	8.5 8.5	8.5	28.6 28.6	28.6	50.6 50.9	50.8	3.5 3.5	1.6		4 5	1	91 91			<0.2	1.1
					Surface	1.0	1.4	164 179	28.9	28.9	7.7	7.7	16.1 16.1	16.1	69.8 69.5	69.7	4.9	6.2		7		85 86			<0.2	1.2
C2	Cloudy	Moderate	12:06	10.1	Middle	5.1	0.9	171	26.8 26.8	26.8	7.6	7.6	26.8	26.8	49.3	49.3	3.4 3.4	10.0	□ 。2	6	7	89 89	825665	806935	40.2	0.2 1.0 1.1
					Bottom	9.1 9.1	0.3	143 149	26.3 26.3	26.3	7.6 7.6	7.6	28.9	28.8	48.7 48.9	48.8	3.3 3.4 3.	11		6	1	90			<0.2	0.9
					Surface	1.0	0.3	134	27.1	27.2	7.7	7.7	24.9	24.8	70.0	70.2	4.8	2.5		4	1	86			<0.2	1.2
СЗ	Cloudy	Moderate	09:50	11.8	Middle	1.0 5.9	0.3	146 54	27.2 26.6	26.6	7.7	7.7	24.8 26.1	26.1	70.3 66.4	66.4	4.9 4.	2.8	36	4	4	86 88 8	822116	817798	<0.2	1.2 1.5 1.4
	,				Bottom	5.9 10.8	0.2	58 95	26.6 25.6	25.6	7.7 7.6	7.6	26.1 30.0	29.9	66.4 72.5	72.8	4.6 5.0 5.	2.9		4	1	90			<0.2	1.6
					Surface	10.8	0.3	100 218	25.7 27.8	27.8	7.6 8.6	8.6	29.9 21.4	21.4	73.0 74.3	74.2	5.0	2.8		5		90 83			<0.2	1.6
IM1	Fine	Rough	10:27	5.3	Middle	1.0	0.3	229	27.8	27.0	8.6	0.0	21.4	21.4	74.0	74.2	5.2	2 2.9		-	5	- 8	817955	807121	<0.2	1.3
livii	Fille	Rougii	10.27	5.5		4.3	0.1	283	26.7		8.6		27.5		57.0		3.9	4.1		- 6	ľ	92	617933	00/121	<0.2	0.7
					Bottom	4.3 1.0	0.1	283 221	26.7 27.8	26.7	8.6 8.5	8.6	27.5 21.3	27.5	57.5 76.3	57.3	4.0 4. 5.3	4.1 3.0	_	5 4		92 83			<0.2	0.8 1.4
					Surface	1.0 3.7	0.1 0.1	230 236	27.7 27.2	27.8	8.5 8.5	8.5	21.3 24.0	21.3	76.1 64.4	76.2	5.3 4.5	9 3.0	_	5 6	1	84 88			<0.2	1.3
IM2	Fine	Moderate	10:33	7.3	Middle	3.7 6.3	0.1	246 324	27.2 26.3	27.2	8.5 8.6	8.5	24.0 29.1	24.0	64.7 50.6	64.6	4.5	3.8	3.8	7	6	88 92	818180	806143	<0.2	0.2 1.3 1.3 1.0
					Bottom	6.3	0.0	325 176	26.3	26.3	8.6 8.5	8.6	29.0	29.1	50.9 83.2	50.8	3.5 3.5 5.9	5 4.7 5.1		7		92			<0.2	1.2
					Surface	1.0	0.4	189 167	26.7	26.7	8.5 8.5	8.5	26.6 28.1	26.6	83.1 46.9	83.2	5.9 3.2	5.2		5	1	84			<0.2	1.1
IM3	Fine	Moderate	10:39	7.4	Middle	3.7	0.1	182 185	26.4	26.4	8.5 8.5	8.5	28.1	28.1	47.0 49.8	47.0	3.2	6.7	6.3	5	5	88 91	818805	805602	<0.2 <0	0.2 1.0 1.0 1.1
					Bottom	6.4	0.1	188	26.2	26.2	8.5 8.5	8.5	28.8	28.8	50.2	50.0	3.5 3.5 5.9	7.1		6		92		<u> </u>	<0.2	0.9
					Surface	1.0	0.2	228	27.8 27.4	27.9	8.5 8.5	8.5	19.6	19.6	83.1	83.2	5.9	1.0		4	1	84 87			<0.2	1.5
IM4	Fine	Moderate	10:48	8.1	Middle	4.1	0.1	179 180	27.4	27.4	8.5	8.5	21.6	21.6	74.7	74.8	5.2	2.6	2.4	5	5	88	819703	804620	<0.2	1.5
					Bottom	7.1	0.1	154 168	27.2 27.1	27.2	8.5 8.5	8.5	22.7	22.8	69.4 69.5	69.5	4.9 4.9	3.0		4		91 92			<0.2	1.0 0.9
					Surface	1.0	1.2	200 216	28.0 28.0	28.0	8.5 8.5	8.5	19.1 19.1	19.1	81.6 81.4	81.5	5.8 5.7 5.	1.6		2	1	83 83			<0.2	1.5
IM5	Fine	Moderate	11:00	8.2	Middle	4.1 4.1	1.0	202 204	27.1 27.1	27.1	8.5 8.5	8.5	22.0 21.9	22.0	63.8 63.7	63.8	4.5 4.5	8.2 8.2	7.0	3	3	87 87	820730	804863	<0.2	0.2 1.0 1.3
					Bottom	7.2 7.2	0.8	192 202	26.7 26.7	26.7	8.5 8.5	8.5	26.5 26.5	26.5	52.5 52.7	52.6	3.6 3.6	13.		4		91 92			<0.2	1.3
					Surface	1.0	1.1	230 232	28.1 28.1	28.1	8.5 8.5	8.5	18.3	18.3	81.5 81.4	81.5	5.8 5.7 5.	2.2		6	1	83 83			<0.2	1.4
IM6	Fine	Rough	11:09	7.8	Middle	3.9 3.9	1.0	213 220	27.5 27.4	27.5	8.5 8.5	8.5	20.7	20.7	68.7 68.4	68.6	4.8	3.2		5 6	6	88 88	821047	805851	<0.2	0.2 1.2 1.4
					Bottom	6.8	0.9 1.0	210 212	26.4 26.4	26.4	8.5 8.5	8.5	27.5 27.4	27.4	54.7 55.1	54.9	3.8 3.	B 10.		7 6	1	91 92			<0.2	1.7
					Surface	1.0 1.0	1.2 1.2	245 262	27.6 27.6	27.6	8.4 8.4	8.4	20.2	20.3	75.8 75.7	75.8	5.3 5.3	2.6		3		83 83			<0.2 <0.2	1.4
IM7	Fine	Rough	11:16	7.9	Middle	4.0 4.0	0.8	246 270	27.3 27.3	27.3	8.5 8.5	8.5	21.5 21.6	21.6	69.1 68.9	69.0	4.9 4.8	3.1		4 5	5	87 87	821354	806843	<0.2 <0	0.2 1.8 1.5
					Bottom	6.9	0.6	239 248	26.4	26.5	8.5 8.5	8.5	27.3 27.3	27.3	54.5 55.2	54.9	3.8 3.8	6.8		6	1	91			<0.2	1.6
					Surface	1.0	0.5	210 221	28.8	28.8	7.8	7.8	18.5	18.5	85.7 85.6	85.7	6.0	1.7		6		85 86			<0.2	1.5
IM8	Cloudy	Moderate	11:33	7.0	Middle	3.5	0.5	205	28.2	28.2	7.7	7.7	20.7	20.7	70.8	70.8	4.9 5.	3.3	3.0	5	6	88 88	821826	808122	-O 2	0.2 1.8 1.7
					Bottom	6.0	0.4	256 267	27.9	27.9	7.7	7.7	23.1	23.1	75.6 76.5	76.1	5.2 5.3	3.0		5	1	89			<0.2	1.8
					1	0.0	∨.⊤		-1.0						, , , , ,		J.U	J.0			1	-			70.2	

### Expansion of Hong Kong International Airport into a Three-Runway System

Water Quality Monitoring Results on

Water Qua	lity Monit	toring Resi	ults on		27 August 19	during Mid-	Ebb Tid	е																						
Monitoring	Weather	Sea	Sampling	Water	Sampling Dept	h (m)	Current Speed	Current	Water Te	mperature (°C)		рН	Salir	nity (ppt)		aturation (%)	Dissol Oxyg		Turbidity(I	NTU)	Suspende (mg/		Total A		Coordinate HK Grid	Coordinate HK Grid	Chron (µg		Nickel (µ	μg/L)
Station	Condition	Condition	Time	Depth (m)			(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA	Value	DA
					Surface	1.0	0.6	161 162	28.7	28.7	7.7	7.7	18.6 18.6	18.6	81.5 81.5	81.5	5.7	-	2.5	-	6 5		86 86	-			<0.2	-	1.8	
IM9	Cloudy	Moderate	11:27	6.6	Middle	3.3	0.4	166	28.0	27.9	7.7	7.7	21.8	21.9	63.8	63.6	4.4	5.1	4.0	3.6	5	6	89	88	822091	808827	<0.2	<0.2	1.6	1.6
					B	3.3 5.6	0.4	174 127	27.9 27.7	07.7	7.7		22.0 24.7		63.4 73.4		4.4 5.0		4.1 4.4	-	6 7		89 90	ł			<0.2	.	1.6 1.5	
					Bottom	5.6	0.1	134	27.7	27.7	7.7	7.7	24.7	24.7	73.9	73.7	5.1	5.1	4.3		8		90				<0.2		1.6	
					Surface	1.0	0.8	123 131	28.6 28.6	28.6	7.7	7.7	18.5 18.6	18.5	73.8 72.2	73.0	5.2	4.9	3.2	ŀ	6		86 87	1			<0.2		1.4	
IM10	Cloudy	Moderate	11:17	6.7	Middle	3.4 3.4	0.8	126 127	28.0 28.1	28.0	7.7	7.7	22.6 22.3	22.4	67.8 67.7	67.8	4.7	4.9	6.4 6.9	8.6	8 9	9	88 89	88	822388	809785	<0.2	<0.2	1.4	1.5
					Bottom	5.7	0.6	98	27.5	27.5	7.7	7.7	25.1	25.1	67.3	68.1	4.6	4.7	14.9	t	11		90	İ			<0.2		1.6	
						5.7 1.0	0.6	104 115	27.5 28.6		7.7		25.0 19.5		68.9 81.8		4.7 5.7		16.6 2.1		10 6		90 86				<0.2	-+	1.5 2.1	_
					Surface	1.0	0.7	118	28.6	28.6	7.8	7.8	19.5	19.5	81.5	81.7	5.7	4.9	2.2	ļ	7		86	1			<0.2	ļ	2.1	
IM11	Cloudy	Moderate	11:02	8.4	Middle	4.2 4.2	0.6	111 111	27.3 27.3	27.3	7.7	7.7	25.6 25.6	25.6	59.4 59.6	59.5	4.1	-	8.6 8.6	6.8	6 5	6	88	88	822078	811438	<0.2	<0.2	1.7	1.9
					Bottom	7.4 7.4	0.4	99 101	26.9 26.9	26.9	7.7	7.7	27.4 27.5	27.4	66.4 66.9	66.7	4.5 4.6	4.6	9.8 9.7	Ī	4 5		90 90				<0.2	. [	1.8	
					Surface	1.0	0.5	101	28.5	28.5	7.8	7.8	20.1	20.1	78.1	78.1	5.4		2.9		5		85				<0.2	-	1.4	-
						1.0 4.3	0.5	105 100	28.5 28.4		7.8 7.8		20.1		78.0 73.9		5.4 5.1	5.3	2.9 3.7	-	6 5		85 88	1			<0.2	. ŀ	1.3	
IM12	Rainy	Moderate	10:54	8.6	Middle	4.3	0.6	109	28.4	28.4	7.8	7.8	20.5	20.4	73.6	73.8	5.1		3.7	4.8	6	6	89	88	821453	812023	<0.2	<0.2	1.4	1.4
					Bottom	7.6 7.6	0.4	101 105	27.2 27.2	27.2	7.7	7.7	26.1 26.1	26.1	62.8 63.0	62.9	4.3	4.3	7.8 7.9	-	6 7		89 90	1			<0.2	.	1.4	
					Surface	1.0 1.0	-	-	28.4 28.4	28.4	7.8	7.8	20.0	20.0	79.4 79.2	79.3	5.5 5.5	-	2.8		6		-				-	F	-	
SR1A	Cloudy	Calm	10:33	5.1	Middle	2.6			-		-		-		-		-	5.5	-	4.6	-	6			819983	812662	-		-	.
O.C.	Oloudy	Guin	10.00	0.1		2.6 4.1	-	-	27.3		7.7		25.0		70.8		4.9		6.3	10	5	Ü	-	ł	010000	012002	-		-	
					Bottom	4.1	-	-	27.3	27.3	7.7	7.7	25.1	25.0	71.1	71.0	4.9	4.9	6.4		6		-				-			
					Surface	1.0	0.5	81 84	28.5 28.5	28.5	7.8	7.8	19.6 19.6	19.6	84.8 84.2	84.5	5.9 5.9		2.1	-	5 6		87 88	1			<0.2		1.2	
SR2	Cloudy	Moderate	10:17	5.8	Middle	-	-	-	-	-		-	-		-	-	-	5.9		2.3		7	-	89	821449	814152	-	<0.2		1.3
					Bottom	4.8	0.4	116	28.0	28.0	7.7	7.7	21.4	21.3	81.7	82.4	5.7	5.8	2.4		8		90				<0.2	. [	1.4	
					Surface	4.8 1.0	0.4	125 192	28.0 28.6	28.5	7.7	7.7	21.3 19.7	19.8	83.0 76.8	76.5	5.8 5.3		2.4		8		90				<0.2	_	1.4	-
					Surface	1.0 4.1	0.6	205 217	28.5 27.9		7.7		19.8 21.6		76.2 68.9		5.3 4.8	5.1	2.6 3.8	-	6		-				-	. [	-	
SR3	Cloudy	Moderate	11:39	8.1	Middle	4.1	0.4	229	27.9	27.9	7.7	7.7	21.6	21.6	68.9	68.9	4.8		3.9	3.6	7	6	-	-	822166	807593	-		-	-
					Bottom	7.1 7.1	0.4	247 271	27.6 27.6	27.6	7.6	7.6	25.3	25.2	76.2 77.0	76.6	5.2	5.3	4.4 4.4	-	4 5		-	1			-		-	
					Surface	1.0 1.0	0.3	252 257	27.8 27.8	27.8	8.5 8.5	8.5	19.5 19.6	19.5	77.4 77.2	77.3	5.5 5.4	Ĺ	3.1	ļ	5 6		-				-	ŀ		
SR4A	Fine	Rough	09:31	9.4	Middle	4.7	0.0	95	27.5	27.5	8.5	8.5	20.0	20.0	75.0	74.8	5.3	5.4	3.4	3.4	7	7	÷		817197	807804	-		-	_
OI(4A	1 1110	rtougii	03.51	3.4		4.7 8.4	0.0	103 67	27.5 27.3		8.5 8.5		20.0		74.5 63.7		5.3 4.5		3.4	5.4	6 7	,	-	1	017137	007004	-		-	
					Bottom	8.4	0.1	73	27.3	27.3	8.5	8.5	22.6	22.6	63.5	63.6	4.4	4.5	3.7		8		-				-		-	
					Surface	1.0	0.1	337 349	27.7 27.7	27.7	8.5 8.5	8.5	19.0 19.0	19.0	76.3 76.1	76.2	5.4	H	4.1 4.1	ŀ	19 21		-				-	.	-	
SR5A	Fine	Moderate	09:16	4.9	Middle	-	-	-	-	-	-	-	-			-	-	3.4	-	6.3		15	-		816572	810701	-	[	-	-
					Bottom	3.9	0.1	270	26.4	26.4	8.5	8.5	28.1	28.0	57.0	57.3	3.9	3.9	8.4	Į	10		-	1			-		-	
					0	3.9 1.0	0.1	295 331	26.4		8.5 8.3		28.0		57.5 64.2		3.9 4.5		8.5 12.4		9 18		-				-		-	_
					Surface	1.0	0.1	305	27.1	27.1	8.3	8.3	22.1	22.1	64.0	64.1	4.5	4.5	12.4	ļ	20		-	1			-	. [		
SR6A	Fine	Moderate	08:47	5.2	Middle	-			-	-	-	-	÷	-	-	-	-	-	-	14.6	-	23	-	-	817971	814739	-			-
					Bottom	4.2 4.2	0.0	243 253	26.8 26.8	26.8	8.3 8.3	8.3	24.6	24.6	61.5 61.7	61.6	4.3	4.3	16.8 16.8	F	27 28		-				-	. [	-	
					Surface	1.0	0.4	72	27.9	27.9	7.7	7.7	20.7	20.6	85.1	85.2	6.0		1.9		6		-				-		-	
607	Claude	Madass	00.00	45.7		1.0 7.9	0.4	76 352	27.9 27.5		7.7		20.6		85.2 77.1		6.0 5.4	5.7	2.1 1.3	1.9	5 5	-	-	1	000000	000744	-		-	
SR7	Cloudy	Moderate	09:09	15.7	Middle	7.9 14.7	0.1	352 44	27.5 24.8	27.5	7.7 7.4	7.7	22.1 31.6	22.1	77.0 70.8	77.1	5.4 4.9		1.3	1.9	6	5	-	·	823639	823744	-			-
					Bottom	14.7	0.3	44	24.9	24.9	7.4	7.4	31.5	31.6	70.9	70.9	4.9	4.9	2.3	-	3									
					Surface	1.0	-	-	28.6 28.6	28.6	7.7	7.7	20.7	20.7	73.8 73.5	73.7	5.1 5.1	_ F	5.2 5.3	Ţ	4 6		-	1			$\vdash \exists$	F	-	
SR8	Cloudy	Calm	10:45	5.3	Middle	-	-	-	-	-	-	-	-		-	-	-	5.1	-	7.1	-	6	-	.	820388	811639	-		-	-
					Bottom	4.3			27.3	27.3	7.6	7.6	25.5	25.5	59.9	60.0	4.1	4.1	9.0	ŀ	6		-	i			-	. t	-	
					Dottom	4.3	-	-	27.3	21.0	7.6	7.0	25.5	20.0	60.0	00.0	4.1	-6.1	8.8		7						-			

#### Expansion of Hong Kong International Airport into a Three-Runway System

Water Quality Monitoring
Water Quality Monitoring Results on

Water Qua	lity Moni	toring Res	ults on		27 August 19	during Mid-	-Flood T	ide																					
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	uth (m)	Current Speed	Current	Water T	emperature (°C)		pН	Salir	ity (ppt)	DO Sa	aturation %)	Disso Oxyg		Turbidity(	NTU)	Suspende (mg		Total Alk (ppn		Coordinate HK Grid	Coordinate HK Grid	Chromium (µg/L)	Nickel	l (µg/L)
Station	Condition	Condition	Time	Depth (m)	Sampling Dep	ar (iii)	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value DA	A Value	DA
					Surface	1.0	0.2	67 68	27.7 27.7	27.7	8.5 8.5	8.5	22.6 22.6	22.6	73.8 74.1	74.0	5.1 5.1		2.6 2.6		5 6		83 84				<0.2	1.0	-
C1	Cloudy	Rough	17:30	8.1	Middle	4.1	0.1	40	27.2	27.2	8.6	8.6	23.0	23.1	66.7	66.4	4.7	4.9	2.8	3.0	5	5	88	88	815602	804238	<0.2	1.0	0.9
	,				Bottom	4.1 7.1	0.1	41 36	27.1 26.7	26.7	8.6 8.6		23.1 26.6	26.6	66.0 53.0	53.0	4.6 3.7	3.7	2.8 3.7	-	5		91 91				<0.2	0.9	1
						7.1 1.0	0.1 1.4	38 69	26.7 29.1		8.6 7.8	8.6	26.6 16.0		52.9 76.0		3.7 5.3	3.1	3.6 5.5		5 6		92 85			<u> </u>	<0.2	0.9 2.1	$\vdash$
					Surface	1.0	1.5	67	29.1	29.1	7.8	7.8	16.0	16.0	76.0	76.0	5.3	4.4	5.5		7		86				<0.2	2.2	1
C2	Cloudy	Rough	16:06	9.9	Middle	5.0 5.0	0.6 0.7	77 76	26.7 26.8	26.7	7.7	7.7	27.2 27.0	27.1	49.2 49.1	49.2	3.4		10.9 11.0	9.7	7 8	8	89 89	88	825661	806967	<0.2	1.9	
					Bottom	8.9 8.9	0.2	58 62	26.3 26.3	26.3	7.6	7.6	28.9	28.9	49.4 49.5	49.5	3.4	3.4	12.7 12.7		8 9		90 90				<0.2 <0.2	2.0 1.9	1
					Surface	1.0	0.1	220 229	28.1	28.1	7.8	7.8	23.1	23.1	80.5 80.5	80.5	5.5 5.5		3.4		6 5		85 86				<0.2	1.1	
СЗ	Cloudy	Moderate	17:56	11.3	Middle	5.7 5.7	0.1	250 262	26.4 26.4	26.4	7.6	7.6	27.2 27.2	27.2	60.2	60.2	4.2	4.9	7.2 7.4	7.2	4	5	88 89	88	822125	817803	<0.2	1.0	1.2
					Bottom	10.3	0.0	271 274	25.4 25.4	25.4	7.6	7.6	30.6	30.6	66.9 67.5	67.2	4.6	4.7	10.9		5	•	90				<0.2	1.3	1
					Surface	1.0	0.0	33	27.4	27.4	8.5	8.5	22.8	22.8	66.9	66.5	4.7		4.1		6		84				<0.2	1.1	
IM1	Claudii	Davish	16:58	5.2	Middle	1.0	0.0	34	27.3		8.5		22.9		66.1		4.6	4.7	4.1	4.6	7	-	- 84	88	817942	807112	<0.2 - <0.	1.2	
IIVI	Cloudy	Rough	10.56	5.2		4.2	0.1	340	26.6		8.5		27.9		50.9		3.5		5.1	4.0	7	·	- 91	00	617942	00/112	<0.2	1.1	1.1
					Bottom	4.2 1.0	0.1	351 54	26.6 27.6	26.6	8.5 8.5	8.5	27.8 23.1	27.8	51.3 73.1	51.1	3.5 5.1	3.5	5.1 7.2		6		91 83				<0.2	1.0	
					Surface	1.0	0.2	56	27.6	27.6	8.5	8.5	23.1	23.1	73.2	73.2	5.1	5.4	7.2		5		84				<0.2	1.1	1
IM2	Cloudy	Moderate	16:52	7.6	Middle	3.8	0.1	64 66	27.5 27.5	27.5	8.5 8.5	8.5	20.2	20.2	71.6 71.6	71.6	5.6 5.6		11.0 11.0	8.6	4 5	6	87 87	87	818149	806154	<0.2	1.0	1.1
					Bottom	6.6 6.6	0.1	64 61	27.5 27.5	27.5	8.5 8.5	8.5	23.2	23.2	65.6 65.3	65.5	4.6 4.5	4.6	7.8 7.8		8		89 91				<0.2	1.1	•
					Surface	1.0	0.5 0.5	55 56	27.6 27.5	27.6	8.5 8.5	8.5	23.5	23.5	71.5 71.7	71.6	5.0 5.0		2.9		7 6		83 84				<0.2	1.2	-
IM3	Cloudy	Moderate	16:46	7.8	Middle	3.9 3.9	0.3	57 56	26.6 26.6	26.6	8.5 8.5	8.5	26.9 26.9	26.9	62.1	61.9	4.3	4.7	6.9	7.2	5 5	6	87 88	88	818804	805591	<0.2	.2 1.2	1.2
					Bottom	6.8	0.2	62	26.2	26.2	8.5	8.5	28.7	28.8	50.3	50.4	3.5	3.5	11.7		4		92				<0.2	1.2	1
					Surface	6.8 1.0	1.3	60 45	26.2 27.4	27.4	8.5 8.5	8.5	28.8	23.7	65.4	65.3	4.5		11.6 7.2		6		92 83				<0.2	1.1	$\vdash$
IM4	Cloudy	Moderate	16:38	8.0	Middle	1.0 4.0	1.4	44 42	27.4 26.9	26.9	8.5 8.5	8.5	23.7 25.5	25.4	65.2 71.6	71.7	4.5 5.0	4.8	7.2 6.4	6.8	7	9	83 88	88	819702	804623	<0.2	1.2	1.4
livit	Cioudy	woderate	10.36	6.0		4.0 7.0	1.1 0.9	43 43	26.9 26.4		8.5 8.5		25.3 28.1		71.7 51.0		5.0 3.5		6.4	0.0	10 10	9	88 92	00	619702	804023	<0.2	1.2	1.4
					Bottom	7.0	0.9	43 34	26.4	26.4	8.5 8.4	8.5	28.1	28.1	51.3 75.1	51.2	3.5 5.3	3.5	6.8		11		92 84				<0.2	1.6	Щ
					Surface	1.0	1.3	35	27.7	27.7	8.4	8.4	20.2	20.2	75.0	75.1	5.3	5.0	3.2		4		84				<0.2	2.0	1
IM5	Cloudy	Moderate	16:30	7.5	Middle	3.8	0.9 1.0	35 34	27.3 27.3	27.3	8.5 8.5	8.5	22.2 22.2	22.2	67.2 67.3	67.3	4.7		9.1 9.1	8.4	3 4	3	88 88	88	820733	804859	<0.2	1.9	1.9
					Bottom	6.5 6.5	0.9	37 38	27.2 27.2	27.2	8.5 8.5	8.5	23.1	23.1	62.0 61.8	61.9	4.3	4.3	12.9 12.9		2		91 92				<0.2	1.9	
					Surface	1.0	1.0	22 25	28.0 28.0	28.0	8.4 8.4	8.4	18.8 18.9	18.8	80.2 79.9	80.1	5.7 5.6		2.3		5 6		83 83				<0.2	1.9	$\Box$
IM6	Cloudy	Moderate	16:19	8.2	Middle	4.1	0.9	24 26	27.0	27.0	8.5	8.5	24.2	24.2	61.6	61.7	4.3	5.0	5.0	5.4	4	5	87 87	87	821072	805840	<0.2	1.8	1.8
					Bottom	7.2	0.7	23	26.5	26.5	8.5	8.5	27.0	27.0	53.9	54.2	3.7	3.8	8.7		4		91				<0.2	1.8	1
					Surface	7.2 1.0	0.8 1.1	24 24	26.5 27.8	27.8	8.5 8.4	8.4	27.0 19.4	19.4	54.4 78.7	78.6	3.8 5.6		8.7 2.3		5 6	<u> </u>	92 84				<0.2	1.9	
	0		1000			1.0 4.2	1.2	25 25	27.8 27.1		8.4 8.4		19.4 24.0		78.5 67.0		5.5 4.7	5.1	2.4 3.9		6	_	84 87		004045		<0.2	1.6	1
IM7	Cloudy	Moderate	16:08	8.3	Middle	4.2 7.3	1.0 0.8	26 24	27.1 26.6	27.1	8.4 8.5	8.4	23.9 25.7	24.0	67.7 53.6	67.4	4.7 3.7		3.9 4.9	3.7	4	5	88 91	88	821343	806852	<0.2 <0.2	1.6	1.7
					Bottom	7.3	0.8	24	26.6	26.6	8.5	8.5	25.7	25.7	53.8	53.7	3.7	3.7	4.9		5		91				<0.2	1.9	Щ
					Surface	1.0	0.4	16 18	28.4 28.4	28.4	7.6	7.6	19.6 19.6	19.6	72.1 72.0	72.1	5.0	5.0	3.8		5 4	l	85 85				<0.2	2.1 1.9	1
IM8	Cloudy	Moderate	16:28	6.8	Middle	3.4	0.2	15 18	28.2 28.2	28.2	7.6	7.6	20.8	20.8	71.0 71.1	71.1	4.9 4.9	5.0	7.2 7.3	6.6	4	5	90 90	89	821849	808135	<0.2 <0.2	2.1	2.2
					Bottom	5.8 5.8	0.2	14 16	28.1 28.1	28.1	7.6 7.6	7.6	21.5 21.5	21.5	73.4 73.6	73.5	5.1 5.1	5.1	9.0 8.7	ŀ	6 5	ł	91 91				<0.2	2.6	-

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

#### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring

27 August 19 during Mid-Flood Tide

Number   N	Water Qua	lity Monit	toring Resi	ults on		27 August 19	during Mid-	Flood Ti	ide																						
Column   C		Weather	Sea	Sampling	Water	Sampling Dent	h (m)			Water Ter	mperature (°C)	1	Н	Salin	ity (ppt)					Turbidity(I	NTU)					Coordinate				Nickel (ı	ıg/L)
March   Marc	Station	Condition	Condition	Time	Depth (m)	Oampling Dept	()		Direction	Value	Average	Value	Average	Value	Average	Value	Average	Value	DA	Value	DA	Value	DA	Value	DA			Value	DA	Value	DA
Mart   County   Mart						Surface					28.6		7.7		18.5		75.6		-											2.2	
No.   No.	IM9	Cloudy	Moderate	16:37	6.4	Middle					28.4		7.7		19.6		71.8		5.2		4.8		6		88	822097	808807		<0.2	2.1	2.2
Mode Couly Moderate No.44 6.1 6.1 6.1 6.2 6.2 6.3 6.2 6.2 6.2 6.2 6.2 6.2 6.2 6.2 6.2 6.2						Bottom	5.4	0.2	328	28.2	28.2	7.7	7.7	21.0	21.0	71.6	71.7	5.0	5.0	6.4	Ī	7		90	İ			<0.2		2.2	
Mino   County   Moderate   16.4   6.1     Moderate   16.4     6.1     Moderate   16.4     6.1     Moderate   16.4     6.1     Moderate   16.4     6.1     Moderate   16.4     6.1     Moderate   16.4   Moderate   16.4						Surface	1.0	0.9	328	28.2	28.2	7.7	7.7	20.1	20.2	71.2	71.2	5.0		4.8		6		85				<0.2		1.9	
Male	IM10	Cloudy	Moderate	16:44	6.1		3.1	0.6	306	27.9		7.7		22.1		70.8		4.9	5.0	6.5	6.0	5	5	89	88	822370	809772	<0.2	<0.2	2.0	2.0
Mill   Clausy   Moderate   18.56   7.5   Moderate   18.56   Moder		Cicacy	Wodorato	10.11	0.1																-				- 55	022070	000772		L	2.0	2.0
Math   Couly   Modern   165   75   Makk   165   Makk   165																			5.5												_
Mile   Coop   Rosen   Rose						Surface	1.0	0.9	314	28.5	28.5	7.7	7.7	19.3		74.8		5.2	5.0	3.8	ļ	4		85				<0.2		2.2	
Mills	IM11	Cloudy	Moderate	16:55	7.5	Middle	3.8	0.7	299	27.8	27.8	7.7	7.7	22.9	22.9	67.7	67.7	4.7		7.3	9.5	3	4	89	88	822039	811459	<0.2	<0.2	2.2	2.2
M12   Obel   Modeles   1703   0.2   Sattoo   15   0.2   200   20						Bottom					27.8		7.7		23.2		74.0		5.1												
Mile   Courty   Moderate   17:00   Reg   Moderate   17:00   Reg   Moderate   17:00   Reg   Moderate   17:00   Reg   Moderate   17:00   Reg   Moderate   17:00   Reg   Moderate   17:00   Reg   Reg   Moderate   17:00   Reg						Surface					29.0		7.8		17.5		78.1		-												
Room   72   31   250   276	IM12	Cloudy	Moderate	17:03	8.2	Middle	4.1	0.4	289	27.7	27.7	7.7	7.7	23.6	23.6	65.8	65.9	4.5	5.0	7.7	6.6	5	- 5	88	88	821457	812035	<0.2	<0.2	1.9	2.0
SRIA Cloudy Calm 17.28 4.9 Modelens 17.28 4.9 Modelens 17.28 4.9 Modelens 17.28 4.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1						Bottom	7.2	0.1	255	27.6	27.6	7.7	7.7	25.2		75.5	75.9	5.2	5.2	8.7	Į	6		89				<0.2	Г	1.9	
SRIA Cloudy Calm 17:25 4.9 Mode						Surface	1.0	-	-	29.2	29.2	7.8	7.8	16.9	16.9	78.7	78.1	5.5		3.0		5		-				_			$\dashv$
Bedom   39   .   .   .   .   .   .   .   .   .	SP1A	Cloudy	Calm	17:25	4.0		2.5					7.8		16.9		77.4		5.4	5.5	3.2	41	-	. ,			810081	812655	-		-	
Surface   10   10   10   10   10   10   10   1	OKIA	Cioday	Caim	17.25	4.5							-		23.0		66.7		4.6		-			. "		-	013301	012033				
SR2   Cloudy   Moderate   17.55   4.7   Modeled   17.55   4.7   Modeled   17.55   4.7   Modeled   17.55   Modeled   17								-	-			7.7		23.0				4.6	4.6					- 85						- 19	4
Secondary   Mode   Mo						Surface					28.3	7.7	7.7		19.5		74.8		5.2	3.7	ļ	5		86					ļ		
SR3 Cloudy Rough 16.21 7.6 Middle 38 0.7 27 22 29 8.0 8.0 77 77 17 231 231 72 5 5 80 80 4.5 5 80 80 4.5 5 80 80 4.5 5 80 80 80 80 80 80 80 80 80 80 80 80 80	SR2	Cloudy	Moderate	17:35	4.7	Middle	-	-	-	-	-	-	-	-	-	-	-	-		-	4.1	-	- 5	÷	87	821464	814174	-	<0.2	-	1.8
SRA Cloudy Rough 16.21 7.6   Middle 3.8   0.7   221   279   279   76   78   275   27						Bottom			276 279		28.0	7.7	7.7	23.2	23.1	84.8 85.6	85.2	5.8	5.9	4.5	-	5		89 89				<0.2	-	1.8	
SR3 Cloudy Rough 16.21 7.6 Middle 3.8 0.7 21 27.9 27.9 7.8 7.6 7.6 22.5 25. 67.0 0.1 4.7 4.7 4.7 4.7 4.7 4.7 4.7 4.7 4.7 4.7						Surface					28.8		7.7		17.0		75.2							-				-		-	
Bottom   6.6   0.5   2.4   27.8   27.8   7.7   7.7   23.1   23.1   23.1   72.7   72.9   5.0   5.1   5.1   5.2   5.0   5.1   5.2   5.2   5.2   5.2   5.2   5.2   5.2   5.3   5.2   5.2   5.2   5.3   5.2   5.2   5.2   5.2   5.3   5.2   5.2   5.3   5.3   5.2   5.3	SR3	Cloudy	Rough	16:21	7.6	Middle			21	27.9	27.9		7.6		22.5	67.0	67.1	4.6	5.0	6.3	6.3	5	- 5	-	-	822131	807592	-	- [	-	-
Second   S						Bottom	6.6	0.5	24	27.8	27.8	7.7	7.7	23.1	23.1	72.7	72.9	5.0	5.1	8.2	ļ	4		-				-		=	
SRAA Cloudy Rough 17.59 9.5 Middle 4.8 0.9 247 272 272 87 8.7 21.4 28.0 8.7 21.5 21.4 21.4 21.4 21.4 21.4 21.4 21.4 21.4						Surface	1.0	1.0	256	28.0	28.0	8.7	8.7	20.1	20.0	76.2	76.2	5.3		5.7		5		÷							ᅱ
Second   S	CD4A	Cloudy	Pough	17:50	0.5		4.8	0.9	247	27.2		8.7		21.5		68.0		4.8	5.1	7.4		7				917101	907901	-	-	-	
SRSA Cloudy Moderate 18:20 4.8 Surface 1.00 0.3 351 28:2 8.7 8.7 20.0 20.0 8.6 8.7 8.7 20.0 20.0 8.6 8.6 8.7 8.7 20.0 20.0 8.6 8.6 8.6 8.6 8.7 8.7 20.0 20.0 8.6 8.6 8.6 8.6 8.6 8.6 8.6 8.6 8.6 8.6	SN4A	Cioddy	Rough	17.59	9.5														0.0		0.7		. ′	-		617191	807801	-		-	.
SR5A Cloudy Moderate 18:20 4.8 Middle : : : : : : : : : : : : : : : : : : :							8.5	0.8	258	26.9		8.6		26.7		56.4		3.9	3.9	13.1		8		-				-			_
SR5A Cloudy Moderate 18:20 4.8 Middle						Surface		0.3		28.2	28.2		8.7		20.0		81.6	5.7	5.7		į	6		-				-			
SR6A Cloudy Moderate 18:49 4.6 Middle	SR5A	Cloudy	Moderate	18:20	4.8	Middle		-	•	-	-		-	-	-		-	-		-	5.8	-	7	÷	-	816579	810694	-	-	-	-
SR6A Cloudy Moderate 18:49 4.6 Middle 1						Bottom					27.5		8.6		23.3		71.2		4.9									-		$\dot{-}$	
SR6A Cloudy Moderate 18:49 4.6 Middle						Surface					27.7		8.7		20.3		81.9							-				-		-	
Bottom 3.6 0.0 221 27.5 27.5 8.7 8.7 21.8 72.9 73.1 5.1 7.7 4 4	SR6A	Cloudy	Moderate	18:49	4.6	Middle	-	-	-	-	-	-	-	-		-		-	5.8	-	6.8	-	- 5	-	-	817950	814748	-	- [	=	-
SR7 Cloudy Moderate 18:26 15.9 Middle 10.0 0.3 229 28.7 28.7 7.9 7.9 20.5 20.5 91.6 91.6 91.6 6.3 6.3 6.9 1.2 4						Bottom	3.6	0.0	221	27.5	27.5	8.7	8.7		21.8	72.9	73.1		5.1	7.7	Į	4		-				-			
SR7 Cloudy Moderate 18:26 15:9 Middle 8.0 0.2 214 28.0 28.0 7.8 7.8 7.8 22.3 78.3 5.4 5.9 2.7 4.7 4.7 3 4 823628 823763						Surface	1.0	0.3	229	28.7	28.7	7.9	7.9	20.5	20.5	91.6	91.6	6.3		1.2		4		÷				-		=	-
SR8 Cloudy Calm 17:16 5.1 Middle 8.0 0.2 203 28.0 2.0 7.8 7.8 7.8 7.8 7.8 7.8 7.8 7.8 7.8 7.8	CD7	Clouds	Moderate	10.26	15.0							7.8		22.3		78.3		5.4	5.9	2.7	4.7	4	. ,	-	1	922620	022762	-	-	-	
SR8 Cloudy Calm 17:16 5.1 Bollotti 14.9 0.1 195 26.1 26.0 7.8 7.8 7.8 17.0 17.0 78.9 78.8 5.5 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0 1.0	387	Cloudy	woderate	10:20	15.9					28.0		7.8		22.3		78.2		5.4		2.7	4./		4	-		023028	023/03	-	•	=	-
SR8 Cloudy Calm 17:16 5.1 Surface 1.0 - 29.2 29.2 7.8 7.8 17.0 17.0 78.7 78.8 5.5 5.5 3.1 6 6 - 4.7 6 7.8 20378 811616 7. 7. 7. 7. 7. 7. 7. 7. 7. 7. 7. 7. 7.							14.9	0.1		26.1		7.8		29.3		83.2		5.7	5.7	10.2		6			1					4	$\dashv$
SR8 Cloudy Calm 1/:16 5.1 Middle						Surface		-	-		29.2		7.8		17.0		78.8		5.5			6	.		1				ļ		
	SR8	Cloudy	Calm	17:16	5.1	Middle	-		-		-		-	-	-	-	-	-		-	4.7	-	6	-	-	820378	811616		- [	-	-
Bottom 4.1 · · · 27.7 27.7 7.7 23.5 23.6 23.8 4.4 4.4 6.3 7 · · · · · · · · · · · · · · · · · ·						Bottom	4.1 4.1	-		27.7 27.7	27.7	7.7	7.7	23.5 23.5	23.5	63.7 63.8	63.8	4.4	4.4	6.2 6.3		6 7		-				-		-	

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined.

## Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 29 August 19 during

29 August 19 during Mid-Ebb Tide

Water Qual	ity Monit	oring Resu	lts on		29 August 19	during Mid-	Ebb Tid	е																			
Monitoring	Weather	Sea	Sampling	Water	Sampling D	enth (m)	Current Speed	Current	Water Te	emperature (°C	)	рН	Salinity (ppt)	DO:	Saturation (%)	Dissolved Oxygen	Turbid	y(NTU)	Suspende (mg		Total All (ppr		Coordinate HK Grid	Coordinate HK Grid	Chrom (µg/l		ickel (µg/L)
Station	Condition	Condition	Time	Depth (m)		()	(m/s)	Direction	Value	Average	Value	Average	Value Average	Value	Average	Value D.	\ Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA Va	alue DA
					Surface	1.0	0.5	221 223	27.5 27.5	27.5	7.8	7.8	27.4 27.4	73.7	73.8	5.0	7.8		8 9		86 86				<0.2		0.9
C1	Rainy	Moderate	11:28	8.4	Middle	4.2	0.4	215 234	26.6 26.6	26.6	7.8	7.8	29.7 29.7	48.8 48.9	48.9	3.3 3.3	14.1	13.4	6	7	88 88	88	815611	804244	<0.2	-0.2	0.9
					Bottom	7.4	0.3	213	26.8	26.8	7.8	7.8	29.3	51.8	52.0	3.5	18.5		7		90				<0.2	0	0.9
					Surface	7.4 1.0	0.3	232 182	26.8 27.2	27.2	7.8 8.1	8.1	29.1 23.2	52.1 72.9		5.1	6.2	1	6 5		90 85				<0.2 <0.2	1	1.6
C2	Rainy	Moderate	13:42	11.3	Middle	1.0 5.7	0.5	199 135	27.2 26.5		8.1 8.1	8.1	22.8	72.7 64.5	64.5	5.1 4.5	6.5	9.5	4	6	86 87	88	825658	806938	<0.2		1.6 1.4 1.5
62	Rainy	Woderate	13.42	11.3		5.7 10.3	0.3	140 89	26.5 26.4	26.5	8.1 8.0		27.0 27.7 27.7	64.5 65.8		4.5 4.5	10.6	9.5	5 9	٥	88 90	00	023030	000930	<0.2	1	1.5
					Bottom	10.3	0.3	91 101	26.4 25.8	26.4	8.0	8.0	27.7	66.1 72.3	66.0	4.6 4.6 5.0	11.8	1	9		90				<0.2	1	1.5
					Surface	1.0	0.4	109	25.8	25.8	8.1	8.0	27.4	72.2	72.3	5.0	3.0		10		85				<0.2	1	1.2
СЗ	Cloudy	Moderate	11:12	12.6	Middle	6.3 6.3	0.3	92 95	24.7 24.6	24.7	8.1 8.1	8.1	30.9 31.1 31.0	63.4 63.2	63.3	4.4	3.8	3.6	11 10	11	88 87	88	822092	817804	<0.2	<0.2	1.1 1.1
					Bottom	11.6 11.6	0.3	34 36	24.4	24.4	8.1 8.1	8.1	31.4 31.4 31.4	63.7	63.8	4.5 4.5	4.2	-	12 11		91 90				<0.2		1.0
					Surface	1.0	0.3	180 197	27.4 27.3	27.4	7.8	7.8	27.5 27.6	74.1 74.0		5.0 5.0	3.7		5 5		85 85				<0.2		1.0 0.9
IM1	Rainy	Moderate	11:41	5.5	Middle	-	-	-	-	-	-	-		-		5.0	, =	4.2	-	5	-	87	817969	807120	_	-0.2	0.8
					Bottom	4.5 4.5	0.1	160 171	27.1	27.1	7.8	7.8	28.6 28.6 28.6	66.6	66.8	4.5 4.5	16		5		88 89				<0.2	0	0.6
					Surface	1.0	0.3	196	27.2	27.2	7.8	7.8	27.4	71.0	71.1	4.8	7.7		4		85				<0.2	1	1.0
IM2	Rainy	Moderate	11:48	7.6	Middle	1.0 3.8	0.3	201 165	27.2 26.9	26.9	7.8 7.8	7.8	29.0 29.0	71.1 66.0	66.0	4.8 4.5	6.4	8.3	5 4	4	85 89	88	818163	806174	<0.2 <0.2	-0.2	0.9 1.0
	,				Bottom	3.8 6.6	0.4	177 161	26.9 26.9	26.9	7.8 7.8	7.8	28.9	65.9 55.4	55.7	4.5 3.8 3.	6.6	-	3 4		89 90				<0.2	1	1.0
					Surface	6.6 1.0	0.3	167 215	26.9 27.3	27.3	7.8		29.5	56.0 69.9		3.8 3. 4.8	10.7		4		90 84				<0.2		1.0
						1.0 4.0	0.3	220 175	27.3 26.9		7.8 7.8	7.8	27.1	71.0 65.3	70.5	4.8 4.4	5.5	7	5 3		85 88				<0.2	0	1.0
IM3	Cloudy	Moderate	11:54	7.9	Middle	4.0	0.2	191 136	26.9 26.7	26.9	7.8	7.8	28.9	65.4 54.7	65.4	4.4	7.3	8.3	4	4	88 89	87	818769	805596	<0.2	<0.2	0.9
					Bottom	6.9	0.4	146	26.8	26.8	7.8	7.8	29.9	55.2	55.0	3.7	12.1		4		90				<0.2	0	0.9
					Surface	1.0	0.8	195 195	27.2 27.2	27.2	7.8	7.8	26.5 26.5	73.8 75.0	74.4	5.1 5.1 4.	4.5		6 7		85 86				<0.2	1	0.9 1.0
IM4	Cloudy	Moderate	12:02	8.4	Middle	4.2	0.6	177 189	26.9 26.9	26.9	7.8	7.8	28.4 28.4	64.5 64.4	64.5	4.4	6.2	7.0	7 6	6	88 89	88	819706	804623	<0.2 <0.2	<0.2	0.9
					Bottom	7.4	0.4	166 168	26.4 26.5	26.5	7.8	7.8	30.4 30.3	51.4 51.8	51.6	3.5 3.5	10.3	+	6		90				<0.2		0.9
					Surface	1.0	0.7	225 229	27.7 27.7	27.7	7.8 7.8	7.8	25.4 25.4 25.4	73.1 73.3	73.2	5.0	4.2		5 6		84 84				<0.2		0.8
IM5	Cloudy	Moderate	12:12	7.8	Middle	3.9	0.6	208 226	26.8 27.0	26.9	7.8	7.8	28.8 29.3	62.5 62.4	62.5	4.2 4.2	7.2	7.6	5	6	88 88	87	820755	804880	×0.2	-02 0	0.8
					Bottom	6.8	0.4	204 223	27.1	27.3	7.8	7.8	29.6 29.4 29.5	62.0	62.1	4.2 4.	11.6	1	5		89 90				<0.2	0	0.9
					Surface	1.0	0.6	223 223 236	27.8 27.8	27.8	7.8	7.8	25.1 25.0 25.1	68.6		4.7	4.2	1	5 4		84 85				<0.2	1	1.0
IM6	Cloudy	Moderate	12:21	8.0	Middle	4.0	0.5	190	27.3	27.4	7.8	7.8	29.1	66.2	66.1	4.5	13.1	11.3	5	5	88	88	821065	805844	<0.2	-0.2 0	0.8
	,				Bottom	4.0 7.0	0.5 0.4	207 206	27.4 26.5	26.5	7.8 7.8	7.8	29.1	66.0 51.9	52.3	4.5 3.5 3.	13.1	1	4 5		89 90				<0.2 <0.2	0	0.9
					Surface	7.0 1.0	0.4	210 242	26.5 28.0	28.0	7.8	7.8	29.9 23.1	52.6 75.9	76.0	3.6 5.2	16.6 3.9		6 4		90 85				<0.2		0.8
13.47	Observation	Madaga	40.00	7.0		1.0 4.0	0.4	254 198	27.9 27.5		7.8 7.8		23.0	76.0 61.8		5.3 4.2	7 3.8 5.5	-	3 4		85 89		004005	00004:	<0.2	0	0.8
IM7	Cloudy	Moderate	12:26	7.9	Middle	4.0	0.3	202 199	27.5 26.6	27.5	7.8	7.8	27.2	62.6 52.7	62.2	4.2	5.6	6.6	4 5	4	89 90	88	821362	806844	<0.2	<0.2	0.8
					Bottom	6.9	0.3	210	26.6 27.2	26.6	7.8	7.8	29.4	53.1 73.3	52.9	3.6 3. 5.1	10.5	1	6		90				<0.2	0	0.8
					Surface	1.0	0.3	195	27.2	27.2	8.0	8.0	24.1	73.1	73.2	5.1	4.1	1	2		84				<0.2	1	1.3
IM8	Rainy	Moderate	13:19	7.5	Middle	3.8	0.1	167 170	26.7 26.7	26.7	8.0	8.0	25.6 25.7 25.6	63.9 63.8	63.9	4.4	5.4 5.5	5.3	4	4	88 88	88	821820	808148	<0.2	<0.2	1.4
					Bottom	6.5 6.5	0.1	357 328	26.6 26.5	26.6	8.0	8.0	26.3 26.4 26.3	64.4 64.6	64.5	4.5 4.5	6.2	<u> </u>	5 4		90 90				<0.2		1.1
DΔ · Denth-Aver																											

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

#### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring

during Mid-Ebb Tide Water Quality Monitoring Results on 29 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value Value DA (Northing) (Easting) Value DA Value Value Average 0.3 1.0 0.3 134 27.1 8.0 24.1 71.9 5.0 4.2 <2 86 <0.2 1.5 4.9 3.5 0.4 130 142 26.7 8.0 69.4 69.3 4.8 5.7 5.7 4 88 89 <0.2 1.4 IM9 Moderate 13:07 6.9 Middle 5.9 88 822073 808809 <0.2 26.7 8.0 0.4 5.9 0.2 88 26.4 90 < 0.2 1.4 7.9 26.7 64.5 4.5 7.9 Bottom 26.4 7.9 26.7 64.5 4.5 4.5 7.9 26.7 64.5 0.2 79 90 13 5.9 94 26.4 <0.2 0.8 123 27.1 4.1 1.2 8.0 73.1 Surface 27.1 8.0 23.8 73.0 8.0 23.9 72.9 5.1 86 1.1 1.0 0.9 125 27.1 4.3 4 < 0.2 26.6 26.6 6.5 1.2 0.7 106 111 8.0 63.9 63.8 88 87 <0.2 3.6 4.4 9 10 IM10 Rainv Moderate 12:59 7.2 Middle 26.6 8.0 25.3 63.9 82 88 822377 809804 <0.2 4.4 6.2 0.5 108 26.3 8.0 58.1 4.0 13.6 11 90 <0.2 1.2 27.0 58.1 4.0 Bottom 26.3 8.0 27.0 6.2 0.6 113 26.3 8.0 58.1 4.0 13.6 12 90 < 0.2 1.0 0.7 106 27.3 85 1.5 1.0 7.9 78.1 5.4 4.8 23.1 <0.2 Surface 27.4 7.9 23.1 78.1 1.0 106 27.4 7.9 78.1 5.4 5.0 6 86 <0.2 1.5 5.0 1.4 4.0 0.5 112 8.0 67.1 4.6 8.8 88 <0.2 26.1 27.3 IM11 67.1 822035 811464 Rainv Moderate 12:45 7.9 Middle 26.1 8.0 27.3 88 <0.2 4.0 0.5 8.8 87 1.3 116 <0.2 26.1 6.9 113 26.1 7.9 57.1 57.5 15.2 14 90 <0.2 1.3 Rottom 26.1 7.9 27.9 57.3 4 0 4.0 6.9 0.4 115 26.1 7.9 15.2 14 90 1.3 27.1 7.9 78.8 78.8 86 <0.2 1.5 23.4 Surface 27.1 7.9 23.4 78.8 1.0 0.7 122 27.1 7.9 23.4 5.5 5.7 6 86 <0.2 1.4 4.2 0.5 106 26.6 8.0 68.9 7.9 9 89 <0.2 1.4 12:35 Middle 68.9 821466 812024 IM12 Rainy Moderate 26.6 8.0 25.8 0.6 26.6 8.0 68.9 4.8 7.9 88 1.2 4.2 7.4 4.1 0.3 97 25.7 8.0 59.4 7.8 90 <0.2 1.4 Bottom 25.7 8.0 27.7 59.6 4.2 27.7 59.7 7.4 0.3 102 25.7 8.0 4.2 7.8 9 90 < 0.2 1.5 1.0 26.1 7.9 25.8 64.8 4.5 6.0 Surface 26.1 7.9 25.8 64.7 1.0 26.0 7.9 25.9 64.6 4.5 6.2 7 2.7 Cloudy Moderate 12:01 Middle 819983 812664 2.7 4.3 25.4 7.9 60.1 4.2 8.4 4.2 Bottom 25.4 7.9 28.8 60.3 4.3 25.4 7.9 28.8 60.4 4.2 8.4 6 1.0 0.4 82 26.5 7.9 25.2 65.7 5.2 13 86 <0.2 1.2 Surface 26.5 7.9 25.1 65.7 1.0 0.4 90 26.5 7.9 25.1 65.6 4.6 5.4 15 87 <0.2 1.2 SR2 Cloudy Moderate 11:38 4.9 Middle 821446 814166 <0.2 1.2 29.0 53.8 53.9 3.8 15 15 Bottom 29.0 53.9 3.9 0.3 72 25.3 7.9 10.0 90 <0.2 1.2 1.0 0.4 197 26.9 8.0 24.8 72.7 5.1 5.0 8.0 24.9 72.6 1.0 0.4 205 26.9 8.0 24 9 72.5 5.0 5.1 8 4.0 0.1 223 26.6 8.0 25.5 63.2 4.4 6.5 7 SR3 Rainy Moderate 13:25 8.0 63.2 822138 807573 25.5 4.0 0.1 245 26.6 8.0 25.6 63.1 4.4 6.7 7 0.3 26.4 26.4 8.0 62.3 62.7 4.3 8.4 8.6 7.0 11 Bottom 62.5 4.3 1.0 0.1 269 27.9 7.8 25.7 75.0 5.1 3.8 Surface 27.9 7.8 25.7 75.0 74.9 1.0 0.1 272 27.9 7.8 25.8 5.1 3.8 8 -4.3 0.0 27.5 4.1 9.4 7.8 28.5 60.7 7.8 807787 SR4A Rainy Calm 11:04 8.5 Middle 27.5 28.5 60.8 817178 4.3 0.0 15 27.5 7.8 28.5 60.9 4.1 9.4 0.0 100 27.0 7.8 14.9 29.1 55.9 56.7 3.8 Rottom 7.8 29.0 56.3 3.8 7.5 0.0 109 27.1 7.8 29.0 3.8 15.0 28.1 1.0 0.0 345 7.8 5.4 5.3 23.9 78.5 Surface 28.1 7.8 23.9 78.5 1.0 0.0 317 28.0 7.8 23.9 78.4 5.4 5.6 10 SR5A 10:48 Middle 816593 810706 Cloudy Calm 5.5 4.5 0.2 119 27.5 4.6 8.4 7.8 68.0 27.1 Bottom 27.6 7.8 27.1 70.3 4.8 4.5 0.2 127 27.6 7.8 3.4 Surface 28.9 7.8 22.8 82.4 164 28.9 3.6 5.6 SR6A Cloudy 10:23 5.2 Middle 817955 814742 Calm 4.2 0.0 184 28.0 64.2 65.1 4.3 64.7 Bottom 7.8 194 28.1 1.0 0.7 72 25.0 8.0 30.1 74.6 5.2 3.2 11 Surface 8.0 74.6 1.0 0.8 78 25.0 8.0 30.1 74.6 5.2 3.3 11 8 1 0.5 62 24.6 8.1 31.2 70.1 4.9 4.8 8 SR7 Cloudy Moderate 10:37 Middle 823630 823731 8.1 0.5 67 24.6 8.0 31.2 70.1 49 4.8 7 15.2 0.2 44 24.5 8.0 61.0 4.3 5.2 Bottom 8.0 15.2 0.2 47 24.5 8.0 61.1 4.3 5.3 27.4 27.4 4.5 4.5 1.0 7.9 23.4 4.9 Surface 79 69.9 49 4.9 --SR8 Cloudy Moderate 12:25 5.1 Middle 820396 811633 26.9 67.0 4.7 12 4.1 7.9 24.6 7.1

26.9

26.9

7.9

24.6

67.1

4.7

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Bottom

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 29 August 19 during

29 August 19 during Mid-Flood Tide

Water Qua	lity Monite	oring Resu	lts on		29 August 19	during Mid-	Flood Ti	de																			
Monitoring	Weather	Sea	Sampling	Water	Sampling D	enth (m)	Current Speed	Current	Water Te	emperature (°C)		pН	Salir	nity (ppt)		aturation (%)	Disso Oxy		Turbidity(	NTU)	Suspende (mg	d Solids /L)	Total Alkalinity (ppm)	Coordinate HK Grid	Coordinate HK Grid	Chrom (µg/	
Station	Condition	Condition	Time	Depth (m)	Sampling B		(m/s)	Direction	Value	Average	Value	Average	Value	Average		Average	Value	DA	Value	DA	Value	DA	Value DA	(Northing)	(Easting)		DA Value DA
					Surface	1.0	0.4	50 49	27.4 27.4	27.4	7.9	7.9	27.3	27.3	67.1 66.7	66.9	4.6 4.5		5.4 5.3		5 4	t	86 86			<0.2	0.9
C1	Cloudy	Moderate	18:25	9.8	Middle	4.9 4.9	0.2	64 62	26.6 26.6	26.6	7.8 7.8	7.8	29.9 29.9	29.9	52.7 53.0	52.9	3.6	4.1	10.9 10.9	10.2	4	5	88 89	815610	804264	<0.2	<0.2 0.8 0.8
					Bottom	8.8	0.2	56	26.9	27.0	7.8	7.8	29.8	29.8	56.7	57.0	3.8	3.9	14.2		6	Í	90			<0.2	0.9
						1.0	0.2	59 13	27.0 27.5		7.8	1	29.8		57.3 71.2		3.9 5.0		14.3 3.9		5 4		90			<0.2	0.9 1.5
					Surface	1.0 5.7	0.6 0.4	12 14	27.5 26.5	27.5	8.0 8.1	8.0	22.8 26.8	22.7	71.0 61.7	71.1	4.9 4.3	4.6	4.0 10.7		5 9	ł	86			<0.2 <0.2	1.4
C2	Rainy	Moderate	17:28	11.4	Middle	5.7	0.5	15	26.5	26.5	8.1	8.1	26.9	26.9	61.8	61.8	4.3		10.9	9.2	9	9	89 88	825695	806960	<0.2	1.5
					Bottom	10.4 10.4	0.3	45 50	26.6 26.7	26.7	8.0	8.0	27.2 27.2	27.2	62.5 62.7	62.6	4.3	4.3	13.0 13.0		13 13	L	90			<0.2	1.5 1.4
					Surface	1.0	0.1	200 221	26.1 26.1	26.1	8.1	8.1	27.1	27.2	66.4 66.3	66.4	4.6 4.6		8.1 8.1		5 5	1	87 87			<0.2	1.1
С3	Cloudy	Moderate	19:40	12.7	Middle	6.4	0.5	250 260	25.9 25.8	25.9	8.1 8.1	8.1	27.6 27.8	27.7	65.5 65.4	65.5	4.6 4.6	4.6	7.8 7.8	7.9	6 7	6	89 88	822088	817785	<0.2	<0.2 1.1 1.2
					Bottom	11.7	0.2	267	25.3	25.3	8.1	8.1	29.1	29.1	59.3	59.5	4.1	4.2	7.9		7	į	90			<0.2	1.2
					Surface	11.7	0.2	279 222	25.3 27.2	27.2	8.1 7.8	7.8	29.0 27.8	27.8	59.6 68.8	69.1	4.2 4.7		7.6 4.9		8 7		90 84			<0.2 <0.2	0.9
IM1						1.0	0.2	242	27.2		7.8	7.0	27.8	27.0	69.3	03.1	4.7	4.7	5.1	11 9	7	7	85 - 87	817969		<0.2	0.9
IIVIT	Cloudy	Moderate	18:04	5.4	Middle	4.4	0.2	- 161	26.7	-	7.8		29.2	-	55.7	-	3.8		18.8	11.9	7	+ ′	- 89	817969	807117	<0.2	<0.2 - 0.9
					Bottom	4.4	0.2	167	26.8	26.8	7.8	7.8	29.2	29.2	55.9	55.8	3.8	3.8	18.8		6	<u>i</u>	89			<0.2	0.9
					Surface	1.0	0.4	45 47	27.4 27.4	27.4	7.9	7.9	27.0 27.0	27.0	74.7 74.6	74.7	5.1 5.1	4.9	3.2		7 6	1	85 85			<0.2 <0.2	1.1
IM2	Cloudy	Moderate	17:58	7.8	Middle	3.9	0.3	38 43	27.3 27.3	27.3	7.8	7.8	27.8	27.8	66.2 70.8	68.5	4.5 4.8		4.1 4.1	6.6	8 10	8	88 89	818168	806170	<0.2	<0.2 1.1 1.1
					Bottom	6.8 6.8	0.2	42 45	27.1 27.2	27.2	7.8		29.4 29.3	29.4	57.8 58.7	58.3	3.9 4.0	4.0	12.3 12.5		10 9	t	89 90			<0.2	1.0
					Surface	1.0	0.2	63 63	27.7	27.7	7.8	7.8	25.7 25.7	25.7	74.4	74.4	5.1		4.6 4.9		8	į	86 86			<0.2	1.1
IM3	Cloudy	Moderate	17:52	8.1	Middle	4.1	0.3	50	27.4	27.4	7.8	7.8	29.1	29.0	59.1	60.2	4.0	4.6	10.9	9.0	8	8	88 00	818766	805605	<0.2	<0.2 1.2 1.2
	,				Bottom	4.1 7.1	0.3	56 48	27.4 26.6	26.6	7.8 7.8	7.0	29.0 29.7	29.7	61.3 54.3	54.5	4.1 3.7	3.7	10.9 11.2		9	1	89 89			<0.2 <0.2	1.1
						7.1 1.0	0.3	46 78	26.6 27.0		7.8		29.7		54.6 69.3		3.7 4.8	5.7	11.3 5.9		5 4		90 85	1		<0.2 <0.2	0.9
					Surface	1.0 4.3	0.4	88 73	27.0 27.0	27.0	7.8 7.8	7.8	28.1 28.8	28.1	69.2 66.1	69.3	4.8 4.5	4.7	5.9 6.2		5 6	t	86			<0.2 <0.2	0.8
IM4	Cloudy	Moderate	17:44	8.6	Middle	4.3	0.4	75	27.0	27.0	7.8	7.8	28.8	28.8	66.2	66.2	4.5		6.1	8.7	7	6	88	819745	804627	< 0.2	0.9
					Bottom	7.6 7.6	0.3	52 56	26.4 26.4	26.4	7.8	7.8	30.5 30.5	30.5	51.4 51.7	51.6	3.5	3.5	14.0 14.1		7 6		89 90			<0.2 <0.2	0.9
					Surface	1.0	0.6	58 59	27.7 27.7	27.7	7.8	7.8	25.2 25.2	25.2	72.0 72.5	72.3	4.9 5.0	4.7	5.0 5.1		5 6	ı	85 85			<0.2	0.8
IM5	Cloudy	Moderate	17:39	7.8	Middle	3.9 3.9	0.4	54 59	27.2 27.3	27.3	7.8 7.8	7.8	29.3 29.1	29.2	63.3 63.2	63.3	4.4	4.7	11.8 11.7	10.8	5 4	5	87 87	820725	804890	<0.2	<0.2 0.9 0.9
					Bottom	6.8	0.5	45 43	26.4 26.4	26.4	7.8	7.8	30.3	30.2	54.3 55.1	54.7	3.7	3.7	15.5 15.5		4 5	İ	89 89			<0.2	0.7
					Surface	1.0	0.3	49	27.7	27.7	7.8	7.8	25.1	25.1	67.5	67.6	4.6		4.1		5		85			<0.2	1.3
IM6	Cloudy	Moderate	17:34	7.7	Middle	1.0 3.9	0.3	52 46	27.6 27.6	27.7	7.8 7.8	7.8	25.0 26.8	26.7	67.7 66.9	67.3	4.6 4.5	4.6	4.2 4.4	7.9	6	6	85 89 89	821050	805816	<0.2	<0.2 1.3 1.3
livio	Cloudy	Woderate	17.34	7.7		3.9 6.7	0.4	42 0	27.7 26.5		7.8 7.8		26.6 29.9		67.6 54.6		4.6 3.7		4.4 15.1	7.9	5 6	"	90 89	621050	005616	<0.2	1.2
					Bottom	6.7	0.2	0	26.5	26.5	7.8	7.8	29.9	29.9	55.1	54.9	3.7	3.7	15.1		7	<u> </u>	91			<0.2	1.4
					Surface	1.0	0.3	37 41	27.9 27.8	27.9	7.8	7.8	23.2	23.2	72.3 71.9	72.1	5.0	4.8	4.7		3	ĺ	85 86			<0.2	1.2
IM7	Cloudy	Moderate	17:27	8.2	Middle	4.1 4.1	0.3	45 47	27.7 27.9	27.8	7.8 7.8	7.8	27.0 26.8	26.9	66.9 68.5	67.7	4.5 4.6		5.5 5.6	9.3	3 4	4	89 89	821340	806853	<0.2	<0.2 1.3 1.3
					Bottom	7.2 7.2	0.2	35 31	26.6 26.7	26.7	7.8 7.8	7.8	29.5 29.5	29.5	55.5 55.8	55.7	3.8	3.8	17.5 17.7		4 5	ŀ	90			<0.2	1.3
					Surface	1.0	0.2	24 27	27.4	27.4	8.2	8.2	23.9	24.0	83.5 83.3	83.4	5.8 5.8		2.3		4	+	86			<0.2	1.4
IM8	Rainy	Moderate	17:56	7.2	Middle	3.6	0.1	24	27.0	27.0	8.2	8.2	24.8	24.8	72.7	72.7	5.0	5.4	3.7	4.5	4	4	85 87 88	821830	808142	<0.2	.0.2 1.5 4.5
					Bottom	3.6 6.2	0.1	25 37	27.0 26.6	26.6	8.2 8.1	0.1	24.8	28.1	72.6 65.2		5.0 4.5	4.5	3.7 7.7		3 6		90			<0.2	1.6
DA: Depth-Ave	raged				Dottom	6.2	0.2	40	26.6	∠0.0	8.1	6.1	28.1	∠6.1	66.0	65.6	4.5	4.5	7.5		4		90			<0.2	1.6

DA: Depth-Averaged
Cahr: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher
Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring

during Mid-Flood Tide Water Quality Monitoring Results on 29 August 19 Suspended Solids Nickel (µg/L) Salinity (ppt) Turbidity(NTU) Water Water Temperature (°C) рΗ Coordinate Sampling Coordinate Monitoring Current (ppm) Sampling Depth (m) HK Grid HK Grid Station Direction Value DA Condition Condition Time Depth (m) (m/s) Value Average Value Average Value Value DA Value DA Value DA Value DA (Northing) (Easting) Value DA Value Average 0.3 80.6 5.6 1.0 0.3 344 27.1 8.2 24.6 3.6 86 <0.2 1.6 3.8 0.4 304 323 26.7 8.1 8.1 66.6 66.6 4.6 4.6 6.0 88 87 <0.2 1.6 IM9 Moderate 18:05 7.5 Middle 5.2 88 822108 808833 <0.2 3.8 26.7 6.0 0.4 6.5 0.3 352 26.7 90 <0.2 1.6 8.1 26.0 66.7 4.6 6.2 8 Bottom 26.7 8.1 26.0 66.8 4.6 8.1 66.9 4.6 1.5 6.5 0.3 26.0 6.2 90 354 26.7 <0.2 0.6 312 27.1 4.9 1.5 8.1 76.7 5.3 Surface 27.1 8.1 24.6 76.4 8.1 24.6 76.1 5.3 86 1.4 1.0 0.7 308 27.0 5.1 < 0.2 26.7 26.7 1.5 3.5 0.7 300 8.1 8.1 26.1 26.1 66.5 66.8 8.3 8.5 88 87 <0.2 4.6 IM10 Rainv Moderate 18:13 7.0 Middle 26.7 8.1 26.1 66.7 88 822376 809805 <0.2 0.7 4.6 293 6.0 0.4 287 26.6 8.1 68.1 4.7 9.0 3 90 <0.2 1.6 26.2 8.0 26.2 68.3 4.7 Bottom 26.6 6.0 0.5 289 26.6 8.0 26.2 68.5 4.7 9.0 90 < 0.2 1.6 1.0 288 75.0 7.7 86 1.5 26.9 8.2 5.2 4 24.9 74.5 <0.2 Surface 26.9 8.2 25.0 1.0 26.9 8.2 74.0 5.1 7.9 87 <0.2 1.5 292 1.5 3.9 0.7 273 26.8 8.2 25.3 25.3 4.8 9.7 88 <0.2 69.5 IM11 69.4 822074 811475 Rainv Moderate 18:23 7.7 Middle 26.8 8.2 25.3 88 <0.2 0.7 4.8 87 3.9 9.0 <0.2 278 26.8 26.7 8.1 25.8 68.5 4.8 13.1 22 90 <0.2 1.5 4.8 Rottom 26.7 8.1 25.8 68.6 6.7 0.5 280 26.7 8.1 25.8 68.6 4.8 13.3 19 90 1.5 27.1 8.2 24.2 79.6 79.4 86 <0.2 1.4 Surface 27.1 8.2 24.2 79.5 1.0 0.7 27.1 8.2 5.5 4.7 3 85 <0.2 1.4 4.3 0.5 261 26.8 71.3 7.4 4 87 <0.2 1.4 18:29 Middle 821462 IM12 Rainy Moderate 26.8 8.1 25.1 71.4 4.3 0.6 26.8 8.1 71.4 7.3 5 14 89 1.5 7.5 0.2 283 26.8 8.0 72.9 11.4 90 <0.2 1.6 Bottom 26.8 8.0 25.4 73.1 5.1 5.1 7.5 0.3 266 26.8 8.0 25.4 73.3 11.1 13 90 < 0.2 1.5 1.0 27.2 8.1 24.5 76.8 5.3 3.9 Surface 27.2 8.1 24.5 76.9 1.0 27.2 8.1 24.5 76.9 5.3 3.9 <2 2.9 SR1A Cloudy Moderate 19:00 5.7 Middle 819976 812653 2.9 26.4 26.4 74.0 74.5 8.1 8.8 11 10 4.7 26.3 26.3 5.2 Bottom 8.0 26.3 74.3 5.2 8.0 1.0 0.3 260 26.8 8 1 25.4 71.3 5.0 10.4 86 <0.2 13 Surface 26.8 8.1 25.4 71.5 1.0 0.3 1.3 263 8.1 71.6 5.0 6 86 26.8 25.4 10.6 < 0.2 SR2 Cloudy Moderate 19:18 4.3 Middle 87 821455 814168 3.3 0.1 273 275 8.0 25.5 25.5 73.3 73.7 5.1 5.1 11.2 11.3 88 <0.2 1.3 Bottom 26.7 8.0 25.5 73.5 5.1 0.1 8.0 1.4 26.7 89 < 0.2 0.4 1.0 27.3 8.1 18 24.3 74.5 5.2 3.8 4 Surface 27.3 8.1 24.3 74.4 1.0 0.4 8.1 74.3 5.2 19 27.3 24.3 3.9 4.3 26.5 4.6 8.0 4 8.2 25.4 65.8 SR3 17:48 Middle 26.5 65.7 822159 807549 Rainy Moderate 8.5 8.2 25.4 4.3 0.1 20 26.4 8.2 25.4 65.6 4.6 8.4 4 . 7.5 0.3 26.3 8.2 28.9 28.9 60.6 4.2 4.2 9.7 6 60.8 42 Rottom 26.3 8.2 28.9 26.3 1.0 0.2 289 27.4 7.9 4.6 5.0 <2 27.0 67.8 Surface 27 4 7.9 26.9 67.9 1.0 297 27.4 5.1 <2 0.2 5.2 0.3 26.9 4.5 10.1 <2 263 7.8 28.6 65.4 SR4A Cloudy Calm 18:50 10.3 Middle 26.9 7.8 28.6 65.3 817169 807826 5.2 0.3 267 26.9 7.8 4.5 10.0 <2 9.3 0.2 26.9 7.8 28.7 59.4 4.0 14.8 Bottom 26.9 7.8 28.7 59.8 4.1 9.3 26.9 0.2 273 14.8 1.0 0.2 226 28.4 7.8 6.2 22.9 72.6 5.0 Surface 28.4 7.8 72.7 22.9 1.0 0.2 230 28.4 7.8 72.7 5.0 6.1 4 Cloudy Calm 19:07 Middle 810678 4.7 0.1 262 27.7 7.9 69.9 4.8 9.9 4 Bottom 7.9 4.8 4.7 0.2 255 326 27.7 7 0 18 0.8 1.0 0.2 28.0 7.8 21.9 76.6 5.3 3.8 3.7 1.0 0.2 339 27.9 7.8 21 9 76.3 5.3 4 5.3 -SR6A Calm 19:40 5.5 Middle 817972 814718 Cloudy 4.5 0.1 263 27.0 7.8 7.8 26.0 59.2 59.3 4.1 4.1 8.2 3 -59.3 Bottom 4.5 0.1 279 27.0 26.0 8.3 1.0 0.0 203 26.8 8.1 8.1 25.4 25.4 83.2 83.2 5.7 5.7 3.7 2 <2 Surface 26.8 8.1 25.4 83.2 1.0 0.0 211 26.8 8.1 0.1 8.1 76.9 5.3 7.5 241 26.0 27.1 4 -76.9 8.1 27.2 823632 823738 SR7 Cloudy Moderate 20:07 16.2 Middle 26.0 76.9 8.1 27.2 5.3 4 8.1 0.1 241 26.0 7.8 -15.2 0.1 223 26.1 8.1 4.7 7.6 4 -27.1 67.9 Bottom 26.1 8.1 27.1 68.0 4.7 8.1 68.0 7.4 15.2 0.1 201 26.1 5.0 1.0 27.2 27.2 8.1 24.4 24.4 72.6 72.6 5.8 5.8 <2 2 Surface 27.2 8.1 24 4 72.6 8.1 5.0 -SR8 Cloudy 18:36 5.5 Middle 820403 811614 Moderate 5.0 5.0 24.6 72.0 6.1 27.1 8.0 24.6 72.3 5.0 Bottom

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined

# Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 31 August 19 during

during Mid-Ebb Tide

Water Quar	iity woilit	orning iteau	113 011		31 August 19	during wid-Ebb i	ue																					
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	Currer Speed	Current	Water To	emperature (°C)		рН	Salin	ity (ppt)	DO Saturati (%)		ssolved Oxygen	Turbidity	(NTU)	Suspende (mg			dkalinity om)	Coordinate HK Grid	Coordinate HK Grid	Chrom (µg/		Nickel (	ıg/L)
Station	Condition	Condition	Time	Depth (m)	Sampling Dep	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value Avera	age Valu	ie DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA V	Value	DA
					Surface	1.0 0.3 1.0 0.3	217 231	27.9 27.9	27.9	7.9	7.9	23.9	23.9	74.5 74.5	5 5.1	_	3.5 3.5		4 5		87 88				<0.2		1.2	
C1	Cloudy	Moderate	13:25	8.2	Middle	4.1 0.2 4.1 0.2	205 218	27.4	27.4	7.9	7.9	26.6 26.6	26.6	68.1 68.2	4.0	4.9	15.6 15.5	13.1	6	8	89 90	89	815608	804248	<0.2	-02	1.1	1.2
					Bottom	7.2 0.1 7.2 0.1	206 210	27.5	27.5	7.9	7.9	26.2 26.2	26.2	71.1 71.	4.0	10	20.2		13		91 91	1			<0.2		1.1	
					Surface	1.0 0.4 1.0 0.4	161 174	27.3 27.3	27.3	8.0	8.0	22.9	22.9	68.6 68.5	4.6	1	7.1 7.2		9 8		82 82				<0.2		1.7	
C2	Cloudy	Moderate	15:04	10.9	Middle	5.5 0.4	174	26.9	26.9	8.0	8.0	23.8	23.8	65.1	1 4.6	4.7	9.6	10.5	9	9	87	87	825673	806943	<0.2	-02	0.8	1.3
					Bottom	5.5 0.5 9.9 0.4	186 125	26.9 26.4	26.4	8.1	8.1	23.8	25.9	65.1 62.9 63.	0 4.4	11	9.3		9		91				<0.2		1.3	
					Surface	9.9 0.4 1.0 0.7	135 62	26.4 26.8	26.8	8.1	8.2	25.8 25.1	25.1	70.4 70.4 70.4	4 4.9	)	14.9 6.3		8		91 83				<0.2		1.4	-
СЗ	Cloudy	Moderate	12:35	12.2	Middle	1.0 0.8 6.1 0.5	63 56	26.8 26.5	26.5	8.2 8.3	8.3	25.1 25.7	25.7	70.4 68.1	4.9	4.8	6.3 7.7	8.6	7 6	8	83 87	87	822124	817784	<0.2	-0.2	1.4	1.5
	,				Bottom	6.1 0.6 11.2 0.6	58 23	26.5 26.2	26.2	8.3 8.3	8.3	25.7 26.6	26.6	68.1 67.4	4.7 e 4.7	4.7	8.0 11.3		9		87 92	-		******	<0.2 <0.2		1.3	
					Surface	11.2 0.6 1.0 0.4	23 165	26.2 27.8	27.8	8.3 7.9	7.9	26.6 24.3	24.3	74.3 74.	4.7		11.7 8.1		10 4		91 86				<0.2 <0.2		1.5	_
	Olevete	Madania	40.47	5.0		1.0 0.4	181	27.7	27.0	7.9	7.9	24.4	24.3	74.4	5.1	5.1	8.5	40.7	5	40	86		047045	007400	<0.2		1.3	
IM1	Cloudy	Moderate	13:47	5.8	Middle	4.8 0.2	- 155	27.5	-	7.9	-	25.2	-	69.4	_ 4.8		13.2	10.7	- 19	12	- 88	87	817945	807139	<0.2		1.2	1.3
					Bottom	4.8 0.2 1.0 0.3	156	27.6	27.6	7.9	7.9	25.1	25.2	69.6	5 4.8	4.0	12.9		21		88 85				<0.2		1.4	_
					Surface	1.0 0.3 3.8 0.3	187 156	27.6	27.6	7.9	7.9	24.9	24.8	70.9	9 4.9	4 9	6.8 5.1		9		86 89	1			<0.2		1.0	
IM2	Cloudy	Moderate	13:54	7.6	Middle	3.8 0.3 6.6 0.2	156 137	27.4	27.4	7.9	7.9	26.0	25.9	70.7	4.8	3	5.2	8.8	10	13	88	88	818155	806184	<0.2	<0.2	1.2	1.1
					Bottom	6.6 0.2	150	27.6	27.6	7.9	7.9	26.0	26.0	72.1	8 4.9	4.9	14.4		19		90				<0.2		1.0	
					Surface	1.0 0.2 1.0 0.2	194 201	27.9 27.8	27.9	7.9	7.9	23.7	23.7	76.2 76.2	5.3	5.0	3.6		6		84 84				<0.2		1.2	
IM3	Cloudy	Moderate	14:01	7.8	Middle	3.9 0.3 3.9 0.3	169 175	27.5 27.5	27.5	7.9 7.9	7.9	25.9 25.9	25.9	69.4 69.3	4.7		7.6 7.8	8.4	20 23	<u>25</u>	88 89	88	818774	805592	<0.2	<0.2	1.1	1.2
					Bottom	6.8 0.2 6.8 0.2	141 142	27.4 27.5	27.5	7.9	7.9	26.3 26.2	26.2	69.6 69.8	4.8	4.8	13.8 13.6		46 45		90 90				<0.2 <0.2		1.2	
					Surface	1.0 0.5 1.0 0.5	201 216	27.8 27.8	27.8	7.9	7.9	24.1	24.1	70.8 70.8	4.9	10	5.6 5.7		7 6		85 85				<0.2		1.3	
IM4	Cloudy	Moderate	14:10	8.3	Middle	4.2 0.5 4.2 0.5	177 182	27.5 27.5	27.5	7.9 7.9	7.9	25.4 25.5	25.4	71.2 71.1	2 4.9		5.7 5.7	8.0	7	8	88 89	88	819729	804598	<0.2 <0.2	<0.2	1.2	1.2
					Bottom	7.3 0.4 7.3 0.4	159 173	27.5 27.5	27.5	7.9 7.9	7.9	26.7 26.7	26.7	70.6 70.9	8 4.8		12.6 12.8		9		89 90				<0.2		1.3	
					Surface	1.0 0.5 1.0 0.5	222 241	28.3 28.3	28.3	7.9 7.9	7.9	23.0 23.0	23.0	74.5 74.4 74.	5 5.		4.2 4.3		4		86 86				<0.2		0.9 1.0	
IM5	Cloudy	Moderate	14:20	8.0	Middle	4.0 0.4 4.0 0.4	192 196	27.5 27.5	27.5	7.9 7.9	7.9	25.7 25.7	25.7	71.1 71.0 71.	1 4.9	)	5.5 5.4	8.5	8	8	88 88	88	820751	804889	<0.2 <0.2		1.2	1.2
					Bottom	7.0 0.3 7.0 0.3	185 189	27.4 27.5	27.5	7.9	7.9	26.5 26.5	26.5	70.5 70.7	4.0	1.8	15.9 16.0		12		90	1			<0.2		1.3	
					Surface	1.0 0.4 1.0 0.4	248 255	27.8	27.8	7.9	7.9	23.7	23.7	74.6 75.1 74.	F .	,	5.4 5.6		6		84 84				<0.2		1.2	
IM6	Cloudy	Moderate	14:30	7.9	Middle	4.0 0.3 4.0 0.3	209 217	27.5	27.5	7.9	7.9	25.8 25.8	25.8	66.9 66.8 66.8	4.6	4.9	7.8	10.7	7	15	88	88	821040	805828	<0.2	-02	1.2	1.2
					Bottom	6.9 0.3 6.9 0.3	183 196	27.6 27.6	27.6	7.9	7.9	26.1	26.1	67.6 67.7	4.0	16	18.8 18.6		31 32		90	1			<0.2		1.2	
					Surface	1.0 0.3	251	27.8	27.8	7.8	7.8	23.3	23.4	68.0	1 4.7		7.8		6		84				<0.2		1.4	_
IM7	Cloudy	Moderate	14:37	9.0	Middle	1.0 0.3 4.5 0.1	259 204	27.8 27.6	27.6	7.9	7.9	23.5	24.6	68.1 68.2 68.	2 4.7	4.7	7.9 7.7	10.7	6 10	9	85 89	88	821353	806815	<0.2	-0.2	1.2	1.2
	,				Bottom	4.5 0.2 8.0 0.1	216 158	27.6 27.6	27.6	7.9 7.8	7.8	24.6 25.7	25.7	67.0	4.6	16	7.7 16.8		10 10		89 89				<0.2 <0.2		1.3	
					Surface	8.0 0.2 1.0 0.2	160 100	27.6 27.1	27.1	7.8 8.1	8.1	25.7 23.5	23.5	67.7	8 4.0	· _	16.5 6.3		10 4		89 83				<0.2 <0.2		1.1	$\dashv$
IM8	Cloudy	Moderate	14:38	7.7	Middle	1.0 0.2 3.9 0.2	105 91	27.1 26.8	26.8	8.1 8.1	8.1	23.5 24.0	24.0	67.8 68.2 68.2	4.7		6.3 6.4	8.3	4 6	6	83 88	87	821833	808155	<0.2	-0.2	1.0	0.9
IIVIO	Cloudy	wouerate	14.30	1.7	Bottom	3.9 0.2 6.7 0.2	99 112	26.8 26.8	26.8	8.1 8.2		24.0 24.9	24.0	68.2 70.8 70.	4.8	}	6.4 12.0	0.3	6 8	v	87 92	01	021033	000100	<0.2	<0.2	1.0 0.6	J.5
					Bottom	6.7 0.2	118	26.8	26.8	8.2	8.2	24.9	24.9	70.9	9 4.9		12.2		9		91				<0.2		0.6	

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher

Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring

Water Quality Monitoring Results on 31 August 19 during Mid-Ebb Tide

Water Qual	ity Monit	oring Resu	its on		31 August 19	during Mid-	-Ebb lide	е																					
Monitoring	Weather	Sea	Sampling	Water	Sampling De	oth (m)	Current Speed	Current	Water T	emperature (°C)		pН	Salin	ity (ppt)	DO Saturati (%)		issolved Oxygen	Turbidity	(NTU)	Suspende (mg	ed Solids <sub>I</sub> /L)		Alkalinity pm)	Coordinate HK Grid	Coordinate HK Grid	Chro	mium g/L)	Nickel	(μg/L
Station	Condition	Condition	Time	Depth (m)	Camping De	5ti (iii)	(m/s)	Direction	Value	Average	Value	Average	Value	Average	Value Aver	age Va	ue DA	Value	DA	Value	DA	Value	DA	(Northing)	(Easting)	Value	DA	Value	DA
					Surface	1.0	0.8	124 136	27.4 27.4	27.4	8.1 8.1	8.1	22.7	22.7	72.3 72.2 72.	3 5.	2	5.1 5.1		11 11		83 83				<0.2		1.3	I
IM9	Cloudy	Moderate	14:32	7.1	Middle	3.6	0.6	116 125	26.8	26.8	8.2	8.2	24.5	24.5	68.2 68.2	2 4.		9.5	9.8	9	9	87 88		822089	808792	<0.2	<0.2	1.5	1.4
					Bottom	6.1	0.4	107	26.7	26.7	8.2	8.2	24.9	24.9	68.3	5 4.	B 4.8	14.7	1	7		91 91				<0.2		1.4	ı
					Surface	6.1 1.0	0.4	109 121	26.7 27.4	27.4	8.1	8.1	22.8	22.8	71.4 71.	<sub>4</sub> 5.	)	14.8 4.6		3		83	1			<0.2		1.1	_
IM10	Cloudy	Moderate	14:24	8.3	Middle	1.0 4.2	1.0 0.8	121 117	27.4 27.1	27.1	8.1 8.1	8.1	22.8 23.6	23.6	69.2	2 4.		4.6 5.5	7.4	4 5	6	83 88	87	822375	809812	<0.2 <0.2	<0.2	1.1	1.3
IIVITO	Cioddy	Wiodelate	14.24	0.0	Bottom	4.2 7.3	0.8	128 114	27.1 26.6	26.6	8.1 8.2	8.2	23.6 25.4	25.4	66.6	4.	6 4.6	5.5 12.2		5 8	Ü	87 91	- 07	022373	003012	<0.2	V0.2	1.3	 
						7.3 1.0	0.4	116 116	26.6 27.0		8.2 8.1		25.4 23.8		66.6	4.	6 4.0	12.2 11.5		9 10		91 83				<0.2	Ш	1.3	_
					Surface	1.0	0.7	119 113	27.0	27.0	8.1	8.1	23.8	23.8	70.1	4.		11.5	1	11		83 87	1			<0.2		1.3	ı
IM11	Cloudy	Moderate	14:11	7.7	Middle	3.9	0.6	119	26.9	26.9	8.1	8.1	24.1	24.1	69.4	4 4.	В	13.2	13.7	12	12	88	87	822065	811466	<0.2	<0.2	1.2	1.3
					Bottom	6.7 6.7	0.4	97 102	26.8 26.8	26.8	8.2 8.2	8.2	24.3	24.3	70.7	8 4.		16.4 16.7		12 14		91 92				<0.2		1.4	
					Surface	1.0	0.4	64 67	27.3 27.3	27.3	8.1 8.1	8.1	23.3	23.3	72.7 72.6		1 5.1	4.2 4.1	ŀ	7 6		83 87	1			<0.2 <0.2		1.2	ı
IM12	Cloudy	Moderate	14:02	9.9	Middle	5.0 5.0	0.4	59 64	27.2 27.2	27.2	8.1	8.1	23.4	23.4	71.7	7 5.	0	4.5 4.5	7.0	9	8	87 87		821445	812031	<0.2	<0.2	1.1	1.3
					Bottom	8.9 8.9	0.3	58 58	26.7 26.7	26.7	8.2	8.2	24.9	24.8	67.2 67.3	3 4.	7 4.7	12.3 12.2		9		92 91				<0.2		1.4	ı
					Surface	1.0	-	-	27.0 27.0	27.0	8.1	8.1	23.8	23.7	69.1 69.0	1 4.	B 10	6.8 6.9		10		-				-	П	-	_
SR1A	Cloudy	Moderate	13:43	5.4	Middle	2.7		-	-	-	-	-	-	-			4.8	-	7.1	-	11	-	-	819978	812662	-	.		-
					Bottom	2.7 4.4	-	-	26.6	26.6	8.1	8.1	24.9	25.0	65.9 65.		6 4.6	7.3		12		-				-			ı
					Surface	1.0	0.5	103	26.6 26.9	26.9	8.1	8.2	25.0 24.4	24.4	65.8	4.	B	7.5 10.4		11 10		- 83				<0.2	H	1.4	_
						1.0	0.6	109	26.9	20.9	8.2	0.2	24.4	24.4	68.3	4 4.	4.8	10.4		11		83	7			<0.2	_ [	1.3	١
SR2	Cloudy	Moderate	12:59	4.8	Middle	3.8	0.3	- 99	26.8	-	8.3	-	24.6	-	68.1	2 4.	R	13.9	12.2	- 14	12	- 88	85	821444	814182	<0.2	<0.2	1.2	1.3
					Bottom	3.8	0.3	104 278	26.8 27.2	26.8	8.3	8.3	24.6	24.6	68.2	4.	B 4.0	14.1		12		87				<0.2	$\square$	1.3	_
					Surface	1.0	0.0	290	27.2	27.2	8.1	8.1	23.1	23.1	67.3	3 4.	7 47	6.9	1	5		Ė				-		릐	ı
SR3	Cloudy	Moderate	14:45	8.4	Middle	4.2 4.2	0.0	137 147	26.7 26.7	26.7	8.1 8.1	8.1	24.6 24.6	24.6	65.9 65.9	4.	6	10.2 10.2	10.2	3	4	-	-	822143	807568	-	-	己	
					Bottom	7.4	0.2	85 87	26.6 26.6	26.6	8.2	8.2	25.1 25.1	25.1	64.9 65.0	4.	5 4.5	13.6 13.6		3		-				-		-	ı
					Surface	1.0	0.1 0.1	108 115	28.1 28.1	28.1	7.9 7.9	7.9	23.6	23.6	74.6 74.9	8 5.	1 40	4.0 4.1		5 6		-	-			-		-	
SR4A	Cloudy	Calm	13:11	8.4	Middle	4.2	0.1	61 62	27.6 27.6	27.6	7.9 7.9	7.9	25.0 25.0	25.0	67.8 67.8	8 4.		14.7 14.9	11.9	21 21	16	-	-	817208	807821	-	-	-	-
					Bottom	7.4	0.1	70 72	27.6	27.6	7.9	7.9	25.1 25.1	25.1	68.5 68.7	- 4	7 47	16.8 16.9	İ	20		-	1			-		-	ı
					Surface	1.0	0.0	28	28.3	28.3	7.8	7.8	23.4	23.4	76.3 76.1	2 5.		5.5		6		Ė				Ė	Ħ	Ħ	_
SR5A	Cloudy	Calm	12:51	5.4	Middle	1.0	0.0	-	28.3	-	-		-	-		5.	5.2	5.5	7.4	-	8	Ė	1 .	816610	810695	-	_	一	
	,				Bottom	4.4	0.0	112	27.8	27.8	7.9	7.9	23.8	23.8	72.9 73.		5.0	9.4		8		-				-	]	己	ı
					Surface	1.0	0.0	115 113	27.8 27.8	27.9	7.9	7.8	23.8	22.3	71.1	5. 4.	9	9.3 7.8		10 14		-				-	$\vdash\vdash$	-	_
						1.0	0.0	117	27.9	21.9	7.8	1.0	22.2	22.3	71.1	4.	4.9	7.9		13		-	7			-	[	-	i
SR6A	Cloudy	Calm	12:04	4.6	Middle	3.6	0.1	230	27.4	-	7.8	-	24.5	-	66.3	- 4	6 40	10.8	9.3	- 44	<u>30</u>	-	] -	817957	814741	-	-		
					Bottom	3.6 1.0	0.1	243	27.5	27.5	7.8	7.8	24.5	24.5	66.6	5 4.	6 4.6	10.7		47 12		Ē				-	Ш		_
					Surface	1.0	8.0	83	27.2	27.2	8.2	8.2	23.9	23.9	74.0	5.	1 50	3.3		12		-	1			-			ı
SR7	Cloudy	Moderate	12:04	14.6	Middle	7.3 7.3	0.5	69 73	26.6 26.6	26.6	8.3 8.3	8.3	25.2 25.2	25.2	70.0 70.	4.	9	4.3 4.3	4.1	12	11	-	<u> </u>	823623	823732	-	-	-	-
					Bottom	13.6 13.6	0.2	50 53	26.6 26.7	26.7	8.2	8.2	25.2 25.2	25.2	70.7	8 4.	9 4.9	4.6 4.6		11 10		-	1	<u></u>		-			
					Surface	1.0	-	-	27.3 27.3	27.3	8.1 8.1	8.1	23.0	23.0	71.4 71.4 71.	4 5.	0	6.4 6.4		13 12		-	-			-		-	_
SR8	Cloudy	Moderate	13:53	4.1	Middle	-	-	-	-	-		-	H	-			5.0	-	10.2	-	14	-	] -	820411	811612	-	-	-	
					Bottom	3.1			27.0	27.0	8.2 8.2	8.2	23.7	23.7	70.3	4 4.		14.0		15 14		-	‡			Ė		-	ı
	l	l	1		1	3.1	1 -	1 -	27.0		J 8.2		23.7		70.4	4.	9	14.1		14			1	1	1	1 -	1 1	1	

DA: Depth-Averaged
Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher
Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

### Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 31 August 19 during

during Mid-Flood Tide

Station	/eather	Sea	Sampling	Water			Current	M/m/ 7	- 0			0.0		DO Saturation	n Di	ssolved			Suspended	d Solids	otal All	calinity	Coordinat	Coordings	Chron		3 Pales I A	
Station Cor	ondition				Sampling Dep	th (m)	Speed Curre	IL	Temperature (°C)		pН	Salin	ity (ppt)	(%)		xygen	Turbidity(	NIU)	(mg/l	L)	(ppr		Coordinate HK Grid	Coordinate HK Grid	(µg/		Nickel (	·g/L)
		Condition	Time	Depth (m)	3 1		(m/s) Directi	Value	Average	Value	Average		Average	Value Avera	•		Value	DA	Value	DA	/alue	DA	(Northing)	(Easting)	Value		Value	DA
					Surface	1.0 1.0 4.1	0.3 48 0.3 51 0.1 70	27.9 27.8 27.3	27.9	7.9 7.9 7.9	7.9	22.6 22.6 26.6	22.6	75.4 75.3 68.3	5.2 5.2	] [	5.6 5.5 13.3		6 11	F	88 88 89				<0.2 <0.2 <0.2		1.1 1.3 1.0	
C1 Clo	Cloudy	Moderate	19:49	8.1	Middle	4.1	0.1 66	27.3	27.3	7.9	7.9	26.6	26.6	68.5	4.7		13.2	12.1	10	10	90	89	815615	804248	<0.2	<0.2	0.8	1.0
					Bottom	7.1 7.1	0.2 46 0.2 50	27.3 27.3	27.3	7.9 7.9	7.9	27.0 27.0	27.0	69.7 69.9	3 4.8		17.4 17.5		14 15		90				<0.2		1.0	
					Surface	1.0	0.4 65 0.4 78	27.0 27.0	27.0	8.0	8.0	23.5 23.5	23.5	66.8 67.0	4.1	16	8.9 8.7		6 7		84 85				<0.2		1.9 1.8	
C2 Clo	Cloudy	Moderate	18:46	8.5	Middle	4.3 4.3	0.4 72 0.4 73	26.7 26.7	26.7	8.0	8.0	24.4	24.4	64.2 64.2	4.5		10.6 10.5	11.1	7	7	88 89	89	825678	806923	<0.2	<0.2	1.8 2.0	1.9
					Bottom	7.5 7.5	0.3 32 0.3 35	26.1 26.1	26.1	8.1 8.1	8.1	26.9 26.9	26.9	62.6 62.6	4.4	4.4	14.1 14.0		8 7		92 93				<0.2		1.9	
					Surface	1.0	0.2 203 0.2 225	26.4 26.4	26.4	8.0	8.0	25.3 25.4	25.3	69.4 69.3	4.8	1 46	3.0		5 6		84 85				<0.2		1.1	
C3 Clo	Cloudy	Moderate	20:58	10.8	Middle	5.4 5.4	0.3 270 0.3 285	25.4 25.3	25.4	8.0	8.0	28.9 28.9	28.9	61.7 61.7	4.3		6.3 6.4	5.6	5	5	88 88	88	822091	817781	<0.2	<0.2	1.0	1.1
					Bottom	9.8 9.8	0.2 303 0.2 315	25.1 25.1	25.1	8.0	8.0	29.7 29.7	29.7	60.9 61.0	4.3	4.3	7.5 7.4		5 5		93 92				<0.2 <0.2		1.1	
					Surface	1.0	0.1 50 0.1 53	28.1 28.1	28.1	7.9	7.9	23.5	23.5	77.2 77.3	5.3		4.4		3		84 84				<0.2		1.3	
IM1 Clo	Cloudy	Moderate	19:30	5.6	Middle	-		-	-	-	-	-	-	-	-	5.5		4.3	-	3	-	86	817933	807153	-	<0.2	-	1.3
					Bottom	4.6 4.6	0.2 90 0.2 83	27.7 27.6	27.7	7.9 7.9	7.9	23.8	23.9	82.3 83.0 82.	5.7	5.7	4.2 4.2		4		88 89				<0.2		1.3	
					Surface	1.0	0.3 65 0.3 72	27.9 27.9	27.9	7.9 7.9	7.9	23.4	23.4	76.7 76.6	5.3	J <sub>6.1</sub>	4.0		4		85 85				<0.2		1.4	
IM2 Clo	Cloudy	Moderate	19:23	6.4	Middle	3.2 3.2	0.2 81 0.2 84	27.6 27.6	27.6	7.9	7.9	24.7	24.7	69.5 69.4	4.8		8.3 8.7	8.0	8	7	88 89	88	818170	806174	<0.2	<0.2	1.3	1.3
					Bottom	5.4 5.4	0.1 63 0.1 62	27.5 27.5	27.5	7.9 7.9	7.9	25.6 25.6	25.6	69.6 69.8	4.8	4.8	11.5 11.4		10		90 90				<0.2		1.3	
					Surface	1.0	0.2 63 0.2 53	27.8 27.8	27.8	7.9	7.9	23.2	23.2	75.8 75.7	5.2	J 50	3.7 3.9		3 4		85 85				<0.2		1.4	
IM3 Clo	Cloudy	Moderate	19:17	8.2	Middle	4.1	0.2 73 0.2 75	27.4	27.4	7.9	7.9	26.0 26.0	26.0	69.4 69.5	4.8		12.6 12.8	10.2	7	7	88	88	818768	805609	<0.2	<0.2	1.4	1.4
					Bottom	7.2	0.2 64 0.3 65	27.4	27.4	7.9	7.9	26.1 26.1	26.1	70.7	4.8	4.8	14.2		10		90				<0.2		1.4	
					Surface	1.0	0.4 52 0.4 55	27.8	27.8	7.9	7.9	23.7	23.7	73.7 73.7	5.1	J 40	5.4		3		85 86				<0.2		1.2	
IM4 Clo	Cloudy	Moderate	19:07	8.7	Middle	4.4	0.2 71 0.3 73	27.4 27.4	27.4	7.9	7.9	26.2	26.2	69.1 69.3	4.1		9.6 9.5	10.4	6	8	88	88	819733	804604	<0.2	<0.2	1.3	1.3
					Bottom	7.7	0.3 42 0.3 45	27.4	27.4	7.9	7.9	26.6	26.6	70.5 70.8 70.8	4.8	4.8	15.9 16.2		15 15		90				<0.2		1.2	
					Surface	1.0	0.4 49 0.4 48	27.7	27.7	7.9	7.9	24.4	24.4	70.5 70.4 70.4	4.8	J 48	7.1		9		84 84				<0.2		1.4	
IM5 Clo	Cloudy	Moderate	19:00	8.1	Middle	4.1	0.1 58 0.1 59	27.5 27.5	27.5	7.9	7.9	25.5 25.6	25.6	69.7 69.7	4.8		7.1	9.8	12	13	88	87	820741	804875	<0.2	<0.2	1.4	1.4
					Bottom	7.1 7.1	0.2 47 0.2 45	27.4 27.4	27.4	7.9 7.9	7.9	26.6 26.6	26.6	69.5 69.7	4.8	4.8	15.3 15.0		19 17		89 90				<0.2		1.4	
					Surface	1.0	0.3 37 0.4 35	28.0	28.0	7.8	7.8	23.4	23.3	72.6 72.9 72.9	5.0	J 50	5.6 5.5		7		84 85				<0.2		1.4	
IM6 Clo	Cloudy	Moderate	18:54	7.6	Middle	3.8	0.3 42 0.3 43	27.6 27.6	27.6	7.9	7.9	24.6	24.5	70.8 70.9	4.8		7.2	9.2	12	13	89 89	88	821069	805849	<0.2	<0.2	1.3	1.4
					Bottom	6.6 6.6	0.3 45 0.3 46	27.7 27.7	27.7	7.8 7.8	7.8	25.9 25.9	25.9	70.5 71.3	4.9	4.9	15.0 14.9		19 18	-	90 90				<0.2		1.6	
					Surface	1.0	0.2 29 0.2 27	27.8 27.8	27.8	7.8 7.8	7.8	23.2	23.2	69.4 69.6	4.8	49	7.9 7.8		5 6		85 85				<0.2		1.5	
IM7 Clo	Cloudy	Moderate	18:43	8.7	Middle	4.4 4.4	0.1 38 0.1 35	27.6 27.6	27.6	7.9	7.9	24.9 25.0	24.9	71.0 71.0	4.9	-	8.1 8.0	11.1	12	12	88	88	821358	806837	<0.2	<0.2	1.4	1.5
					Bottom	7.7	0.2 36 0.2 35	27.7	27.7	7.9	7.9	25.6 25.6	25.6	75.2 75.8 75.8	5.2	5.2	17.3 17.4		20	-	90				<0.2		1.5	
					Surface	1.0	0.2 344 0.2 359	27.2	27.2	7.9	7.9	22.1	22.1	63.6 63.6	4.5	4.5	6.6		5		85 85				<0.2		2.1	
IM8 Clo	Cloudy	Moderate	19:05	7.9	Middle	4.0 4.0	0.2 317 0.2 305	27.0	27.0	8.0	8.0	22.7	22.7	62.9 63.0	4.4	-	9.6 9.5	10.2	5 4	5	88 89	89	821833	808136	<0.2	<0.2	2.0	2.0
DA: Depth-Averaged					Bottom	6.9 6.9	0.2 325 0.2 315	26.8 26.9	26.9	8.0	8.0	24.4	24.4	68.5 68.5	4.8		14.6 14.3		7	-	92 93				<0.2		1.9	

DA: Depth-Averaged

Calm: Small or no wave; Moderate: Between calm and rough; Rough : White capped or rougher


Value exceeding Action Level is underlined; Value exceeding Limit Level is bolded and underlined


## Expansion of Hong Kong International Airport into a Three-Runway System Water Quality Monitoring Water Quality Monitoring Results on 31 August 19 during


during Mid-Flood Tide


Water Qual	ity Monit	oring Resu	its on		31 August 19	during Mid-		de					_													
Monitoring	Weather	Sea	Sampling	Water	Sampling Dep	th (m)	Current Speed	Current Direction	Water Te	mperature (°C)		pН	Salir	nity (ppt)		aturation (%)	Dissolved Oxygen	Turbidi	y(NTU)	Suspend (mg	ed Solids I/L)	Total Alkali (ppm)	Coordinate HK Grid	Coordinate HK Grid	Chromiu (µg/L)	
Station	Condition	Condition	Time	Depth (m)			(m/s)		Value	Average		Average		Average	Value	Average	Value DA	Value	DA	Value	DA	Value D	A (Northing)	(Easting)		DA Value DA
					Surface	1.0	0.4	318 322	27.2 27.2	27.2	8.0	8.0	22.1	22.1	67.4 67.4	67.4	4.7 4.7 4.7	6.3	Ⅎ	4 5		85 85			<0.2	2.0
IM9	Cloudy	Moderate	19:11	7.3	Middle	3.7	0.5	299 297	27.0 27.0	27.0	8.0	8.0	22.7	22.7	67.5 67.5	67.5	4.7	10.2	10.3	6	6	88 89	822098	808834	<0.2	0.2 1.9 1.9
					Bottom	6.3 6.3	0.4	275 278	26.9 26.9	26.9	8.0	8.0	24.4	24.4	69.8 70.0	69.9	4.9 4.9	14.5 14.2	7	6		92 93			<0.2	1.9
					Surface	1.0	0.7	292 294	27.2 27.2	27.2	7.9	7.9	22.0	22.0	69.4	69.5	4.9	5.6 5.6		4 5		84 85			<0.2	1.8
IM10	Cloudy	Moderate	19:19	7.5	Middle	3.8	0.5	294 296	26.9 26.9	26.9	8.0	8.0	24.1	24.1	67.6 67.6	67.6	4.9 4.7 4.7	9.4	10.1	4	4	89 88	9 822401	809780	~O 2	0.2 1.9 1.9
					Bottom	6.5	0.3	285	26.9	26.9	8.0	8.0	24.2	24.2	67.6	67.6	4.7	15.3	1	4		92			<0.2	1.9
					Surface	6.5 1.0	0.3	288 284	26.9 27.1	27.1	8.0 7.9	7.9	24.2 22.4	22.4	67.6 69.2	69.2	4.7	15.2 6.3		7		93 84		1	<0.2	1.9
IM11	Cloudy	Moderate	19:29	8.3	Middle	1.0 4.2	0.5	289 283	27.1 26.8	26.8	7.9 8.0	8.0	22.4	23.6	69.2 68.3	68.3	4.9 4.8 4.9	6.4	6.8	8 7	7	85 89 8	9 822039	811456	<0.2	0.2 1.6 1.6
IIVI I	Cloudy	woderate	19.29	0.3		4.2 7.3	0.3	284 270	26.8 26.4		8.0		23.6 25.4		68.3 66.6		4.8	6.0 8.0	0.0	7	,	89 92	622039	611456	<0.2	1.7
					Bottom	7.3	0.2	277 272	26.4	26.4	8.0	8.0	25.4	25.4	66.8	66.7	4.7 4.7 4.6	8.1 7.6	1	6		93			<0.2	1.5
					Surface	1.0	0.4	279	26.6	26.6	8.0	8.0	24.8	24.8	65.7	65.8	4.6	7.7	1	9		85			<0.2	1.3
IM12	Cloudy	Moderate	19:34	7.8	Middle	3.9 3.9	0.3	269 258	26.6 26.6	26.6	8.0	8.0	25.0 25.0	25.0	65.4 65.5	65.5	4.6 4.6	8.9 9.0	8.9	9	9	89 89	9 821456	812032	<0.2	0.2 1.4 1.4
					Bottom	6.8	0.3	260 263	26.4 26.4	26.4	8.0	8.0	25.3 25.3	25.3	66.8 67.1	67.0	4.7 4.7	10.1 10.2		9 10		92 93			<0.2 <0.2	1.3
					Surface	1.0	-	-	26.6 26.6	26.6	8.0	8.0	24.6	24.6	66.5 66.5	66.5	4.7 4.7	7.3	+	6 7		-			-	-
SR1A	Cloudy	Moderate	20:23	5.6	Middle	2.8	-	-	-	-	-	-	-	-	-	-	- 4.7	-	7.4	-	8	-	819978	812659	-	
					Bottom	4.6 4.6	-	-	26.5 26.5	26.5	8.0	8.0	25.0 25.0	25.0	65.6 65.6	65.6	4.6 4.6	7.4 7.5	7	9 10		-				-
					Surface	1.0	0.3	242 244	26.6 26.6	26.6	8.0	8.0	24.7	24.7	66.7	66.7	4.7	8.0		6 7		85 84			<0.2 <0.2	1.3
SR2	Cloudy	Moderate	20:35	5.0	Middle	-	-	-	-	-	-	-	-	-	-	-	4.7	-	8.3	-	7	- 8	821459	814166		0.2 - 1.2
					Bottom	4.0	0.2	250	26.3	26.3	8.0	8.0	25.7	25.7	65.2	65.3	4.6 4.6	8.6	1	8		88			<0.2	1.2
					Surface	4.0 1.0	0.2	262 75	26.3 27.1	27.1	8.0	8.0	25.7 23.0	23.0	65.3 67.1	67.3	4.6	8.6 8.9		8 6		- 88			<0.2	1.1
SR3	Cloudy	Moderate	19:00	8.8	Middle	1.0 4.4	0.2	74 88	27.1 26.8	26.8	8.0	8.0	23.0	23.9	67.4 63.6	63.6	4.7 4.4 4.6	8.9 11.7	11.2	6 5	6	-	822142	807549	-	. 🗀 .
	,				Bottom	4.4 7.8	0.1	89 65	26.8 26.8	26.8	8.0 8.1	8.1	24.0 24.7	24.7	63.6 68.1	68.2	4.4 4.8 4.8	11.9 13.1	₫	6 5	-	-			-	
					Surface	7.8 1.0	0.1	63 274	26.8 27.7	27.7	8.1 7.9	7.9	24.7	23.2	68.2 72.0	72.0	4.8 4.8 5.0	13.0 6.6	1	5 8		-		1	-	
						1.0 4.7	0.3	281 263	27.7 27.6		7.9 7.9		23.2		71.9 70.5		5.0 4.9 5.0	6.5 12.9	7	8 12		-			-	-
SR4A	Cloudy	Calm	20:15	9.4	Middle	4.7 8.4	0.3	265 282	27.6 27.5	27.6	7.9	7.9	24.4	24.4	70.6 72.4	70.6	4.9	13.0 16.4	12.0	13	13	-	817189	807821	-	. 🗎 .
					Bottom	8.4	0.2	277 249	27.5	27.5	7.9	7.9	24.5	24.5	72.8	72.6	5.0 5.0	16.6	1	19		-				
					Surface	1.0	0.2	253	27.8	27.8	7.9	7.8	23.4	23.4	73.3	73.3	5.1	10.2	1	15		-				-
SR5A	Cloudy	Moderate	20:32	5.2	Middle	-	-	-	-	-	-	-	-	-	-	-	-	-	12.2	-	16	-	816570	810692	-	- 🖃 -
					Bottom	4.2 4.2	0.3	202 205	27.6 27.5	27.6	7.9 7.9	7.9	23.6	23.6	74.3 74.9	74.6	5.1 5.2	14.0		16 18		-			-	-
					Surface	1.0	0.0	246 247	27.8 27.8	27.8	7.8	7.8	22.3	22.3	72.2 72.3	72.3	5.0 5.0 5.0	5.7 5.8		9		-			-	-
SR6A	Cloudy	Calm	21:00	5.7	Middle	-	-	-	-	-	-	-	-	-	-	-	- 5.0	-	7.6	-	10	-	817964	814741	-	
					Bottom	4.7 4.7	0.1	259 271	27.7 27.7	27.7	7.8	7.8	22.7 22.7	22.7	69.5 69.5	69.5	4.8 4.8	9.8 9.2		10 11		-			-	
					Surface	1.0	0.3	217 225	25.4 25.4	25.4	8.0 8.0	8.0	28.8	28.8	72.7 72.6	72.7	5.1	5.1 5.0	+	9					Ħ	
SR7	Cloudy	Moderate	21:26	14.4	Middle	7.2	0.1	244	25.2	25.2	8.0	8.0	29.6	29.6	70.7	70.8	4.9	8.3	7.3	9	9	-	823634	823736	Ħ	. 🗀 .
					Bottom	7.2 13.4	0.1	246 224	25.2 25.1	25.1	8.0	8.0	29.6 29.8	29.8	70.9 60.8	60.9	4.9 4.2 4.3	8.2	‡	9		-				-
					Surface	13.4 1.0	0.5	236	25.1 26.7	26.7	8.0	8.0	29.8 24.5	24.5	60.9 66.7	66.7	4.3	8.6 7.0	$\pm$	8 6		-		<del>                                     </del>		
SR8	Clouds	Modorate	10:44	4.4		1.0	-	-	26.7	20.1	8.0	0.0	24.5	24.0	66.6	00.1	4.7	7.1	7.3	6	8	-	920297	011620		-
SK8	Cloudy	Moderate	19:44	4.4	Middle	3.4	-	-	26.6	-	8.0	-	24.8		65.6	-	4.6	7.6	1.3	- 9	ď	-	820387	811639	-	
					Bottom	3.4	-	-	26.6	26.6	8.0	8.0	24.8	24.8	65.6	65.6	4.6	7.6		10		-			-	-


DA: Depth-Averaged
Calm: Small or no wave; Moderate: Between calm and rough; Rough: White capped or rougher
Value exceeding Action Level is underlined: Value exceeding Limit Level is bolded and underlined

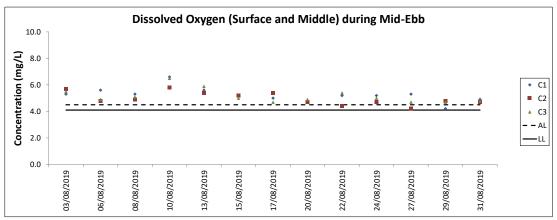


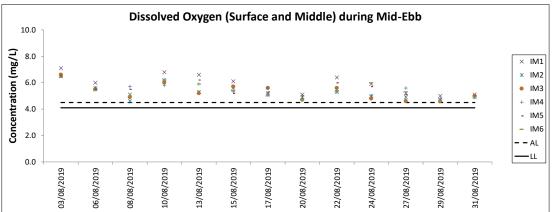


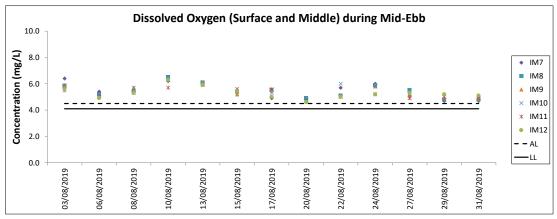


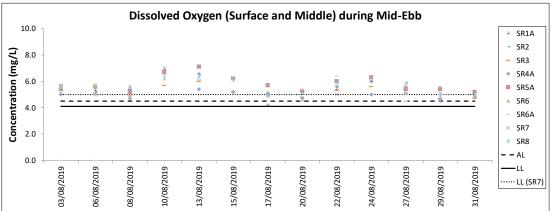


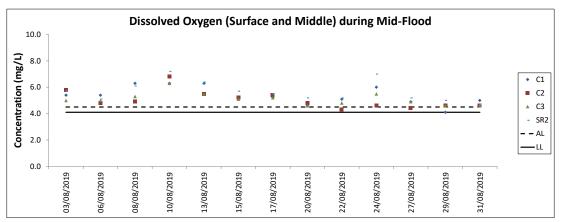


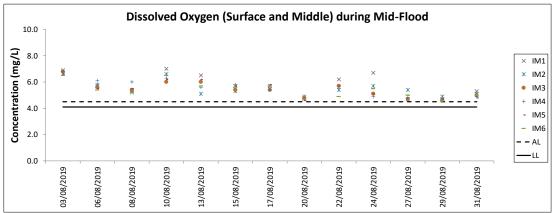


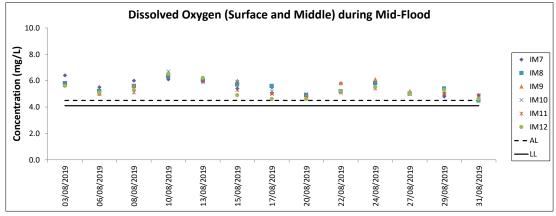


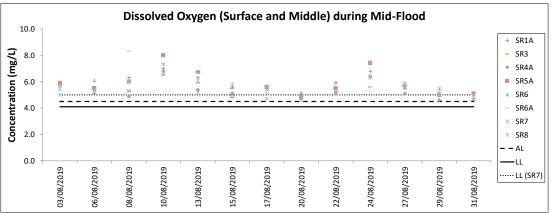


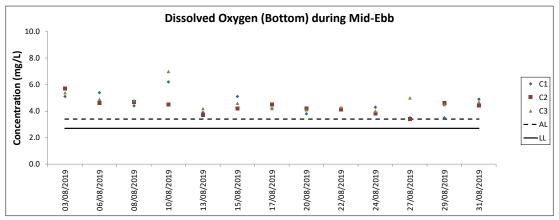


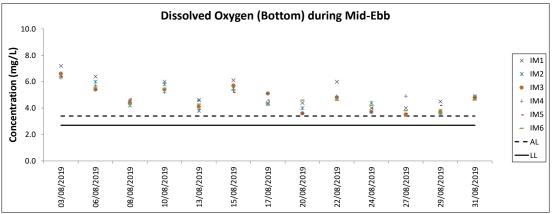


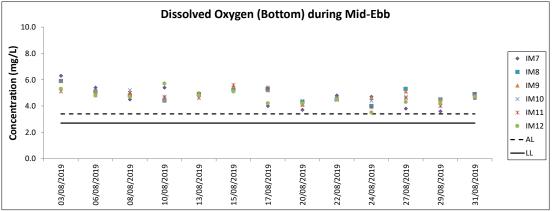


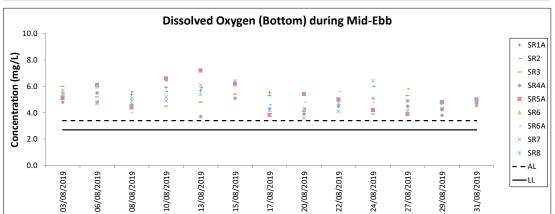


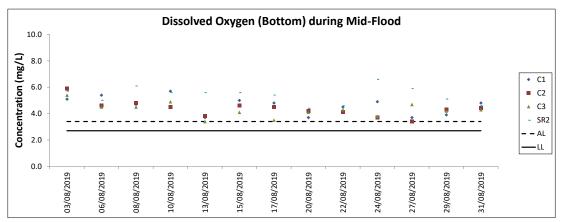


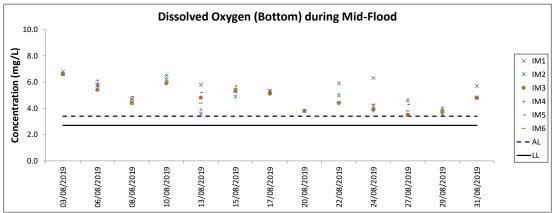


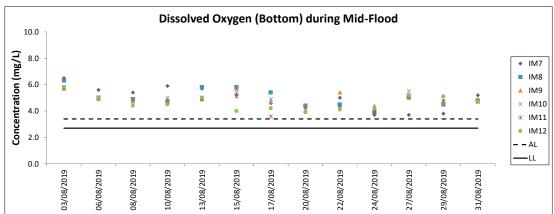


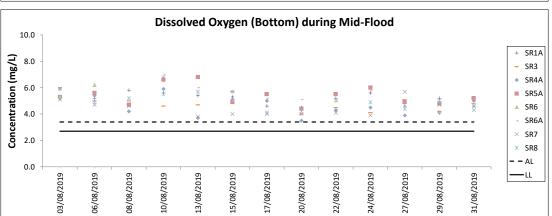

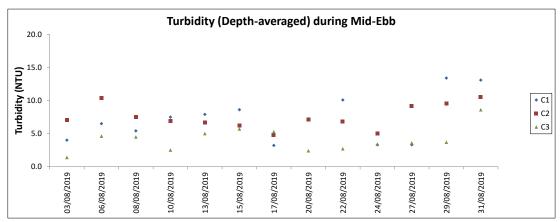


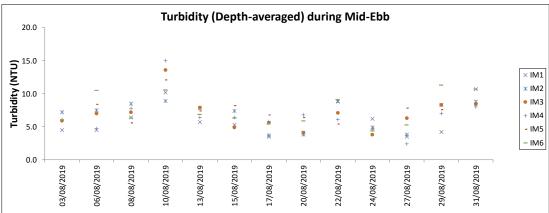


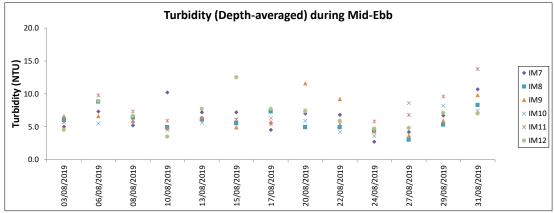


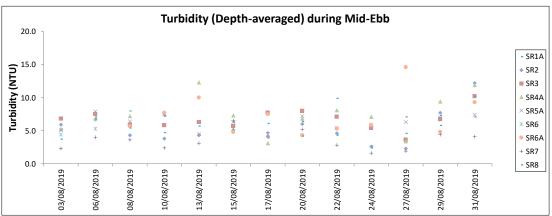


Note: The Action and Limit Level of turbidity can be referred to Table 4.2 of the monthly EM&A report.

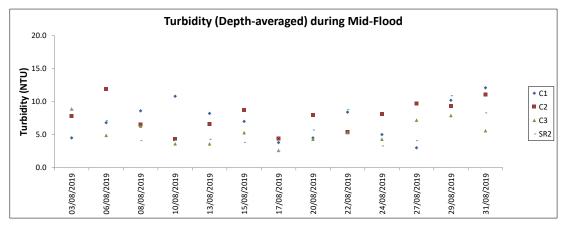


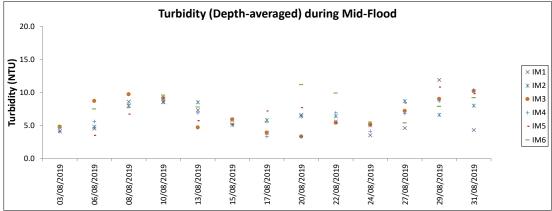


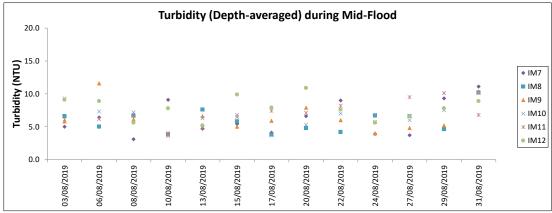


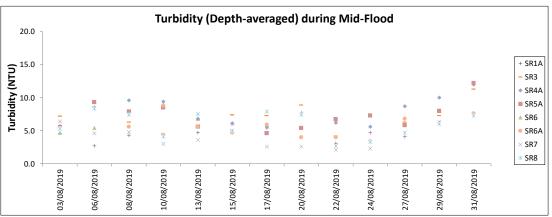



Note: The Action and Limit Level of turbidity can be referred to Table 4.2 of the monthly EM&A report.

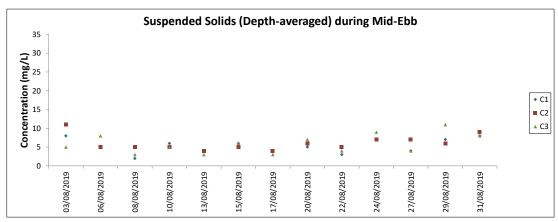


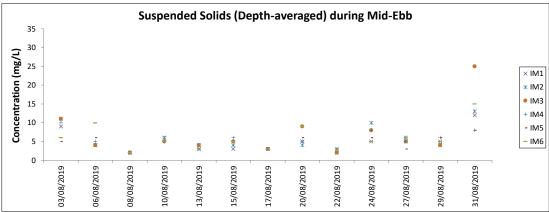


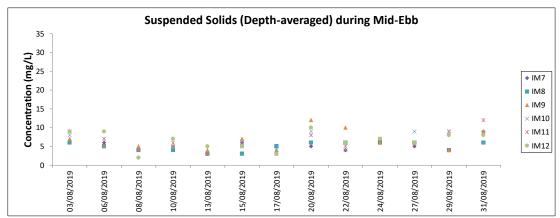


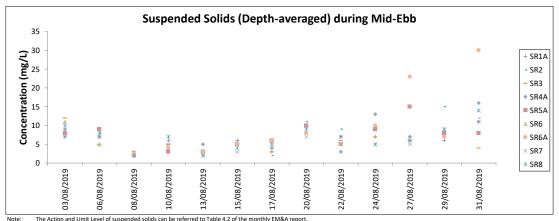


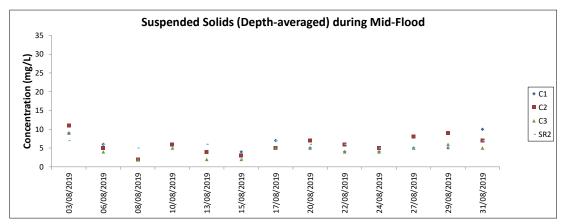


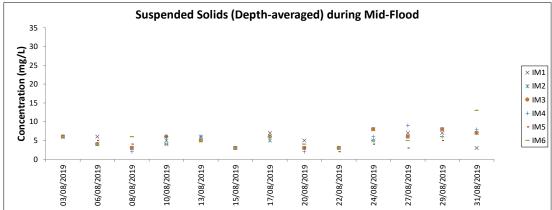


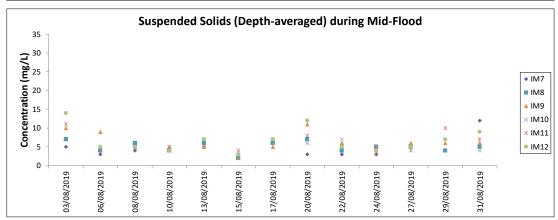


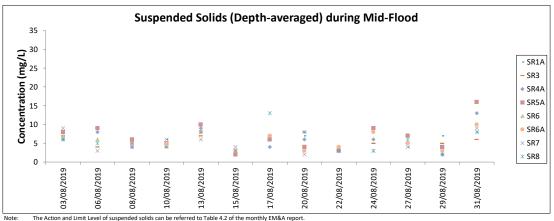


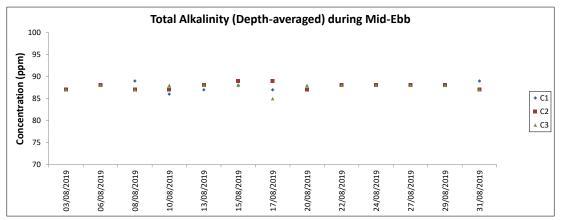


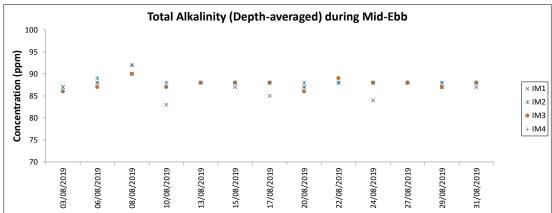


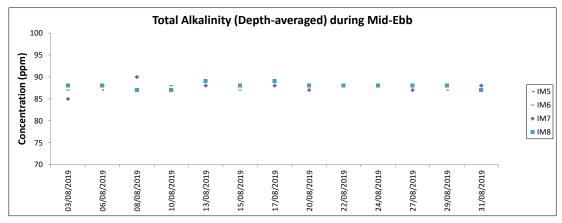


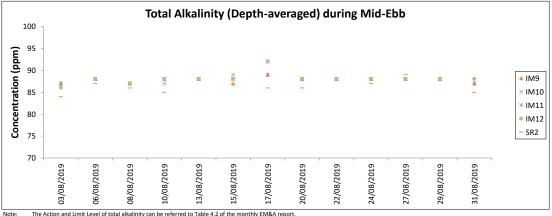

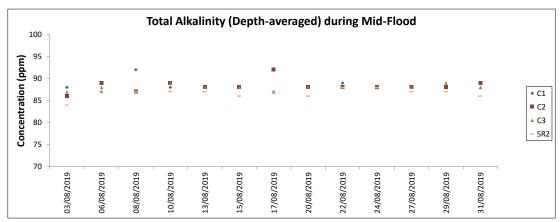


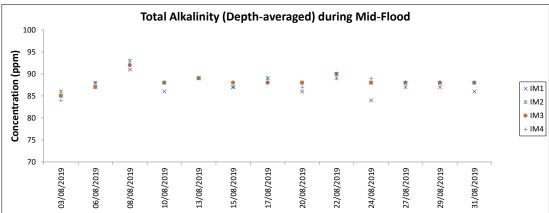


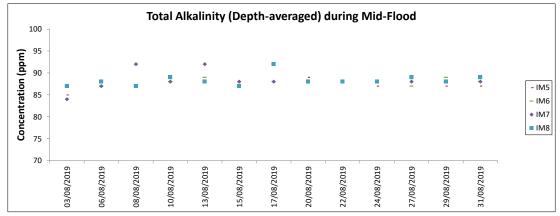


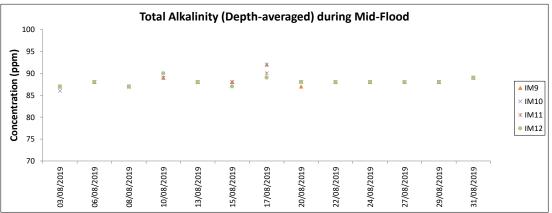


Note: The Action and Limit Level of total alkalinity can be referred to Table 4.2 of the monthly EM&A report.

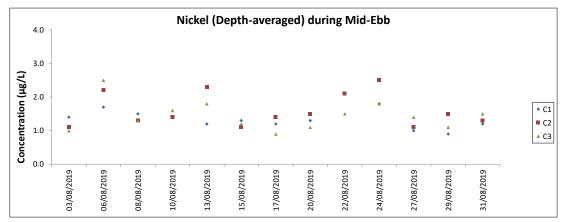


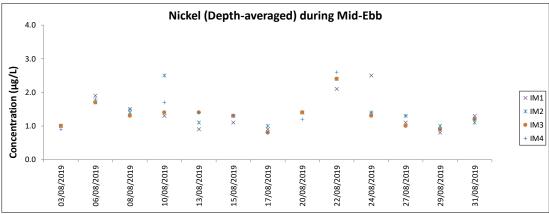


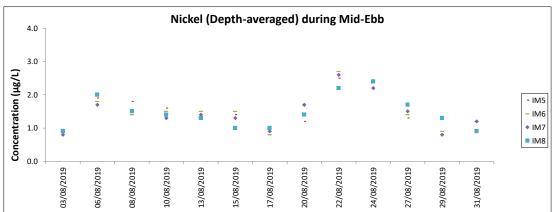


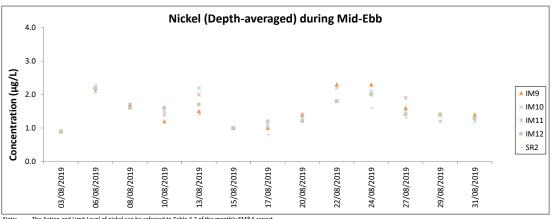


ote: The Action and Limit Level of nickel can be referred to Table 4.2 of the monthly EM&A report. All chromium results in the reporting period was below the reporting limit 0.2 µg/L.

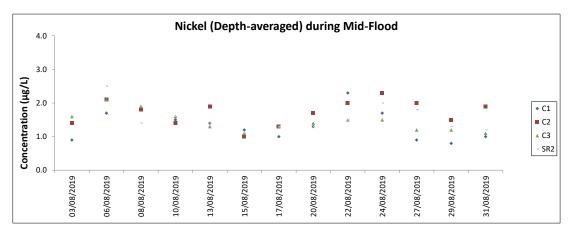

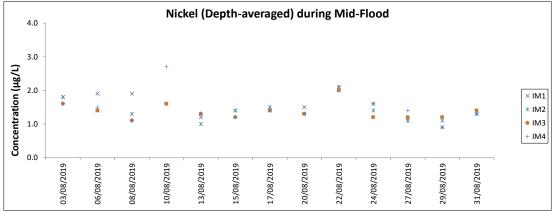

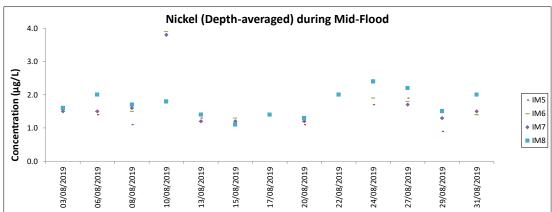

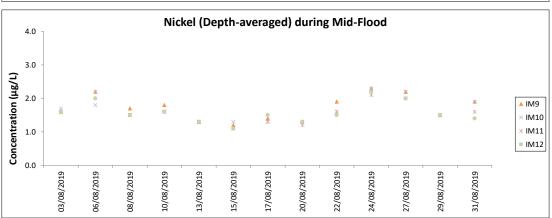

The Action and Limit Level of nickel can be referred to Table 4.2 of the monthly EM&A report.

All chromium results in the reporting period was below the reporting limit 0.2 µg/L.

Major site activities carried out during the reporting period are summarized in Section 1.4 of the monthly EM&A report.

Weather conditions during monitoring are presented in the data tables above.

QA/ QC requirements as stipulated in the EM&A Manual were carried out during measurement.

Mott MacDonald   Expansion of Hong Kong International Airport into a Three-Runway System
Chinese White Dolphin Monitoring Result

#### **CWD Small Vessel Line-transect Survey**

#### **Survey Effort Data**

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
4-Jun-19	NEL	2	27.350	SUMMER	32166	3RS ET	Р
4-Jun-19	NEL	3	7.700	SUMMER	32166	3RS ET	Р
4-Jun-19	NEL	4	2.600	SUMMER	32166	3RS ET	Р
4-Jun-19	NEL	2	7.050	SUMMER	32166	3RS ET	S
4-Jun-19	NEL	3	3.200	SUMMER	32166	3RS ET	S
6-Jun-19	AW	2	4.730	SUMMER	32166	3RS ET	Р
6-Jun-19	WL	2	7.467	SUMMER	32166	3RS ET	Р
6-Jun-19	WL	3	12.575	SUMMER	32166	3RS ET	Р
6-Jun-19	WL	2	1.850	SUMMER	32166	3RS ET	S
6-Jun-19	WL	3	7.388	SUMMER	32166	3RS ET	S
6-Jun-19	WL	4	0.570	SUMMER	32166	3RS ET	S
11-Jun-19	NEL	1	1.600	SUMMER	32166	3RS ET	Р
11-Jun-19	NEL	2	34.960	SUMMER	32166	3RS ET	Р
11-Jun-19	NEL	1	1.200	SUMMER	32166	3RS ET	S
11-Jun-19	NEL	2	10.140	SUMMER	32166	3RS ET	S
17-Jun-19	SWL	3	10.690	SUMMER	32166	3RS ET	Р
17-Jun-19	SWL	4	44.330	SUMMER	32166	3RS ET	Р
17-Jun-19	SWL	2	0.900	SUMMER	32166	3RS ET	S
17-Jun-19	SWL	3	2.800	SUMMER	32166	3RS ET	S
17-Jun-19	SWL	4	12.480	SUMMER	32166	3RS ET	S
18-Jun-19	SWL	2	51.312	SUMMER	32166	3RS ET	Р
18-Jun-19	SWL	3	2.970	SUMMER	32166	3RS ET	Р
18-Jun-19	SWL	2	10.560	SUMMER	32166	3RS ET	S
18-Jun-19	SWL	3	3.830	SUMMER	32166	3RS ET	S
19-Jun-19	NWL	1	7.700	SUMMER	32166	3RS ET	Р
19-Jun-19	NWL	2	30.077	SUMMER	32166	3RS ET	Р
19-Jun-19	NWL	3	24.682	SUMMER	32166	3RS ET	Р
19-Jun-19	NWL	1	3.900	SUMMER	32166	3RS ET	S
19-Jun-19	NWL	2	6.050	SUMMER	32166	3RS ET	S
19-Jun-19	NWL	3	2.491	SUMMER	32166	3RS ET	S
26-Jun-19	AW	2	5.100	SUMMER	32166	3RS ET	Р
26-Jun-19	WL	2	18.167	SUMMER	32166	3RS ET	Р
26-Jun-19	WL	3	2.710	SUMMER	32166	3RS ET	Р
26-Jun-19	WL	2	9.143	SUMMER	32166	3RS ET	S
26-Jun-19	WL	3	1.810	SUMMER	32166	3RS ET	S
27-Jun-19	NWL	2	4.700	SUMMER	32166	3RS ET	Р
27-Jun-19	NWL	3	58.800	SUMMER	32166	3RS ET	Р
27-Jun-19	NWL	2	2.200	SUMMER	32166	3RS ET	S
27-Jun-19	NWL	3	9.600	SUMMER	32166	3RS ET	S
8-Jul-19	NEL	2	6.410	SUMMER	32166	3RS ET	Р
8-Jul-19	NEL	3	27.530	SUMMER	32166	3RS ET	Р
8-Jul-19	NEL	4	3.400	SUMMER	32166	3RS ET	Р
8-Jul-19	NEL	2	2.960	SUMMER	32166	3RS ET	S
8-Jul-19	NEL	3	7.500	SUMMER	32166	3RS ET	S
9-Jul-19	NEL	2	4.100	SUMMER	32166	3RS ET	Р
9-Jul-19	NEL	3	26.300	SUMMER	32166	3RS ET	Р
9-Jul-19	NEL	4	6.700	SUMMER	32166	3RS ET	Р

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
9-Jul-19	NEL	2	2.000	SUMMER	32166	3RS ET	S
9-Jul-19	NEL	3	7.500	SUMMER	32166	3RS ET	S
9-Jul-19	NEL	4	0.900	SUMMER	32166	3RS ET	S
16-Jul-19	AW	1	4.980	SUMMER	32166	3RS ET	Р
16-Jul-19	WL	1	5.410	SUMMER	32166	3RS ET	Р
16-Jul-19	WL	2	5.206	SUMMER	32166	3RS ET	Р
16-Jul-19	WL	3	7.009	SUMMER	32166	3RS ET	Р
16-Jul-19	WL	4	1.137	SUMMER	32166	3RS ET	Р
16-Jul-19	WL	1	1.570	SUMMER	32166	3RS ET	S
16-Jul-19	WL	2	2.237	SUMMER	32166	3RS ET	S
16-Jul-19	WL	3	4.340	SUMMER	32166	3RS ET	S
16-Jul-19	WL	4	0.223	SUMMER	32166	3RS ET	S
17-Jul-19	SWL	2	39.559	SUMMER	32166	3RS ET	Р
17-Jul-19	SWL	3	11.290	SUMMER	32166	3RS ET	Р
17-Jul-19	SWL	1	0.930	SUMMER	32166	3RS ET	S
17-Jul-19	SWL	2	10.694	SUMMER	32166	3RS ET	S
17-Jul-19	SWL	3	4.140	SUMMER	32166	3RS ET	S
18-Jul-19	SWL	1	1.882	SUMMER	32166	3RS ET	Р
18-Jul-19	SWL	2	40.279	SUMMER	32166	3RS ET	Р
18-Jul-19	SWL	3	13.740	SUMMER	32166	3RS ET	Р
18-Jul-19	SWL	1	0.398	SUMMER	32166	3RS ET	S
18-Jul-19	SWL	2	10.003	SUMMER	32166	3RS ET	S
18-Jul-19	SWL	3	3.490	SUMMER	32166	3RS ET	S
22-Jul-19	NWL	1	8.700	SUMMER	32166	3RS ET	Р
22-Jul-19	NWL	2	53.140	SUMMER	32166	3RS ET	Р
22-Jul-19	NWL	3	0.800	SUMMER	32166	3RS ET	Р
22-Jul-19	NWL	1	1.100	SUMMER	32166	3RS ET	S
22-Jul-19	NWL	2	9.860	SUMMER	32166	3RS ET	S
23-Jul-19	AW	2	4.840	SUMMER	32166	3RS ET	Р
23-Jul-19	WL	2	14.693	SUMMER	32166	3RS ET	Р
23-Jul-19	WL	3	3.892	SUMMER	32166	3RS ET	Р
23-Jul-19	WL	2	5.815	SUMMER	32166	3RS ET	S
23-Jul-19	WL	3	3.119	SUMMER	32166	3RS ET	S
24-Jul-19	NWL	2	38.660	SUMMER	32166	3RS ET	Р
24-Jul-19	NWL	3	23.760	SUMMER	32166	3RS ET	Р
24-Jul-19	NWL	2	6.300	SUMMER	32166	3RS ET	S
24-Jul-19	NWL	3	5.780	SUMMER	32166	3RS ET	S
7-Aug-19	SWL	2	24.140	SUMMER	32166	3RS ET	Р
7-Aug-19	SWL	3	29.880	SUMMER	32166	3RS ET	Р
7-Aug-19	SWL	2	6.300	SUMMER	32166	3RS ET	S
7-Aug-19	SWL	3	9.480	SUMMER	32166	3RS ET	S
8-Aug-19	AW	2	4.820	SUMMER	32166	3RS ET	Р
8-Aug-19	WL	2	17.412	SUMMER	32166	3RS ET	Р
8-Aug-19	WL	3	1.230	SUMMER	32166	3RS ET	Р
8-Aug-19	WL	2	6.241	SUMMER	32166	3RS ET	S
8-Aug-19	WL	3	1.330	SUMMER	32166	3RS ET	S
12-Aug-19	NWL	2	3.080	SUMMER	32166	3RS ET	Р
12-Aug-19	NWL	3	49.260	SUMMER	32166	3RS ET	Р
12-Aug-19	NWL	4	9.700	SUMMER	32166	3RS ET	Р

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
12-Aug-19	NWL	2	1.240	SUMMER	32166	3RS ET	S
12-Aug-19	NWL	3	9.320	SUMMER	32166	3RS ET	S
12-Aug-19	NWL	4	1.400	SUMMER	32166	3RS ET	S
13-Aug-19	NEL	2	32.600	SUMMER	32166	3RS ET	Р
13-Aug-19	NEL	3	4.800	SUMMER	32166	3RS ET	Р
13-Aug-19	NEL	2	7.900	SUMMER	32166	3RS ET	S
13-Aug-19	NEL	3	2.300	SUMMER	32166	3RS ET	S
16-Aug-19	NEL	2	18.650	SUMMER	32166	3RS ET	Р
16-Aug-19	NEL	3	18.620	SUMMER	32166	3RS ET	Р
16-Aug-19	NEL	2	8.230	SUMMER	32166	3RS ET	S
16-Aug-19	NEL	3	2.000	SUMMER	32166	3RS ET	S
21-Aug-19	AW	2	1.850	SUMMER	32166	3RS ET	Р
21-Aug-19	AW	3	2.850	SUMMER	32166	3RS ET	Р
21-Aug-19	WL	2	19.158	SUMMER	32166	3RS ET	Р
21-Aug-19	WL	3	1.440	SUMMER	32166	3RS ET	Р
21-Aug-19	WL	2	10.752	SUMMER	32166	3RS ET	S
22-Aug-19	SWL	2	54.700	SUMMER	32166	3RS ET	Р
22-Aug-19	SWL	2	16.000	SUMMER	32166	3RS ET	S
26-Aug-19	NWL	2	14.600	SUMMER	32166	3RS ET	Р
26-Aug-19	NWL	3	38.000	SUMMER	32166	3RS ET	Р
26-Aug-19	NWL	4	10.340	SUMMER	32166	3RS ET	Р
26-Aug-19	NWL	2	2.000	SUMMER	32166	3RS ET	S
26-Aug-19	NWL	3	10.060	SUMMER	32166	3RS ET	S

Notes: CWD monitoring survey data of the two preceding survey months (i.e. June and July 2019) are presented for reference only.

#### **CWD Small Vessel Line-transect Survey**

#### **Sighting Data**

DATE	STG#	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
6-Jun-19	1	1052	CWD	3	WL	3	325	ON	3RS ET	22.2518	113.8337	SUMMER	NONE	S
6-Jun-19	2	1123	CWD	6	WL	2	214	ON	3RS ET	22.2445	113.8496	SUMMER	NONE	S
6-Jun-19	3	1221	CWD	2	WL	2	82	ON	3RS ET	22.2144	113.8319	SUMMER	NONE	Р
18-Jun-19	1	1134	CWD	1	SWL	2	22	ON	3RS ET	22.2055	113.9224	SUMMER	NONE	S
18-Jun-19	2	1406	CWD	3	SWL	2	89	ON	3RS ET	22.2096	113.8827	SUMMER	NONE	S
18-Jun-19	3	1505	CWD	4	SWL	2	348	ON	3RS ET	22.1764	113.8690	SUMMER	NONE	Р
18-Jun-19	4	1603	CWD	1	SWL	2	70	ON	3RS ET	22.1866	113.8494	SUMMER	NONE	Р
18-Jun-19	5	1609	CWD	4	SWL	2	225	ON	3RS ET	22.1892	113.8496	SUMMER	PURSE SEINER	Р
19-Jun-19	1	1131	CWD	5	NWL	2	70	ON	3RS ET	22.3867	113.8780	SUMMER	NONE	Р
19-Jun-19	2	1323	CWD	1	NWL	3	119	ON	3RS ET	22.3999	113.8974	SUMMER	NONE	Р
26-Jun-19	1	1052	CWD	7	WL	2	117	ON	3RS ET	22.2231	113.8350	SUMMER	NONE	Р
26-Jun-19	2	1211	CWD	3	WL	3	664	ON	3RS ET	22.2054	113.8309	SUMMER	NONE	Р
16-Jul-19	1	1034	CWD	5	WL	1	134	ON	3RS ET	22.2665	113.8595	SUMMER	NONE	S
16-Jul-19	2	1123	CWD	1	WL	3	40	ON	3RS ET	22.2411	113.8416	SUMMER	NONE	Р
16-Jul-19	3	1133	CWD	2	WL	3	73	ON	3RS ET	22.2412	113.8312	SUMMER	NONE	Р
16-Jul-19	4	1159	CWD	5	WL	2	54	ON	3RS ET	22.2277	113.8378	SUMMER	NONE	S
16-Jul-19	5	1229	CWD	11	WL	3	473	ON	3RS ET	22.2137	113.8294	SUMMER	NONE	Р
16-Jul-19	6	1313	CWD	3	WL	3	114	ON	3RS ET	22.1953	113.8420	SUMMER	NONE	Р
17-Jul-19	1	1123	CWD	1	SWL	2	565	ON	3RS ET	22.1952	113.9279	SUMMER	NONE	Р
17-Jul-19	2	1148	CWD	6	SWL	2	41	ON	3RS ET	22.2008	113.9183	SUMMER	NONE	Р
17-Jul-19	3	1244	CWD	4	SWL	2	289	ON	3RS ET	22.1714	113.9086	SUMMER	NONE	Р
17-Jul-19	4	1258	CWD	10	SWL	2	24	ON	3RS ET	22.1751	113.9078	SUMMER	NONE	Р
17-Jul-19	5	1326	CWD	4	SWL	2	371	ON	3RS ET	22.1927	113.9082	SUMMER	NONE	S
17-Jul-19	6	1339	CWD	3	SWL	2	143	ON	3RS ET	22.1977	113.9078	SUMMER	NONE	Р
17-Jul-19	7	1355	CWD	1	SWL	2	35	ON	3RS ET	22.2089	113.8973	SUMMER	NONE	Р
17-Jul-19	8	1446	CWD	5	SWL	2	88	ON	3RS ET	22.1830	113.8885	SUMMER	NONE	Р
17-Jul-19	9	1519	CWD	2	SWL	3	23	ON	3RS ET	22.1913	113.8780	SUMMER	NONE	Р
17-Jul-19	10	1552	CWD	6	SWL	3	97	ON	3RS ET	22.1784	113.8689	SUMMER	NONE	Р
17-Jul-19	11	1645	CWD	3	SWL	3	233	ON	3RS ET	22.1922	113.8494	SUMMER	NONE	Р
18-Jul-19	1	1220	CWD	8	SWL	2	435	ON	3RS ET	22.1798	113.9042	SUMMER	NONE	S
18-Jul-19	2	1238	CWD	3	SWL	2	16	ON	3RS ET	22.1894	113.9066	SUMMER	NONE	S
18-Jul-19	3	1315	CWD	11	SWL	2	24	ON	3RS ET	22.1780	113.8975	SUMMER	NONE	Р

DATE	STG#	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
18-Jul-19	4	1409	CWD	9	SWL	2	403	ON	3RS ET	22.2013	113.8871	SUMMER	NONE	Р
18-Jul-19	5	1514	CWD	2	SWL	2	31	ON	3RS ET	22.1785	113.8690	SUMMER	NONE	Р
18-Jul-19	6	1527	CWD	2	SWL	2	68	ON	3RS ET	22.1850	113.8690	SUMMER	NONE	Р
18-Jul-19	7	1542	CWD	1	SWL	2	462	ON	3RS ET	22.1978	113.8685	SUMMER	NONE	Р
22-Jul-19	1	1035	CWD	1	NWL	2	131	ON	3RS ET	22.2771	113.8704	SUMMER	NONE	Р
23-Jul-19	1	1031	CWD	7	WL	2	142	ON	3RS ET	22.2606	113.8539	SUMMER	NONE	Р
23-Jul-19	2	1111	CWD	1	WL	2	85	ON	3RS ET	22.2447	113.8497	SUMMER	NONE	S
23-Jul-19	3	1126	CWD	4	WL	2	77	ON	3RS ET	22.2418	113.8423	SUMMER	NONE	Р
23-Jul-19	4	1153	CWD	3	WL	2	1245	ON	3RS ET	22.2357	113.8252	SUMMER	NONE	S
23-Jul-19	5	1203	CWD	3	WL	2	107	ON	3RS ET	22.2325	113.8330	SUMMER	NONE	Р
23-Jul-19	6	1230	CWD	3	WL	3	20	ON	3RS ET	22.2145	113.8282	SUMMER	NONE	Р
23-Jul-19	7	1305	CWD	5	WL	2	123	ON	3RS ET	22.1962	113.8392	SUMMER	NONE	Р
24-Jul-19	1	1129	CWD	2	NWL	2	217	ON	3RS ET	22.3800	113.8764	SUMMER	NONE	Р
7-Aug-19	1	1500	CWD	2	SWL	2	511	ON	3RS ET	22.1883	113.8491	SUMMER	NONE	Р
8-Aug-19	1	1029	CWD	10	WL	2	78	ON	3RS ET	22.2668	113.8594	SUMMER	NONE	S
8-Aug-19	2	1052	CWD	5	WL	2	272	ON	3RS ET	22.2600	113.8430	SUMMER	NONE	Р
8-Aug-19	3	1120	CWD	1	WL	2	611	ON	3RS ET	22.2434	113.8488	SUMMER	NONE	S
8-Aug-19	4	1127	CWD	8	WL	2	836	ON	3RS ET	22.2415	113.8435	SUMMER	NONE	Р
8-Aug-19	5	1211	CWD	2	WL	2	48	ON	3RS ET	22.2290	113.8379	SUMMER	NONE	S
8-Aug-19	6	1230	CWD	5	WL	2	413	ON	3RS ET	22.2136	113.8254	SUMMER	NONE	Р
8-Aug-19	7	1250	CWD	6	WL	2	140	ON	3RS ET	22.2143	113.8344	SUMMER	NONE	Р
8-Aug-19	8	1328	CWD	1	WL	2	333	ON	3RS ET	22.1890	113.8422	SUMMER	NONE	S
12-Aug-19	1	1051	CWD	1	NWL	3	472	ON	3RS ET	22.2794	113.8696	SUMMER	NONE	Р
21-Aug-19	1	1039	CWD	3	WL	2	126	ON	3RS ET	22.2604	113.8523	SUMMER	NONE	Р
21-Aug-19	2	1137	CWD	10	WL	2	501	ON	3RS ET	22.2340	113.8244	SUMMER	NONE	S
21-Aug-19	3	1203	CWD	5	WL	2	186	ON	3RS ET	22.2231	113.8360	SUMMER	NONE	Р
21-Aug-19	4	1231	CWD	1	WL	2	21	ON	3RS ET	22.2144	113.8344	SUMMER	NONE	Р
21-Aug-19	5	1251	CWD	7	WL	2	13	ON	3RS ET	22.2145	113.8355	SUMMER	NONE	Р
21-Aug-19	6	1310	CWD	2	WL	2	162	ON	3RS ET	22.2057	113.8251	SUMMER	NONE	Р
22-Aug-19	1	1106	FP	2	SWL	2	119	ON	3RS ET	22.1563	113.9277	SUMMER	NONE	Р
22-Aug-19	2	1511	CWD	2	SWL	2	94	ON	3RS ET	22.1942	113.8492	SUMMER	NONE	Р

Abbreviations: STG# = Sighting Number; GP SZ = Group Size; BEAU = Beaufort Sea State; PSD = Perpendicular Distance (in metres); N/A = Not Applicable; DEC LAT = Latitude (WGS84 in Decimal), DEC LON = Longitude (WGS84 in Decimal); BOAT ASSOC. = Fishing Boat Association; P/S = Primary Transect / Secondary Transect

Notes:

CWD monitoring survey data of the two preceding survey months (i.e. June 2019 and July 2019) are presented for reference only. No relevant figure or text will be mentioned in this monthly EM&A report.

Sighting data of finless porpoise (FP) are presented for reference only. No relevant figure or text will be mentioned in the monthly EM&A report. All FP sightings are excluded in calculation.

Calculation of the August 2019 encounter rates STG and ANI in the whole survey area (NEL, NWL, AW, WL, SWL):

A total of 430.243 km of survey effort was collected under Beaufort Sea State 3 or below with favourable visibility; total no. of 17 on-effort sightings and total number of 71 dolphins from on-effort sightings were collected under such condition. Calculation of the encounter rates in August 2019 are shown as below:

Encounter Rate by Number of Dolphin Sightings (STG) in August 2019

$$STG = \frac{17}{430.243} \times 100 = 3.95$$

Encounter Rate by Number of Dolphins (ANI) in August 2019

$$ANI = \frac{71}{430.243} \times 100 = 16.50$$

Calculation of the running quarterly STG and ANI in the whole survey area (NEL, NWL, AW, WL, SWL):

A total of 1259.561 km of survey effort was collected under Beaufort Sea State 3 or below with favourable visibility; total no. of 62 on-effort sightings and total number of 248 dolphins from on-effort sightings were collected under such condition. Calculation of the running quarterly encounter rates are shown as below:

Running Quarterly Encounter Rate by Number of Dolphin Sightings (STG)


$$STG = \frac{62}{1259561} \times 100 = 4.92$$


Running Quarterly Encounter Rate by Number of Dolphins (ANI)


$$ANI = \frac{248}{1259.561} \times 100 = 19.69$$


#### **CWD Small Vessel Line-transect Survey**


#### **Photo Identification**

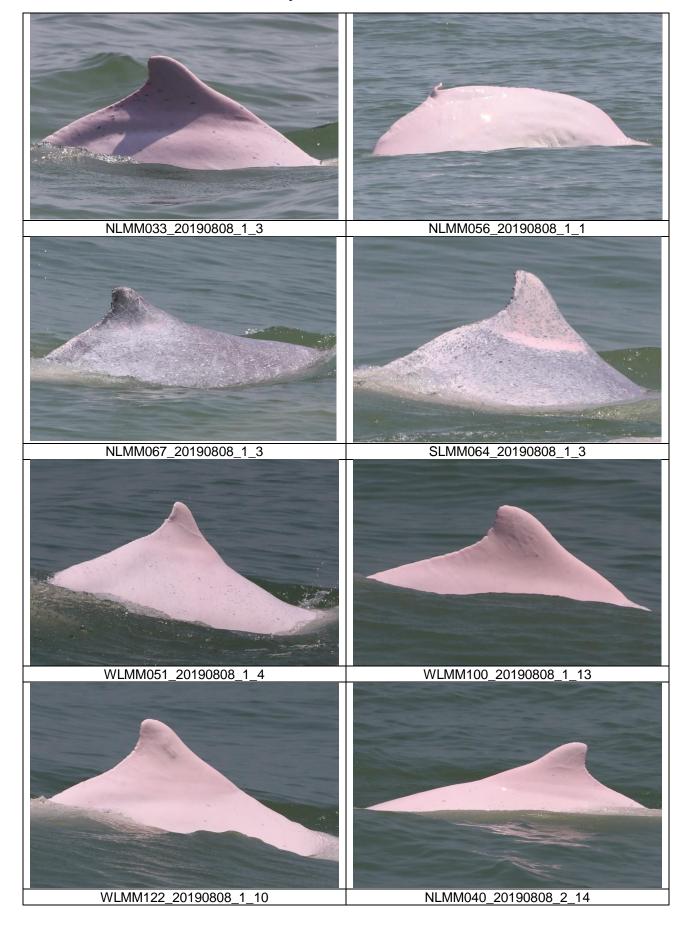

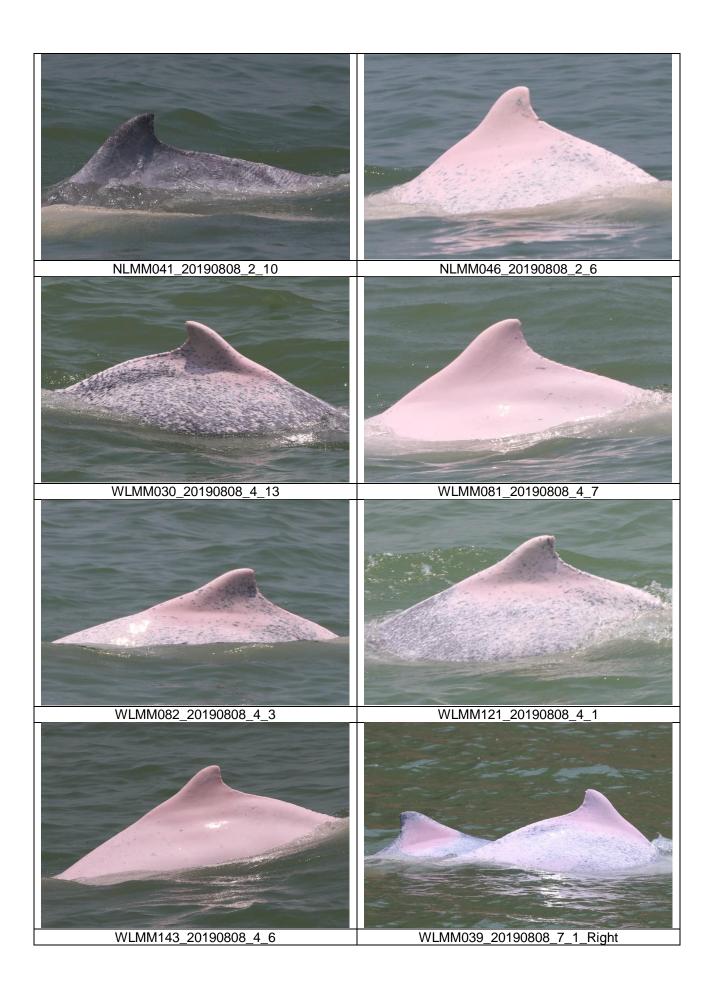

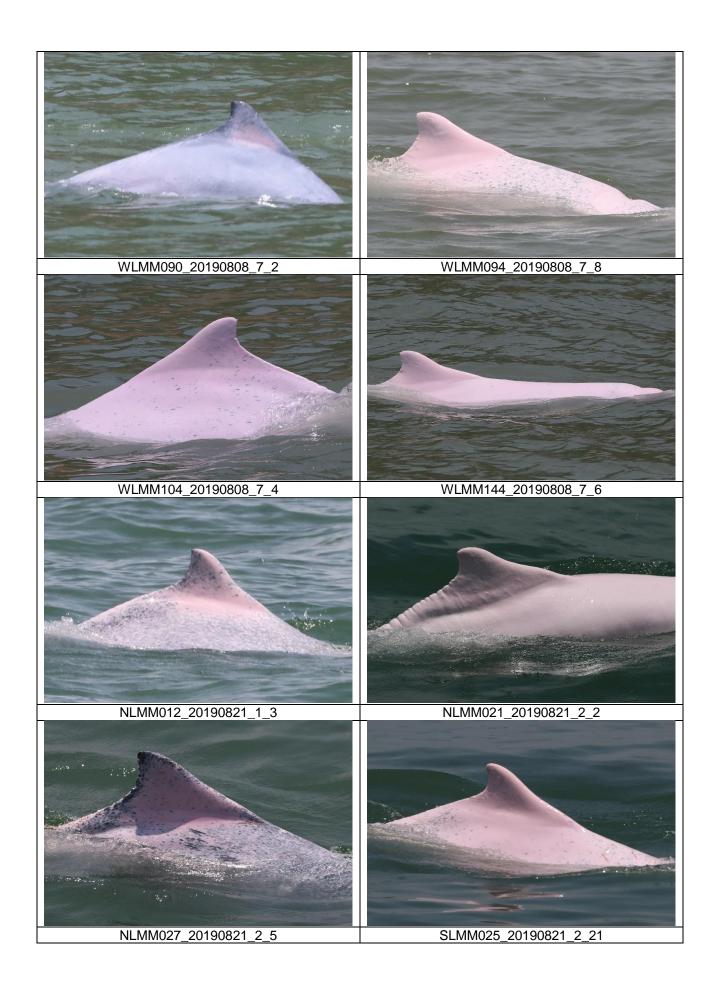

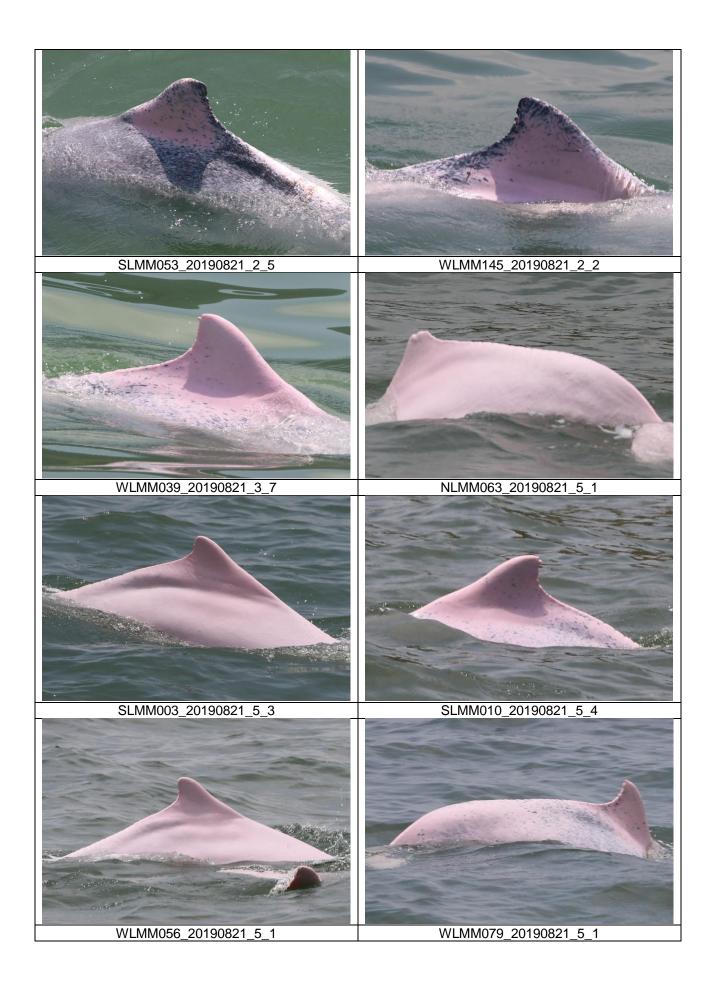

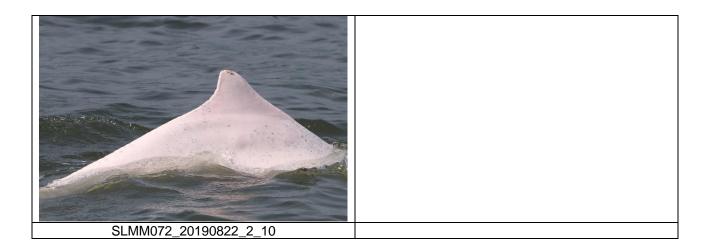

#### **CWD Land-based Theodolite Tracking Survey**

#### **CWD Groups by Survey Date**

Date	Station	Start Time	End Time	Duration	Beaufort Range	Visibility	No. of Focal Follow Dolphin Groups Tracked	Dolphin Group Size Range	
15/Aug/19	Lung Kwu Chau	8:55	14:55	6:00	2-3	1-2	2	1-3	
22/Aug/19	Lung Kwu Chau	8:50	14:50	6:00	2	2	3	1	
27/Aug/19	Sha Chau	9:10	15:10	6:00	2-3	1-2	0	-	

Visibility: 1=Excellent, 2=Good, 3=Fair, 4=Poor

### **Appendix D. Calibration Certificates**



Tel: (852) 3956 8717; Fax: (852) 3956 3928

#### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

AI080036

Date of Issue

06 Aug, 2019

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd.

Flat 2207, Yu Fun House,

Yu Chui Court, Shatin

New Territories, Hong Kong

Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI 6920V2 (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

Date of Received

17H105557

Date of Calibration

Aug 02, 2019

Aug 02, 2019

Date of Next Calibration(a)

Nov 02, 2019

#### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter

Reference Method

pH at 25°C Dissolved Oxygen APHA 21e 4500-H+ B APHA 21e 4500-O G

Conductivity at 25°C

APHA 21e 2510 B

Salinity

APHA 21e 2520 B

Turbidity Temperature APHA 21e 2130 B Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

#### PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	3.98	-0.02	Satisfactory
7.42	7.40	-0.02	Satisfactory
10.01	10.01	0.00	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
11.5	11.3	-0.2	Satisfactory
26.0	25.9	-0.1	Satisfactory
51.5	52.0	0.5	Satisfactory

Tolerance limit of temperature should be less than  $\pm 2.0$  (°C)

#### ~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

The results relate only to the calibrated equipment as received

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

"Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is referenced to YSI product specifications.

LEE Chun-ning, Desmond Senior Chemist



#### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

AI080036

Date of Issue

06 Aug, 2019

Page No.

2 of 2

#### PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.01	0.27	0.26	Satisfactory
1.68	1.75	0.07	Satisfactory
4.52	4.81	0.29	Satisfactory
7.84	8.00	0.16	Satisfactory

Tolerance limit of dissolved oxygen should be less than ±0.50 (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	152.6	3.9	Satisfactory
0.01	1412	1389	-1.6	Satisfactory
0.1	12890	12452	-3.4	Satisfactory
0.5	58670	58588	-0.1	Satisfactory
1.0	111900	111882	0.0	Satisfactory

Tolerance limit of conductivity should be less than ±10.0 (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	10.08	0.8	Satisfactory
20	20.35	1.8	Satisfactory
30	30.00	0.0	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.00		Satisfactory
10	10.03	0.3	Satisfactory
20	20.11	0.5	Satisfactory
100	100.07	0.1	Satisfactory
800	800.35	0.0	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

Remark(s): -

relevant international standards.

<sup>© &</sup>quot;Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.
© The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form



#### 專業化驗有限公司 **QUALITY PRO TEST-CONSULT LIMITED**

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

#### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

AI080035

Date of Issue

06 Aug, 2019

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd. Flat 2207, Yu Fun House, Yu Chui Court, Shatin New Territories, Hong Kong Attn: Mr. Thomas WONG

#### PART B - DESCRIPTION

Name of Equipment

YSI 6920V2 (Multi-Parameters)

Manufacturer

YSI (a xylem brand)

Serial Number

18A104824

Aug 02, 2019

Date of Received

Date of Calibration

Aug 02, 2019

Date of Next Calibration(a)

Nov 02, 2019

#### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

<u>Parameter</u>

Reference Method

pH at 25°C

APHA 21e 4500-H+ B APHA 21e 4500-O G

Dissolved Oxygen Conductivity at 25°C

APHA 21e 2510 B

Salinity

APHA 21e 2520 B

Turbidity

APHA 21e 2130 B

Temperature

Section 6 of international Accreditation New Zealand Technical

Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

#### PART D - CALIBRATION RESULTS(b,c)

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading(d) (pH Unit)	Tolerance(e)(pH Unit)	Results
4.00	4.01	0.01	Satisfactory
7.42	7.44	0.02	Satisfactory
10.01	10.00	-0.01	Satisfactory

Tolerance of pH should be less than ±0.20 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer	Displayed Reading (°C)	Tolerance (°C)	Results
11.5	11.4	-0.1	Satisfactory
26.0	25.9	-0.1	Satisfactory
51.5	52.0	0.5	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

#### ~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.

The results relate only to the calibrated equipment as received

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

"Displayed Reading" denotes the figure shown on item under calibration/checking regardless of equipment precision or significant figures.

The "Tolerance Limit" mentioned is referenced to YSI product specifications.

LEE Chun-ning, Desmond Senior Chemist



#### REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No.

AI080035

Date of Issue

06 Aug, 2019

Page No.

2 of 2

#### PART D - CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.01	0.26	0.25	Satisfactory
1.68	1.82	0.14	Satisfactory
4.52	4.83	0.21	Satisfactory
7.84	8.04	0.20	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.50$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)	Results
0.001	146.9	144.3	-1.8	Satisfactory
0.01	1412	1394	-1.3	Satisfactory
0.1	12890	12677	-1.7	Satisfactory
0.5	58670	58642	0.0	Satisfactory
1.0	111900	112012	0.1	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	10.06	0.6	Satisfactory
20	20.22	1.1	Satisfactory
30	30.17	0.6	Satisfactory

Tolerance limit of salinity should be less than ±10.0 (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.01	<u> </u>	Satisfactory
10	10.04	0.4	Satisfactory
20	20.09	0.4	Satisfactory
100	100.19	0.2	Satisfactory
800	801.44	0.2	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

Remark(s): -

<sup>(</sup>Displayed Reading) presents the figures shown on item under calibration/checking regardless of equipment precision or significant figures.

<sup>(8)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted form relevant international standards.



Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

#### CALIBRATION REPORT

Test Report No. : AG060168

Date of Issue

: Jun 27, 2019

Page No.

1 of 2

#### PART A - CUSTOMER INFORMATION

Enovative Environmental Service Ltd. Rm 811, Hin Pui House, Hin Keng Estate, Tai Wai New Territories, Hong Kong Attn: Mr. Thomas Wong

#### PART B - SAMPLE INFORMATION

Description of Samples

Titrette bottletop burette, 50ml

Brand Name

**BRAND** 

Model Number

1224B90

Serial Number

10N65665

Equipment Number

Date of Received

Jun 16, 2019

Date of Calibration Date of Next Calibration(a) Jun 19, 2019 Sep 19, 2019

#### PART C - CALIBRATION REQUESTED

#### **Parameter**

#### **Reference Method**

Accuracy Test

In-house Method (Gravimetric Method)

~ Continued On Next Page ~

Remark(s): -

APPROVED SIGNATORY:

CHAN Mei-wah Amy Assistant Lab. Manager

The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international



#### 業化驗有限公司

#### QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong Email: info@qualityprotest.com; Website: www.qualityprotest.com Tel: (852) 3956 8717; Fax: (852) 3956 3928

#### **CALIBRATION REPORT**

Test Report No.

: AG060168

Date of Issue

: Jun 27, 2019

Page No.

: 2 of 2

PART D - RESULT(b),(c)

Water temperature: 23.5 ℃

Relative humidity: 58%

z-Factor: 1.0036

	Nominal volume (mL) at interval							
	3	3	3	3	3			
Trial	Range: (1-4)	Range: (16-19)	Range: (23-26)	Range: (34-37)	Range: (42-45)			
1	2.9845	2.9774	2.9779	2.9887	2.9797			
2	2.9891	2.9842	2.9859	2.9826	2.9866			
3	2.9894	2.9745	2.9876	2.9882	2.9808			
4	2.9872	2.9882	2.9838	2.9819	2.9702			
5	2.9839	2.9825	2.9858	2.9875	2.9892			
6	2.9828	2.9886	2.9823	2.9898	2.9805			
7	2.9802	2.9845	2.9821	2.9906	2.9776			
8	2.9863	2.9833	2.9814	2.9841	2.9793			
9	2.9815	2.9909	2.9849	2.9811	2.9825			
10	2.9849	2.9808	2.9848	2.9898	2.9807			
Average	2.9850	2.9835	2.9837	2.9864	2.9807			
Standard deviation	0.0031	0.0051	0.0028	0.0036	0.0051			
Calculated volume (mL)	2.9957	2.9942	2.9944	2.9972	2.9914			
Error (%)	-0.1425	-0.1923	-0.1870	-0.0940	-0.2853			
RSD (%)	0.1022	0.1692	0.0935	0.1211	0.1702			

#### Acceptance Criteria (d)

Accuracy (%Error)	< ±1%	<±1%	<±1%	< ±1%	< ±1%
Precision (%RSD)	< 1%	< 1%	< 1%	< 1%	< 1%

~ END OF REPORT ~

Remark(s): 
(b) The results relate only to the tested sample as received

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "acceptance criteria" is applicable for similar equipment used by QPT or quoted form relevant international standards.

## **Appendix E. Status of Environmental Permits and Licences**

	Description	Permit/ Reference No.	Status	
EIAO	Environmental Permit	EP-489/2014	Approved on 7 Nov 2014	

Contract No.	Description	Location	Permit/ Reference No.	Status
P560 (R)	Notification of Construction Work	Site Office	397151	Receipt acknowledged by EPD on 15 Jan 2016
	under APCO	Stockpiling Area	398015	Receipt acknowledged by EPD on 18 Jan 2016
	Discharge License under WPCO	Stockpiling Area	WT00024250- 2016	Approved on 25 Apr 2016 to 30 Apr 2021
	Registration as Chemical Waste Producer	Stockpiling Area	WPN 5213-951- L2902-02	Registration was updated on 3 Oct 2016
	Bill Account for disposal		A/C 7023982	Approval granted from EPD on 14 Dec 2015
3201	Notification of Construction Work under APCO	Works area of 3201	406004	Receipt acknowledged by EPD on 10 Aug 2016
	Construction Noise Permit (General	Works area of 3201	GW-RS0130-19	Superseded by GW-RS0693-19 on 6 Aug 2019
	Works)		GW-RS0693-19	Valid until 5 Feb 2020
	Discharge License under WPCO	Works area of 3201	WT00032628- 2018	Valid from to 19 Dec 2018 to 31 Dec 2023
	Registration as Chemical Waste Producer	Works area of 3201	WPN 5213-951- P3231-01	Completion of Registration on 9 Sep 2016
	Bill Account for disposal		A/C 7025760	Approval granted from EPD on 31 Aug 2016
3205	Notification of Construction Work under APCO	Works area of 3205	409041	Receipt acknowledged by EPD on 19 Oct 2016
	Registration as Chemical Waste Producer	Works Area of 3205	WPN 5213-951- B2502-01	Registration was updated on 25 Sep 2017
		Works Area of 3205	WPN 5111-421- B2509-01	Registration was updated on 25 Sep 2017
	Construction Noise Permit (General Works)	Works Area of 3205	GW-RS0593-19	Valid until 07 Jan 2020
	Discharge License under WPCO	Works area of 3205	WT00028370- 2017	Valid from 21 Jun 2017 to 30 Jun 2022
	Bill Account for disposal	Works area of 3205	A/C 7026295	Approval granted from EPD on 9 Nov 2016
3206	Notification of Construction Work under APCO	Works area of 3206	409237	Receipt acknowledged by EPD on 25 Oct 2016
	Registration as Chemical Waste Producer	Site office of 3206	WPN 5213-951- Z4035-01	Completion of Registration on 18 Nov 2016

Contract No.	Description	Location	Permit/ Reference No.	Status
		Works area of 3206	WPN 5213-951- Z4035-02	Completion of Registration on 18 Nov 2016
	Construction Noise Permit (General	Works Area of 3206	GW-RS0650-19	Superseded by GW-RS0762-19 on 29 Aug 2019
	Works)		GW-RS0762-19	Valid until 20 Feb 2020
	Bill Account for disposal	Works area of 3206	A/C 7026398	Approval granted from EPD on 16 Nov 2016
3301	Notification of Construction Work under APCO	Works area of 3301	415821	Receipt acknowledged by EPD on 19 Apr 2017
	Registration as Chemical Waste Producer	Works area of 3301	WPN 5213-951- F2718-02	Completion of Registration on 9 Jun 2017
	Bill Account for disposal	Works area of 3301	A/C 7027728	Approval granted from EPD on 8 May 2017
	Construction Noise Permit (General Works)	Works area of 3301 (Cable ducting works)	GW-RS0266-19	Valid until 11 Oct 2019
		Works area of 3301	GW-RS0267-19	Valid until 11 Oct 2019
3302	Notification of Construction Work	Works area of 3302	440222	Receipt acknowledged by EPD on 10 Dec 2018
	under APCO	Staging area of 3302	2018CES1	Receipt acknowledged by EPD on 21 Dec 2018
	Registration as Chemical Waste Producer	Works area of 3302	5296-951-C4331- 01	Completion of Registration on 4 Jan 2019
	Bill Account for disposal	Works area of 3302	A/C 7032881	Approval granted from EPD on 8 Jan 2019
	Construction Noise Permit (General Works)	Works area of 3302	GW-RS0595-19	Valid until 6 Jan 2020
	Construction Noise Permit (Percussive Piling)	Works area of 3302	PP-RS0011-19	Valid until 31 Jan 2020
3303	Notification of Construction Work under APCO	Works area of 3303	445611	Receipt acknowledged by EPD on 27 May 2019
	Registration as Chemical Waste Producer	Works area of 3303	5213-951-S4174- 01	Completion of Registration on 17 Jun 2019
	Bill Account for disposal	Works area of 3303	A/C 7034272	Approval granted from EPD on 10 Jun 2019
	Construction Noise Permit (General	Works area of 3303	GW-RS0692-19	Superseded by GW-RS0764-19 on 29 Aug 2019
	Works)		GW-RS0764-19	Valid until 28 Feb 2020
3402	Notification of Construction Work	Works area of 3402	440808	Receipt acknowledged by EPD on 31 Dec 2018
	under APCO	Stockpiling area of 3402	441960	Receipt acknowledged by EPD on 8 Feb 2019
	Registration as Chemical Waste Producer	Works area of 3402	WPN 5213-951- W1172-05	Registration was updated on 25 Feb 2019
	Discharge License under WPCO	Works area of 3402	WT00033685- 2019	Valid from 20 Jun 2019 to 30 Jun 2024

Contract No.	Description	Location	Permit/ Reference No.	Status
	Bill Account for disposal	Works area of 3402	A/C 7032577	Approval granted from EPD on 27 Nov 2018
	Construction Noise Permit (General Works)	Works area of 3402	GW-RS0207-19	Valid until 14 Aug 2019
		Works area of 3402	GW-RS0720-19	Valid from 15 Aug 2019 to 14 Jan 2020
3501	Notification of Construction Work under APCO	Works area of 3501	434640	Receipt acknowledged by EPD on 13 Jun 2018
	Registration as Chemical Waste Producer	Works area of 3501	WPN 5213-951- B2520-02	Completion of Registration on 25 Jul 2017
	Discharge License under WPCO	Works area of 3501	WT00031400- 2018	Valid from 30 Aug 2018 to 31 Aug 2023
	Bill Account for disposal	Works area of 3501	A/C 7028144	Approval granted from EPD on 23 Jun 2017
	Construction Noise Permit (General Works)	Works area of 3501	GW-RS0184-19	Valid until 4 Sep 2019
3502	Notification of Construction Work under APCO	Works area of 3502	437766	Receipt acknowledged by EPD on 26 Sep 2018
	Registration as Chemical Waste Producer	Works area of 3502	WPN 5213-951- B2520-01	Completion of Registration on 3 Jul 2017
	Bill Account for disposal	Works area of 3502	A/C 7028050	Approval granted from EPD on 21 Jun 2017
	Construction Noise Permit (General Works)	Works area of 3502	GW-RS0191-19	Valid until 10 Sep 2019
3503	Notification of Construction Work	Works area of 3503	435180	Receipt acknowledged by EPD on 29 Jun 2018
	under APCO	Stockpiling area of 3503	439777	Receipt acknowledged by EPD on 26 Nov 2018
	Registration as Chemical Waste Producer	Works area of 3503	WPN 5113-951- L2845-02	Completion of Registration on 8 Jan 2018
	Discharge License under WPCO	Works area of 3503	WT00031258- 2018	Valid from 7 Jun 2018 to 30 Jun 2023
		Stockpiling area of 3503	WT00031826- 2018	Valid from 18 Sep 2018 to 30 Sep 2023
	Bill Account for disposal	Works area of 3503	A/C 7029665	Approval granted from EPD on 27 Dec 2017
	Construction Noise Permit (General Works)	Works area of 3503	GW-RS0592-19	Valid until 4 Jan 2020
	rrome,	Stockpiling area of 3503	GW-RS0407-19	Valid until 13 Nov 2019
3602	Notification of Construction Work under APCO	Works area of 3602	421278	Receipt acknowledged by EPD on 18 Sep 2017
	Registration as Chemical Waste	Works area of 3602	WPN 5296-951- N2673-01	Completion of Registration on 9 Oct 2017
	Producer	Site office of 3602	WPN 5296-951- N2673-02	Completion of Registration on 11 Dec 2017

Contract No.	Description	Location	Permit/ Reference No.	Status
	Bill Account for disposal	Works area of 3602	A/C 7028942	Approval granted from EPD on 6 Oct 2017
	Construction Noise Permit (General Works)	Works area of 3602	GW-RS0641-19	Valid until 31 Dec 2019
3603	Notification of Construction Work under APCO	Site office of 3603	433604	Receipt acknowledged by EPD on 16 May 2018
	Registration as Chemical Waste Producer	Works area of 3603	WPN 5296-951- S4069-01	Completion of Registration on 22 Jan 2018
	Bill Account for disposal	Works area of 3603	A/C 7030002	Approval granted from EPD on 1 Feb 2018
	Construction Noise Permit (General Works)	Works area of 3603	GW-RS0313-19	Valid until 25 Oct 2019
3801	Notification of Construction Work	Works area of 3801	418345	Receipt acknowledged by EPD on 26 Jun 2017
	under APCO		430372	Receipt acknowledged by EPD on 2 Feb 2018
			435652	Receipt acknowledged by EPD on 16 Jul 2018
	Registration as Chemical Waste Producer	Works area of 3801	WPN 5296-951- C1169-53	Completion of Registration on 14 Aug 2018
	Discharge License under WPCO	Works and stockpiling area of 3801	WT00029535- 2017	Valid from 24 Nov 2017 to 30 Nov 2022
	Bill Account for disposal	Works area of 3801	A/C 7028254	Approval granted from EPD on 3 Jul 2017
	Construction Noise Permit (General Works)	Works and stockpiling area of 3801	GW-RS0662-19	Valid until 24 Jan 2020
		Works area of 3801 (Drill and grouting works)	GW-RS0556-19	Valid until 26 Sep 2019

# Appendix F. Cumulative Statistics on Exceedances, Environmental Complaints, Notification of Summons and Status of Prosecution

#### Statistics for Exceedances for 1-hour TSP, Noise, Water, Waste, CWD Monitoring

		Total no. recorded in the reporting period	Total no. recorded since the project commenced
1-hr TSP	Action	0	0
	Limit	0	0
Noise	Action	0	0
	Limit	0	0
Water	Action	0	0
	Limit	0	0
Waste	Action	0	0
	Limit	0	0
CWD	Action	0	0
	Limit	0	0

Remark: Exceedances, which are not project related, are not shown in this table.

#### Statistics for Complaints, Notifications of Summons and Prosecution

Reporting Period	Cumulative Statistics					
	Complaints	Notifications of Summons	Prosecutions			
This reporting period	0	0	0			
From 28 December 2015 to end of the reporting period	17	1	1			

## Appendix G. Data of SkyPier HSF Movements to/from Zhuhai and Macau (between 1 and 31 August 2019)

### <u>Data of SkyPier HSF Movements to/from Zhuhai and Macau (between 1 and 31 August 2019)</u>

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
1-Aug	8:59	3A061	YFT	Arrival	11.5	-	-
1-Aug	10:07	8S212	XZM	Arrival	11.4	-	-
1-Aug	11:03	3A063	YFT	Arrival	11.7	-	-
1-Aug	11:04	8S121	XZM	Departure	11.8	-	-
1-Aug	12:40	8S215	XZM	Arrival	12.3	-	-
1-Aug	13:04	3A064	YFT	Arrival	12.7	-	-
1-Aug	14:19	3A164	YFT	Departure	11.3	-	-
1-Aug	14:59	3A065	YFT	Arrival	12	-	-
1-Aug	16:18	3A167	YFT	Departure	12.7	-	-
1-Aug	17:05	3A067	YFT	Arrival	11.7	-	-
1-Aug	18:14	8S126	XZM	Departure	13.1	-	-
1-Aug	20:28	3A084	ZUI	Arrival	12.1	-	-
1-Aug	20:54	8S2113	XZM	Arrival	12.7	-	-
1-Aug	21:07	3A185	ZUI	Departure	12.4	-	-
2-Aug	8:56	3A061	YFT	Arrival	12.6	-	-
2-Aug	9:57	3A081	ZUI	Arrival	11.8	-	-
2-Aug	10:20	3A181	ZUI	Departure	11.5	-	-
2-Aug	10:21	8S212	XZM	Arrival	12.5	-	-
2-Aug	11:06	8S121	XZM	Departure	13.4	-	-
2-Aug	11:10	3A063	YFT	Arrival	12	-	-
2-Aug	12:59	3A064	YFT	Arrival	11.6	-	-
2-Aug	13:20	8S215	XZM	Arrival	11.5	-	-
2-Aug	13:48	3A082	ZUI	Arrival	11.9	-	-
2-Aug	14:14	3A182	ZUI	Departure	11.8	-	-
2-Aug	14:15	3A164	YFT	Departure	12.4	-	-
2-Aug	14:56	3A065	YFT	Arrival	13.4	-	-
2-Aug	16:21	3A167	YFT	Departure	12.3	-	-
2-Aug	17:00	3A083	ZUI	Arrival	12.7	<= 5	< 4min
2-Aug	17:02	3A067	YFT	Arrival	11.8	-	-
2-Aug	17:21	3A183	ZUI	Departure	11.2	-	-
2-Aug	18:04	8S126	XZM	Departure	11.9	-	-
2-Aug	20:39	3A084	ZUI	Arrival	11.7	-	-
2-Aug	20:54	3A185	ZUI	Departure	13.6	-	-
2-Aug	21:03	8S2113	XZM	Arrival	11.1	-	-
3-Aug	8:57	3A061	YFT	Arrival	12.3	-	-
3-Aug	10:00	3A081	ZUI	Arrival	12.1	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM - Macao (Maritime Ferry Terminal) YFT - Macao (Taipa)  ZUI - Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
3-Aug	10:19	8S212	XZM	Arrival	12.6	-	-
3-Aug	10:30	3A181	ZUI	Departure	12.7	-	-
3-Aug	11:05	3A063	YFT	Arrival	11.6	-	-
3-Aug	11:11	8S121	XZM	Departure	12.2	-	-
3-Aug	12:44	8S215	XZM	Arrival	12.1	-	-
3-Aug	12:57	3A064	YFT	Arrival	12.4	-	-
3-Aug	14:01	3A082	ZUI	Arrival	13.3	-	-
3-Aug	14:16	3A164	YFT	Departure	12.4	-	-
3-Aug	14:20	3A182	ZUI	Departure	11.9	-	-
3-Aug	15:05	3A065	YFT	Arrival	12.4	-	-
3-Aug	16:14	3A167	YFT	Departure	10.9	-	-
3-Aug	16:56	3A067	YFT	Arrival	12.5	-	-
3-Aug	17:08	3A083	ZUI	Arrival	11.6	-	-
3-Aug	17:26	3A183	ZUI	Departure	11.6	-	-
3-Aug	18:00	8S126	XZM	Departure	12.7	-	-
3-Aug	20:42	3A084	ZUI	Arrival	11.8	-	-
3-Aug	20:53	8S2113	XZM	Arrival	11	-	-
3-Aug	20:56	3A185	ZUI	Departure	13.4	-	-
4-Aug	8:57	3A061	YFT	Arrival	11.5	-	-
4-Aug	9:58	3A081	ZUI	Arrival	12.2	-	-
4-Aug	10:11	8S212	XZM	Arrival	12	-	-
4-Aug	10:28	3A181	ZUI	Departure	13.3	-	-
4-Aug	10:55	3A063	YFT	Arrival	12.9	-	-
4-Aug	11:06	8S121	XZM	Departure	12.2	-	-
4-Aug	12:39	8S215	XZM	Arrival	12.5	-	-
4-Aug	12:54	3A064	YFT	Arrival	12.4	-	-
4-Aug	14:02	3A082	ZUI	Arrival	13.1	-	-
4-Aug	14:21	3A182	ZUI	Departure	12.7	-	-
4-Aug	14:25	3A164	YFT	Departure	12.7	-	-
4-Aug	14:56	3A065	YFT	Arrival	12.2	-	-
4-Aug	16:19	3A167	YFT	Departure	12.6	-	-
4-Aug	17:03	3A067	YFT	Arrival	12.3	-	-
4-Aug	17:09	3A083	ZUI	Arrival	13	-	-
4-Aug	17:29	3A183	ZUI	Departure	11.5	-	-
4-Aug	18:13	8S126	XZM	Departure	12.7	-	-
4-Aug	20:51	3A084	ZUI	Arrival	11.8	-	-
4-Aug	20:53	8S2113	XZM	Arrival	12.6	-	-
4-Aug	21:02	3A185	ZUI	Departure	13.5	-	-
5-Aug	8:55	3A061	YFT	Arrival	12.1	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
5-Aug	10:07	3A081	ZUI	Arrival	12.5	-	-
5-Aug	10:27	8S212	XZM	Arrival	10.9	-	-
5-Aug	10:35	3A181	ZUI	Departure	13.5	-	-
5-Aug	11:03	8S121	XZM	Departure	12.6	-	-
5-Aug	11:07	3A063	YFT	Arrival	12.2	-	-
5-Aug	12:36	8S215	XZM	Arrival	13.6	-	-
5-Aug	12:54	3A064	YFT	Arrival	11.9	-	-
5-Aug	14:00	3A082	ZUI	Arrival	13.2	-	-
5-Aug	14:12	3A164	YFT	Departure	12.1	-	-
5-Aug	14:15	3A182	ZUI	Departure	12.3	-	-
5-Aug	14:55	3A065	YFT	Arrival	12.6	-	-
5-Aug	16:14	3A167	YFT	Departure	12.6	-	-
5-Aug	16:57	3A067	YFT	Arrival	12.5	-	-
5-Aug	17:02	3A083	ZUI	Arrival	12.7	-	-
5-Aug	17:21	3A183	ZUI	Departure	11.4	-	-
5-Aug	17:59	8S126	XZM	Departure	12.8	-	-
5-Aug	20:44	3A084	ZUI	Arrival	11.9	-	-
5-Aug	20:57	8S2113	XZM	Arrival	12.8	-	-
5-Aug	21:04	3A185	ZUI	Departure	13	-	-
6-Aug	8:58	3A061	YFT	Arrival	11.4	-	-
6-Aug	10:05	3A081	ZUI	Arrival	12.3	-	-
6-Aug	10:19	8S212	XZM	Arrival	12.5	-	-
6-Aug	10:34	3A181	ZUI	Departure	13.3	-	-
6-Aug	10:58	3A063	YFT	Arrival	11.8	-	-
6-Aug	11:02	8S121	XZM	Departure	13.3	-	-
6-Aug	12:36	8S215	XZM	Arrival	12.5	-	-
6-Aug	12:56	3A064	YFT	Arrival	12.3	-	-
6-Aug	13:56	3A082	ZUI	Arrival	12.7	-	-
6-Aug	14:11	3A182	ZUI	Departure	13.1	-	-
6-Aug	14:13	3A164	YFT	Departure	12.1	-	-
6-Aug	14:56	3A065	YFT	Arrival	11.7	-	-
6-Aug	16:21	3A167	YFT	Departure	12.1	-	-
6-Aug	16:58	3A083	ZUI	Arrival	13.1	-	-
6-Aug	17:00	3A067	YFT	Arrival	12.4	-	-
6-Aug	17:36	3A183	ZUI	Departure	12	-	-
6-Aug	18:08	8S126	XZM	Departure	12.4	-	-
6-Aug	20:51	3A084	ZUI	Arrival	12.7	-	-
6-Aug	20:55	8S2113	XZM	Arrival	12.9	-	-
6-Aug	21:09	3A185	ZUI	Departure	12.7	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
7-Aug	8:56	3A061	YFT	Arrival	12.6	-	-
7-Aug	10:05	3A081	ZUI	Arrival	12.7	-	-
7-Aug	10:20	8S212	XZM	Arrival	11.4	-	-
7-Aug	10:34	3A181	ZUI	Departure	13.1	-	-
7-Aug	10:56	3A063	YFT	Arrival	12.5	-	-
7-Aug	11:07	8S121	XZM	Departure	11.7	<= 5	< 2min
7-Aug	12:43	8S215	XZM	Arrival	12.9	-	-
7-Aug	12:59	3A064	YFT	Arrival	11.7	-	-
7-Aug	13:57	3A082	ZUI	Arrival	12.9	-	-
7-Aug	14:16	3A164	YFT	Departure	11.1	-	-
7-Aug	14:17	3A182	ZUI	Departure	13.3	-	-
7-Aug	14:57	3A065	YFT	Arrival	12	-	-
7-Aug	16:18	3A167	YFT	Departure	13.3	-	-
7-Aug	16:59	3A067	YFT	Arrival	11.9	-	-
7-Aug	17:08	3A083	ZUI	Arrival	13.4	-	-
7-Aug	17:22	3A183	ZUI	Departure	12.2	-	-
7-Aug	18:12	8S126	XZM	Departure	13.7	-	-
7-Aug	20:39	3A084	ZUI	Arrival	12.8	-	-
7-Aug	20:57	3A185	ZUI	Departure	12.4	-	-
7-Aug	20:57	8S2113	XZM	Arrival	12.9	-	-
8-Aug	8:52	3A061	YFT	Arrival	12.2	-	-
8-Aug	9:51	3A081	ZUI	Arrival	12.4	-	-
8-Aug	10:21	8S212	XZM	Arrival	12.4	-	-
8-Aug	10:27	3A181	ZUI	Departure	12.9	-	-
8-Aug	10:52	3A063	YFT	Arrival	12.2	-	-
8-Aug	10:58	8S121	XZM	Departure	12.6	-	-
8-Aug	12:45	8S215	XZM	Arrival	12	-	-
8-Aug	13:00	3A064	YFT	Arrival	9.8	-	-
8-Aug	14:08	3A082	ZUI	Arrival	12.7	-	-
8-Aug	14:14	3A164	YFT	Departure	12.3	-	-
8-Aug	14:19	3A182	ZUI	Departure	12.9	-	-
8-Aug	14:53	3A065	YFT	Arrival	13.2	-	-
8-Aug	16:15	3A167	YFT	Departure	12.2	-	-
8-Aug	16:56	3A067	YFT	Arrival	11.3	-	-
8-Aug	17:00	3A083	ZUI	Arrival	12.7	-	-
8-Aug	17:34	3A183	ZUI	Departure	12.6	-	-
8-Aug	18:12	8S126	XZM	Departure	12.4	-	-
8-Aug	20:49	3A084	ZUI	Arrival	12.7	-	-
8-Aug	21:02	3A185	ZUI	Departure	12.5	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
8-Aug	21:05	8S2113	XZM	Arrival	12.4	-	-
9-Aug	8:53	3A061	YFT	Arrival	12.2	1	-
9-Aug	9:57	3A081	ZUI	Arrival	13.2	-	-
9-Aug	10:22	8S212	XZM	Arrival	12.9	-	-
9-Aug	10:25	3A181	ZUI	Departure	12.3	-	-
9-Aug	10:59	3A063	YFT	Arrival	11.8	-	-
9-Aug	11:04	8S121	XZM	Departure	12.9	-	-
9-Aug	12:40	8S215	XZM	Arrival	12.2	-	-
9-Aug	12:57	3A064	YFT	Arrival	12.3	-	-
9-Aug	13:58	3A082	ZUI	Arrival	12.5	-	-
9-Aug	14:19	3A182	ZUI	Departure	12.7	-	-
9-Aug	14:22	3A164	YFT	Departure	11.9	-	-
9-Aug	14:54	3A065	YFT	Arrival	12.1	-	-
9-Aug	16:22	3A167	YFT	Departure	13	-	-
9-Aug	16:53	3A067	YFT	Arrival	12.3	-	-
9-Aug	17:04	3A083	ZUI	Arrival	12.6	-	-
9-Aug	17:29	3A183	ZUI	Departure	13.4	-	-
9-Aug	18:20	8S126	XZM	Departure	13.5	-	-
9-Aug	21:04	8S2113	XZM	Arrival	11.9	-	-
9-Aug	21:06	3A084	ZUI	Arrival	12.5	-	-
9-Aug	21:20	3A185	ZUI	Departure	12.6	-	-
10-Aug	7:18	8S1288	XZM	Departure	12.7	-	-
10-Aug	8:59	3A061	YFT	Arrival	11.9	-	-
10-Aug	10:00	3A081	ZUI	Arrival	12.9	-	1
10-Aug	10:17	8S212	XZM	Arrival	13	-	1
10-Aug	10:33	3A181	ZUI	Departure	12.3	-	-
10-Aug	11:05	3A063	YFT	Arrival	12.8	-	-
10-Aug	11:08	8S121	XZM	Departure	12.5	-	-
10-Aug	12:46	8S215	XZM	Arrival	12.8	-	-
10-Aug	12:56	3A064	YFT	Arrival	11.6	-	-
10-Aug	13:58	3A082	ZUI	Arrival	12.6	-	-
10-Aug	14:16	3A164	YFT	Departure	11.4	-	-
10-Aug	14:19	3A182	ZUI	Departure	12.9	-	-
10-Aug	14:59	3A065	YFT	Arrival	12.4	-	-
10-Aug	16:18	3A167	YFT	Departure	12.9	-	-
10-Aug	16:54	3A067	YFT	Arrival	11.7	-	-
10-Aug	17:04	3A083	ZUI	Arrival	12.2	-	-
10-Aug	17:20	3A183	ZUI	Departure	13.4	-	-
10-Aug	19:22	8S126	XZM	Departure	11.4	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM - Macao (Maritime Ferry Terminal) YFT - Macao (Taipa)  ZUI - Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
10-Aug	21:00	3A084	ZUI	Arrival	12.9	1	-
10-Aug	21:02	8S2113	XZM	Arrival	13.1	-	-
10-Aug	21:14	3A185	ZUI	Departure	12.8	1	-
11-Aug	8:56	3A061	YFT	Arrival	12	-	-
11-Aug	10:03	3A081	ZUI	Arrival	12.4	-	-
11-Aug	10:05	8S212	XZM	Arrival	12.3	-	-
11-Aug	10:27	3A181	ZUI	Departure	11.3	-	-
11-Aug	10:53	3A063	YFT	Arrival	13	-	-
11-Aug	11:08	8S121	XZM	Departure	12.9	-	-
11-Aug	12:35	8S215	XZM	Arrival	12.3	-	-
11-Aug	12:56	3A064	YFT	Arrival	12.4	-	-
11-Aug	13:46	3A082	ZUI	Arrival	12.3	-	-
11-Aug	14:15	3A182	ZUI	Departure	12	-	-
11-Aug	14:17	3A164	YFT	Departure	12.5	-	-
11-Aug	14:57	3A065	YFT	Arrival	11.5	-	-
11-Aug	16:21	3A167	YFT	Departure	13.1	-	-
11-Aug	16:48	3A083	ZUI	Arrival	12.5	-	-
11-Aug	17:05	3A067	YFT	Arrival	12.4	-	-
11-Aug	17:19	3A183	ZUI	Departure	12.9	-	-
11-Aug	19:19	8S127	XZM	Departure	11.8	-	-
11-Aug	20:40	3A084	ZUI	Arrival	12.3	-	-
11-Aug	20:57	8S2113	XZM	Arrival	11.3	-	-
11-Aug	21:23	3A185	ZUI	Departure	13	-	-
12-Aug	8:57	3A061	YFT	Arrival	12.2	-	1
12-Aug	10:04	3A081	ZUI	Arrival	12.7	-	-
12-Aug	10:07	8S212	XZM	Arrival	12.2	-	-
12-Aug	10:34	3A181	ZUI	Departure	11.9	-	-
12-Aug	10:52	3A063	YFT	Arrival	12.6	-	-
12-Aug	11:11	8S121	XZM	Departure	12.4	-	-
12-Aug	12:43	8S215	XZM	Arrival	12	-	-
12-Aug	12:52	3A064	YFT	Arrival	12.3	-	-
12-Aug	13:58	3A082	ZUI	Arrival	12	-	-
12-Aug	14:17	3A164	YFT	Departure	12.1	-	-
12-Aug	14:18	3A182	ZUI	Departure	12	-	-
12-Aug	14:58	3A065	YFT	Arrival	11.8	-	-
12-Aug	16:18	3A167	YFT	Departure	12.7	-	-
12-Aug	16:55	3A067	YFT	Arrival	11.8	-	-
12-Aug	17:05	3A083	ZUI	Arrival	11.9	-	-
12-Aug	18:25	8S126	XZM	Departure	12.9	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
12-Aug	19:02	3A183	ZUI	Departure	12.3	-	-
12-Aug	21:10	3A168	YFT	Departure	12.9	-	-
13-Aug	9:01	3A061	YFT	Arrival	11.1	-	-
13-Aug	10:01	3A081	ZUI	Arrival	12.7	-	-
13-Aug	10:17	8S212	XZM	Arrival	12.2	-	-
13-Aug	10:25	3A181	ZUI	Departure	12.4	-	-
13-Aug	10:52	3A063	YFT	Arrival	12.6	-	-
13-Aug	11:11	8S121	XZM	Departure	12.2	-	-
13-Aug	12:43	8S215	XZM	Arrival	11.4	-	-
13-Aug	13:13	3A064	YFT	Arrival	12.1	-	-
13-Aug	13:59	3A082	ZUI	Arrival	12	-	-
13-Aug	14:18	3A182	ZUI	Departure	11.9	-	-
13-Aug	14:19	3A164	YFT	Departure	12	-	-
13-Aug	14:55	3A065	YFT	Arrival	12.4	-	-
13-Aug	16:31	3A167	YFT	Departure	12.3	-	-
13-Aug	17:01	3A067	YFT	Arrival	11.6	-	-
13-Aug	17:05	3A083	ZUI	Arrival	12.2	-	-
13-Aug	17:37	3A183	ZUI	Departure	13	-	-
13-Aug	18:20	8S126	XZM	Departure	13	-	-
13-Aug	21:06	3A084	ZUI	Arrival	12.3	-	-
13-Aug	21:11	3A185	ZUI	Departure	13.5	-	-
14-Aug	8:56	3A061	YFT	Arrival	12.8	-	-
14-Aug	10:01	3A081	ZUI	Arrival	12.1	-	-
14-Aug	10:19	8S212	XZM	Arrival	11.5	-	1
14-Aug	10:34	3A181	ZUI	Departure	12.4	-	-
14-Aug	10:55	3A063	YFT	Arrival	11.7	-	-
14-Aug	11:02	8S121	XZM	Departure	12.7	-	-
14-Aug	12:35	8S215	XZM	Arrival	12.8	-	-
14-Aug	12:55	3A064	YFT	Arrival	13.1	-	-
14-Aug	13:45	3A082	ZUI	Arrival	13.5**	-	-
14-Aug	14:18	3A182	ZUI	Departure	12.5	-	-
14-Aug	14:22	3A164	YFT	Departure	12.4	-	-
14-Aug	14:58	3A065	YFT	Arrival	11.9	-	-
14-Aug	16:25	3A167	YFT	Departure	12	-	-
14-Aug	16:57	3A083	ZUI	Arrival	13.4	-	-
14-Aug	16:59	3A067	YFT	Arrival	12.7	-	-
14-Aug	17:26	3A183	ZUI	Departure	12.3	-	-
14-Aug	18:12	8S126	XZM	Departure	11.6	-	-
14-Aug	20:33	3A084	ZUI	Arrival	13	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
14-Aug	21:00	3A185	ZUI	Departure	12.1**	1	-
14-Aug	21:03	8S2113	XZM	Arrival	11.5	-	-
15-Aug	8:51	3A061	YFT	Arrival	12.4	1	-
15-Aug	9:58	3A081	ZUI	Arrival	11.6	-	-
15-Aug	10:20	8S212	XZM	Arrival	13.2	-	-
15-Aug	10:20	3A181	ZUI	Departure	13.1	-	-
15-Aug	10:57	3A063	YFT	Arrival	12.9	-	-
15-Aug	11:11	8S121	XZM	Departure	13.5	-	-
15-Aug	12:55	3A064	YFT	Arrival	13.3	-	-
15-Aug	12:58	8S215	XZM	Arrival	11.7	-	-
15-Aug	13:43	3A082	ZUI	Arrival	12.6	-	-
15-Aug	14:17	3A164	YFT	Departure	13	-	-
15-Aug	14:21	3A182	ZUI	Departure	12.7	-	-
15-Aug	14:56	3A065	YFT	Arrival	12.2	-	-
15-Aug	16:21	3A167	YFT	Departure	12.7	-	-
15-Aug	16:48	3A083	ZUI	Arrival	12.8	-	-
15-Aug	16:56	3A067	YFT	Arrival	12.9	-	-
15-Aug	17:30	3A183	ZUI	Departure	12.7	-	-
15-Aug	18:32	8S126	XZM	Departure	12.4	-	-
15-Aug	20:31	3A084	ZUI	Arrival	12.5	-	-
15-Aug	20:48	8S2113	XZM	Arrival	13.2	-	-
15-Aug	21:16	3A185	ZUI	Departure	13.2	-	-
16-Aug	8:55	3A061	YFT	Arrival	12.4	-	-
16-Aug	10:09	3A081	ZUI	Arrival	11.9	-	1
16-Aug	10:15	8S212	XZM	Arrival	10.9	-	-
16-Aug	10:41	3A181	ZUI	Departure	13.1	-	-
16-Aug	10:56	3A063	YFT	Arrival	12.1	-	-
16-Aug	11:02	8S121	XZM	Departure	11.2	-	-
16-Aug	12:46	8S215	XZM	Arrival	12.8	-	-
16-Aug	12:55	3A064	YFT	Arrival	13.2	-	-
16-Aug	14:06	3A082	ZUI	Arrival	12.8	-	-
16-Aug	14:27	3A164	YFT	Departure	13.4	-	-
16-Aug	14:29	3A182	ZUI	Departure	11.8	-	-
16-Aug	15:06	3A065	YFT	Arrival	12	-	-
16-Aug	16:14	3A167	YFT	Departure	12.1	-	-
16-Aug	17:00	3A067	YFT	Arrival	12.5	-	-
16-Aug	17:15	3A083	ZUI	Arrival	12.3	-	-
16-Aug	17:30	3A183	ZUI	Departure	12	-	-
16-Aug	18:14	8S126	XZM	Departure	13	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
16-Aug	20:43	3A084	ZUI	Arrival	12.3	1	-
16-Aug	21:02	3A185	ZUI	Departure	13.2	-	-
16-Aug	21:12	8S2113	XZM	Arrival	10.9	-	-
17-Aug	8:54	3A061	YFT	Arrival	12.2	-	-
17-Aug	10:11	3A081	ZUI	Arrival	12.3	-	-
17-Aug	10:19	8S212	XZM	Arrival	12.3	-	-
17-Aug	10:39	3A181	ZUI	Departure	12.9	-	-
17-Aug	11:06	8S121	XZM	Departure	13.5	-	-
17-Aug	11:11	3A063	YFT	Arrival	12	-	-
17-Aug	12:47	8S215	XZM	Arrival	12.6	-	-
17-Aug	12:55	3A064	YFT	Arrival	11.3	-	-
17-Aug	13:58	3A082	ZUI	Arrival	12.8	-	-
17-Aug	14:15	3A164	YFT	Departure	12.5	-	-
17-Aug	14:17	3A182	ZUI	Departure	12.2	-	-
17-Aug	14:52	3A065	YFT	Arrival	12.8	-	-
17-Aug	16:20	3A167	YFT	Departure	12.8	-	-
17-Aug	16:57	3A067	YFT	Arrival	12.6	-	-
17-Aug	17:02	3A083	ZUI	Arrival	12.5	-	-
17-Aug	17:20	3A183	ZUI	Departure	11.4	-	-
17-Aug	18:31	8S126	XZM	Departure	12.9	-	-
17-Aug	21:03	8S2113	XZM	Arrival	11.5	-	-
17-Aug	21:13	3A084	ZUI	Arrival	11.8	-	-
17-Aug	21:31	3A185	ZUI	Departure	13.3	-	-
18-Aug	8:52	3A061	YFT	Arrival	11.8	-	1
18-Aug	10:03	3A081	ZUI	Arrival	12	-	1
18-Aug	10:18	8S212	XZM	Arrival	11.2	-	-
18-Aug	10:38	3A181	ZUI	Departure	13	-	-
18-Aug	11:04	8S121	XZM	Departure	13.2	-	-
18-Aug	11:04	3A063	YFT	Arrival	11.5	-	-
18-Aug	12:46	8S215	XZM	Arrival	11.2	-	-
18-Aug	13:03	3A064	YFT	Arrival	12.7	-	-
18-Aug	13:59	3A082	ZUI	Arrival	12.9	-	-
18-Aug	14:17	3A164	YFT	Departure	12.9	-	-
18-Aug	14:20	3A182	ZUI	Departure	12.1	-	-
18-Aug	14:58	3A065	YFT	Arrival	11.4	-	-
18-Aug	16:16	3A167	YFT	Departure	11.3	-	-
18-Aug	16:55	3A067	YFT	Arrival	11.4	-	-
18-Aug	17:10	3A083	ZUI	Arrival	12.3	-	-
18-Aug	17:28	3A183	ZUI	Departure	11.7	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM - Macao (Maritime Ferry Terminal) YFT - Macao (Taipa)  ZUL - Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
18-Aug	18:15	8S126	XZM	Departure	13.5	1	-
18-Aug	20:42	3A084	ZUI	Arrival	12.3	-	-
18-Aug	20:56	3A185	ZUI	Departure	13.5	1	-
18-Aug	21:01	8S2113	XZM	Arrival	12	-	-
19-Aug	9:14	3A061	YFT	Arrival	11.1	-	-
19-Aug	10:00	3A081	ZUI	Arrival	12.4	-	-
19-Aug	10:21	8S212	XZM	Arrival	10.5	-	-
19-Aug	10:33	3A181	ZUI	Departure	13.1	-	-
19-Aug	11:01	3A063	YFT	Arrival	12	-	-
19-Aug	11:15	8S121	XZM	Departure	12.6	-	-
19-Aug	12:35	8S215	XZM	Arrival	12.7	-	-
19-Aug	12:57	3A064	YFT	Arrival	13.1	-	-
19-Aug	14:03	3A082	ZUI	Arrival	12.9	-	-
19-Aug	14:16	3A164	YFT	Departure	13.2	-	-
19-Aug	14:17	3A182	ZUI	Departure	12.3	-	-
19-Aug	14:55	3A065	YFT	Arrival	12.9	-	-
19-Aug	16:23	3A167	YFT	Departure	11.5	-	-
19-Aug	17:05	3A067	YFT	Arrival	13.4	<= 5	< 1min
19-Aug	17:08	3A083	ZUI	Arrival	13.2	-	-
19-Aug	17:21	3A183	ZUI	Departure	11.7	-	-
19-Aug	18:08	8S126	XZM	Departure	12.7	-	-
19-Aug	20:50	8S2113	XZM	Arrival	12.1	-	-
19-Aug	20:51	3A084	ZUI	Arrival	12.5	-	-
19-Aug	21:06	3A185	ZUI	Departure	13.7	-	-
20-Aug	10:03	3A081	ZUI	Arrival	12.5	-	-
20-Aug	10:15	8S212	XZM	Arrival	11.6	-	-
20-Aug	10:35	3A181	ZUI	Departure	13.1	-	-
20-Aug	10:55	3A063	YFT	Arrival	12.1	-	-
20-Aug	10:58	8S121	XZM	Departure	12.9	-	-
20-Aug	12:40	8S215	XZM	Arrival	12.9	-	-
20-Aug	12:58	3A064	YFT	Arrival	12.7	-	-
20-Aug	14:00	3A082	ZUI	Arrival	12.4	-	-
20-Aug	14:16	3A182	ZUI	Departure	12.9	-	-
20-Aug	14:23	3A164	YFT	Departure	13	-	-
20-Aug	14:56	3A065	YFT	Arrival	11.9	-	-
20-Aug	16:21	3A167	YFT	Departure	12.3	-	-
20-Aug	17:00	3A067	YFT	Arrival	12	<= 5	< 1min
20-Aug	17:02	3A083	ZUI	Arrival	13	-	-
20-Aug	17:20	3A183	ZUI	Departure	12.2	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
20-Aug	18:06	8S126	XZM	Departure	13	-	-
20-Aug	20:40	3A084	ZUI	Arrival	12.5	-	-
20-Aug	21:08	8S2113	XZM	Arrival	12.1	-	-
20-Aug	21:10	3A185	ZUI	Departure	13.3	-	-
21-Aug	8:56	3A061	YFT	Arrival	12.2	-	-
21-Aug	10:06	3A081	ZUI	Arrival	12.2	-	-
21-Aug	10:28	8S212	XZM	Arrival	12.6	-	-
21-Aug	10:33	3A181	ZUI	Departure	13.3	-	-
21-Aug	10:54	3A063	YFT	Arrival	11.6	-	-
21-Aug	11:11	8S121	XZM	Departure	12.6	-	-
21-Aug	12:33	8S215	XZM	Arrival	12.9	-	-
21-Aug	12:55	3A064	YFT	Arrival	11.9	-	-
21-Aug	13:58	3A082	ZUI	Arrival	13.1	-	-
21-Aug	14:17	3A164	YFT	Departure	12.4	-	-
21-Aug	14:17	3A182	ZUI	Departure	12.7	-	-
21-Aug	14:56	3A065	YFT	Arrival	12.7	-	-
21-Aug	16:18	3A167	YFT	Departure	12.2	-	-
21-Aug	16:52	3A067	YFT	Arrival	13	-	-
21-Aug	17:00	3A083	ZUI	Arrival	13	-	-
21-Aug	17:26	3A183	ZUI	Departure	12.4	-	-
21-Aug	18:10	8S126	XZM	Departure	13.5	-	-
21-Aug	20:40	3A084	ZUI	Arrival	12.6	-	-
21-Aug	20:52	8S2113	XZM	Arrival	12.4	-	-
21-Aug	20:56	3A185	ZUI	Departure	12.8	-	-
22-Aug	9:00	3A061	YFT	Arrival	12.3	-	-
22-Aug	9:58	3A081	ZUI	Arrival	12	-	-
22-Aug	10:04	8S212	XZM	Arrival	12.9	-	-
22-Aug	10:30	3A181	ZUI	Departure	13.1	-	-
22-Aug	10:57	3A063	YFT	Arrival	12.7	-	-
22-Aug	11:11	8S121	XZM	Departure	12.5	-	-
22-Aug	12:37	8S215	XZM	Arrival	11.3	-	-
22-Aug	13:01	3A064	YFT	Arrival	11.7	-	-
22-Aug	13:53	3A082	ZUI	Arrival	12.9	-	-
22-Aug	14:15	3A182	ZUI	Departure	12.7	-	-
22-Aug	14:18	3A164	YFT	Departure	12.2	-	-
22-Aug	14:53	3A065	YFT	Arrival	11.7	-	-
22-Aug	16:18	3A167	YFT	Departure	13.1	-	
22-Aug	16:47	3A083	ZUI	Arrival	12.4	-	-
22-Aug	16:59	3A067	YFT	Arrival	12	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
22-Aug	17:18	3A183	ZUI	Departure	12.8	-	-
22-Aug	18:03	8S126	XZM	Departure	14.2	-	-
22-Aug	20:39	3A084	ZUI	Arrival	12.6	-	-
22-Aug	20:45	8S2113	XZM	Arrival	11.7	-	-
22-Aug	20:57	3A185	ZUI	Departure	12.9	-	-
23-Aug	8:56	3A061	YFT	Arrival	11.7	-	-
23-Aug	10:04	3A081	ZUI	Arrival	13	-	-
23-Aug	10:18	8S212	XZM	Arrival	12.5	-	-
23-Aug	10:33	3A181	ZUI	Departure	13	-	-
23-Aug	10:55	3A063	YFT	Arrival	11.9	-	-
23-Aug	11:02	8S121	XZM	Departure	13.1	-	-
23-Aug	12:42	8S215	XZM	Arrival	12.5	-	-
23-Aug	13:01	3A064	YFT	Arrival	11.8	-	-
23-Aug	13:59	3A082	ZUI	Arrival	12.3	-	-
23-Aug	14:13	3A164	YFT	Departure	12.3	-	-
23-Aug	14:17	3A182	ZUI	Departure	13.2	-	-
23-Aug	14:51	3A065	YFT	Arrival	12.9	-	-
23-Aug	16:27	3A167	YFT	Departure	13.1	-	-
23-Aug	16:57	3A067	YFT	Arrival	12.1	-	-
23-Aug	17:03	3A083	ZUI	Arrival	12.7	-	-
23-Aug	17:37	3A183	ZUI	Departure	12	-	-
23-Aug	18:05	8S126	XZM	Departure	12.6	-	-
23-Aug	20:39	3A084	ZUI	Arrival	12.5	-	-
23-Aug	20:54	8S2113	XZM	Arrival	12.3	-	-
23-Aug	20:56	3A185	ZUI	Departure	12.9	-	-
24-Aug	8:58	3A061	YFT	Arrival	12	-	-
24-Aug	10:02	3A081	ZUI	Arrival	13	-	-
24-Aug	10:23	8S212	XZM	Arrival	14.4	<= 5	< 3min
24-Aug	10:33	3A181	ZUI	Departure	12.8	-	-
24-Aug	11:03	3A063	YFT	Arrival	12	-	-
24-Aug	11:04	8S121	XZM	Departure	13.3	-	-
24-Aug	12:43	8S215	XZM	Arrival	12.2	-	-
24-Aug	12:50	3A064	YFT	Arrival	12.9	-	-
24-Aug	14:04	3A082	ZUI	Arrival	12.6	-	-
24-Aug	14:21	3A182	ZUI	Departure	12.9	-	-
24-Aug	14:23	3A164	YFT	Departure	13.2	-	-
24-Aug	14:56	3A065	YFT	Arrival	12.1	-	-
24-Aug	16:19	3A167	YFT	Departure	12.8	-	-
24-Aug	16:51	3A067	YFT	Arrival	13.5	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
24-Aug	17:14	3A083	ZUI	Arrival	13.1	-	-
24-Aug	17:44	3A183	ZUI	Departure	12.6	-	-
24-Aug	18:36	8S126	XZM	Departure	10.9	-	-
24-Aug	20:39	3A084	ZUI	Arrival	12.4	-	-
24-Aug	20:59	8S2113	XZM	Arrival	12.4	-	-
24-Aug	21:18	3A185	ZUI	Departure	13	-	-
25-Aug	8:53	3A061	YFT	Arrival	12.6	-	-
25-Aug	10:21	8S212	XZM	Arrival	11.3	-	-
25-Aug	10:22	3A081	ZUI	Arrival	12.8	-	-
25-Aug	10:33	3A181	ZUI	Departure	12.3	-	-
25-Aug	10:53	3A063	YFT	Arrival	13.1	-	-
25-Aug	11:07	8S121	XZM	Departure	12.1	-	-
25-Aug	12:48	8S215	XZM	Arrival	12.6	-	-
25-Aug	13:12	3A064	YFT	Arrival	11.6	-	-
25-Aug	14:03	3A082	ZUI	Arrival	12.6	-	-
25-Aug	14:14	3A164	YFT	Departure	11.3	-	-
25-Aug	14:20	3A182	ZUI	Departure	12.1	-	-
25-Aug	14:52	3A065	YFT	Arrival	12.5	-	-
25-Aug	16:26	3A167	YFT	Departure	13.4	-	-
25-Aug	16:56	3A067	YFT	Arrival	11.1	-	-
25-Aug	17:06	3A083	ZUI	Arrival	12.4	-	-
25-Aug	17:25	3A183	ZUI	Departure	12.8	-	-
25-Aug	18:26	8S126	XZM	Departure	13.1	-	-
25-Aug	20:37	3A084	ZUI	Arrival	12.8	-	-
25-Aug	20:54	8S2113	XZM	Arrival	11.8	-	-
25-Aug	21:15	3A185	ZUI	Departure	12.8	-	-
26-Aug	8:57	3A061	YFT	Arrival	12.7	-	-
26-Aug	10:04	3A081	ZUI	Arrival	13.1	-	-
26-Aug	10:20	8S212	XZM	Arrival	13	-	-
26-Aug	10:35	3A181	ZUI	Departure	12	-	-
26-Aug	10:58	3A063	YFT	Arrival	12.5	-	-
26-Aug	11:07	8S121	XZM	Departure	12.9	-	-
26-Aug	12:36	8S215	XZM	Arrival	11.8	-	-
26-Aug	13:00	3A064	YFT	Arrival	12.3	-	-
26-Aug	13:51	3A082	ZUI	Arrival	11.8	-	-
26-Aug	14:13	3A164	YFT	Departure	12.4	-	-
26-Aug	14:17	3A182	ZUI	Departure	12.1	-	-
26-Aug	14:53	3A065	YFT	Arrival	11	-	-
26-Aug	16:28	3A167	YFT	Departure	13.1	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
26-Aug	16:49	3A083	ZUI	Arrival	11.7	1	-
26-Aug	16:56	3A067	YFT	Arrival	12.2	-	-
26-Aug	17:21	3A183	ZUI	Departure	12.1	-	-
26-Aug	18:07	8S126	XZM	Departure	13.6	-	-
26-Aug	20:23	3A084	ZUI	Arrival	11.7	-	-
26-Aug	20:57	8S2113	XZM	Arrival	11.4	-	-
26-Aug	21:10	3A185	ZUI	Departure	13.2	-	-
27-Aug	8:54	3A061	YFT	Arrival	13.1	-	-
27-Aug	9:59	3A081	ZUI	Arrival	13.2	-	-
27-Aug	10:17	3A181	ZUI	Departure	12.1	-	-
27-Aug	10:23	8S212	XZM	Arrival	12.4	-	-
27-Aug	10:57	3A063	YFT	Arrival	11.7	-	-
27-Aug	11:08	8S121	XZM	Departure	12.7	-	-
27-Aug	12:38	8S215	XZM	Arrival	12.3	-	-
27-Aug	12:53	3A064	YFT	Arrival	12.2	-	-
27-Aug	14:00	3A082	ZUI	Arrival	12.4	-	-
27-Aug	14:12	3A164	YFT	Departure	12.6	-	-
27-Aug	14:15	3A182	ZUI	Departure	12	-	-
27-Aug	14:58	3A065	YFT	Arrival	12.6	-	-
27-Aug	16:13	3A167	YFT	Departure	12.7	-	-
27-Aug	16:54	3A067	YFT	Arrival	11.7	-	-
27-Aug	17:00	3A083	ZUI	Arrival	12	-	-
27-Aug	17:17	3A183	ZUI	Departure	13.2	-	-
27-Aug	18:03	8S126	XZM	Departure	13.3	-	-
27-Aug	20:42	3A084	ZUI	Arrival	12.2	-	-
27-Aug	20:54	8S2113	XZM	Arrival	12.4	-	-
27-Aug	20:59	3A185	ZUI	Departure	13.5	-	-
28-Aug	8:55	3A061	YFT	Arrival	12.3	-	-
28-Aug	10:03	3A081	ZUI	Arrival	13.1	-	-
28-Aug	10:17	8S212	XZM	Arrival	11.9	-	-
28-Aug	10:44	3A181	ZUI	Departure	12.2	-	-
28-Aug	10:54	3A063	YFT	Arrival	13.2	-	-
28-Aug	11:07	8S121	XZM	Departure	12.9	-	-
28-Aug	12:38	8S215	XZM	Arrival	13	-	-
28-Aug	12:57	3A064	YFT	Arrival	12.3	-	-
28-Aug	14:00	3A082	ZUI	Arrival	12.7	-	-
28-Aug	14:21	3A164	YFT	Departure	13.2	-	-
28-Aug	14:22	3A182	ZUI	Departure	11.7	-	-
28-Aug	15:01	3A065	YFT	Arrival	11.3	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM Macao (Maritime Ferry Terminal) YFT Macao (Taipa)  ZUI Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
28-Aug	16:19	3A167	YFT	Departure	12.6	1	-
28-Aug	16:58	3A067	YFT	Arrival	11.8	-	-
28-Aug	17:09	3A083	ZUI	Arrival	12.1	-	-
28-Aug	17:26	3A183	ZUI	Departure	13.1	-	-
28-Aug	18:07	8S126	XZM	Departure	13	-	-
28-Aug	20:42	3A084	ZUI	Arrival	12.3	-	-
28-Aug	20:53	8S2113	XZM	Arrival	12.5	-	-
28-Aug	20:56	3A185	ZUI	Departure	13.6	-	-
29-Aug	8:55	3A061	YFT	Arrival	12.5	-	-
29-Aug	10:04	3A081	ZUI	Arrival	13.8	-	-
29-Aug	10:14	8S212	XZM	Arrival	12.4	-	-
29-Aug	10:32	3A181	ZUI	Departure	12.5	-	-
29-Aug	10:55	3A063	YFT	Arrival	12.3	-	-
29-Aug	11:02	8S121	XZM	Departure	12.7	-	-
29-Aug	12:41	8S215	XZM	Arrival	12.4	-	-
29-Aug	13:00	3A064	YFT	Arrival	11	-	-
29-Aug	14:02	3A082	ZUI	Arrival	13	-	-
29-Aug	14:24	3A164	YFT	Departure	12	-	-
29-Aug	14:24	3A182	ZUI	Departure	8.9	-	-
29-Aug	14:55	3A065	YFT	Arrival	12.9	-	-
29-Aug	16:21	3A167	YFT	Departure	11.9	-	-
29-Aug	16:45	3A083	ZUI	Arrival	12.8	-	-
29-Aug	16:56	3A067	YFT	Arrival	12.3	-	-
29-Aug	17:25	3A183	ZUI	Departure	12.7	-	1
29-Aug	18:09	8S126	XZM	Departure	12.5	-	1
29-Aug	20:42	3A084	ZUI	Arrival	12.5	-	-
29-Aug	20:57	3A185	ZUI	Departure	0	-	-
29-Aug	20:59	8S2113	XZM	Arrival	12.7	-	-
30-Aug	8:52	3A061	YFT	Arrival	11.9	-	-
30-Aug	9:54	3A081	ZUI	Arrival	12.1	-	-
30-Aug	10:15	3A181	ZUI	Departure	12.6	1	-
30-Aug	10:23	8S212	XZM	Arrival	11.4	-	-
30-Aug	10:56	3A063	YFT	Arrival	13	-	-
30-Aug	11:10	8S121	XZM	Departure	12	-	-
30-Aug	12:40	8S215	XZM	Arrival	12.4	-	-
30-Aug	12:57	3A064	YFT	Arrival	12.4	-	-
30-Aug	13:51	3A082	ZUI	Arrival	12	-	-
30-Aug	14:21	3A164	YFT	Departure	12.9	-	-
30-Aug	14:23	3A182	ZUI	Departure	12.5	-	-

Date	Time [Arrival at / Departure from HKIA SkyPier]	Ferry No.	Connecting Port  [XZM - Macao (Maritime Ferry Terminal) YFT - Macao (Taipa)  ZUL - Zhuhai Jiuzhou]	Travel Direction [Arrival at / Departure from HKIA SkyPier]	Average Speed within Speed Control Zone (knots)	Extent of Instantaneous Speeding by SkyPier HSFs across SCZ (knots)	Duration of the Instantaneous Speeding (min)
30-Aug	15:01	3A065	YFT	Arrival	11.6	-	-
30-Aug	16:14	3A167	YFT	Departure	11.5	-	-
30-Aug	16:54	3A067	YFT	Arrival	11.9	-	-
30-Aug	17:01	3A083	ZUI	Arrival	12.6	-	-
30-Aug	17:30	3A183	ZUI	Departure	12.4	-	-
30-Aug	18:06	8S126	XZM	Departure	12.6	-	-
30-Aug	20:44	3A084	ZUI	Arrival	11.3	-	-
30-Aug	20:56	3A185	ZUI	Departure	11.7	-	-
30-Aug	20:59	8S2113	XZM	Arrival	11.5	-	-
31-Aug	8:56	3A061	YFT	Arrival	12.3	-	-
31-Aug	9:57	3A081	ZUI	Arrival	12.6	-	-
31-Aug	10:23	3A181	ZUI	Departure	12.8	-	-
31-Aug	10:23	8S212	XZM	Arrival	11.7	-	-
31-Aug	10:56	3A063	YFT	Arrival	12	-	-
31-Aug	11:07	8S121	XZM	Departure	12.3	-	-
31-Aug	12:41	8S215	XZM	Arrival	12	-	-
31-Aug	12:57	3A064	YFT	Arrival	11.6	-	-
31-Aug	14:01	3A082	ZUI	Arrival	12.9	-	-
31-Aug	14:16	3A182	ZUI	Departure	11.4	-	-
31-Aug	14:20	3A164	YFT	Departure	11.3	-	-
31-Aug	15:01	3A065	YFT	Arrival	12.1	-	-
31-Aug	16:24	3A167	YFT	Departure	12.7	-	-
31-Aug	16:54	3A067	YFT	Arrival	11.3	-	-
31-Aug	17:08	3A083	ZUI	Arrival	12.7	-	-
31-Aug	17:23	3A183	ZUI	Departure	12	-	-
31-Aug	18:27	8S126	XZM	Departure	13.1	-	-
31-Aug	20:47	3A084	ZUI	Arrival	12.1	-	-
31-Aug	20:55	8S2113	XZM	Arrival	11.5	-	-
31-Aug	20:58	3A185	ZUI	Departure	13.7	-	-

<sup>\*\*</sup> Insufficient or no AIS data for speed calculation.

#### Follow-up on instantaneous speeding

Referring to the data of SkyPier HSF movements in August 2019, instantaneous speeding (i.e. a sudden change in speed at over 15 knots for a short period of time) within the SCZ was recorded from 5 HSF movements of which the durations of all instantaneous speeding cases were less than 2 minutes. The AIS data and ferry operators' responses showed the cases were due to local strong water and giving way to vessels. The captains had reduced speed and maintained the speed at less than 15 knots after the incidents.

Two HSFs with insufficient transmission of AIS data were received in August 2019. Vessel captains were requested to provide the AIS plots to indicate the vessels entered the SCZ though the gate access points with no speeding in the SCZ.